



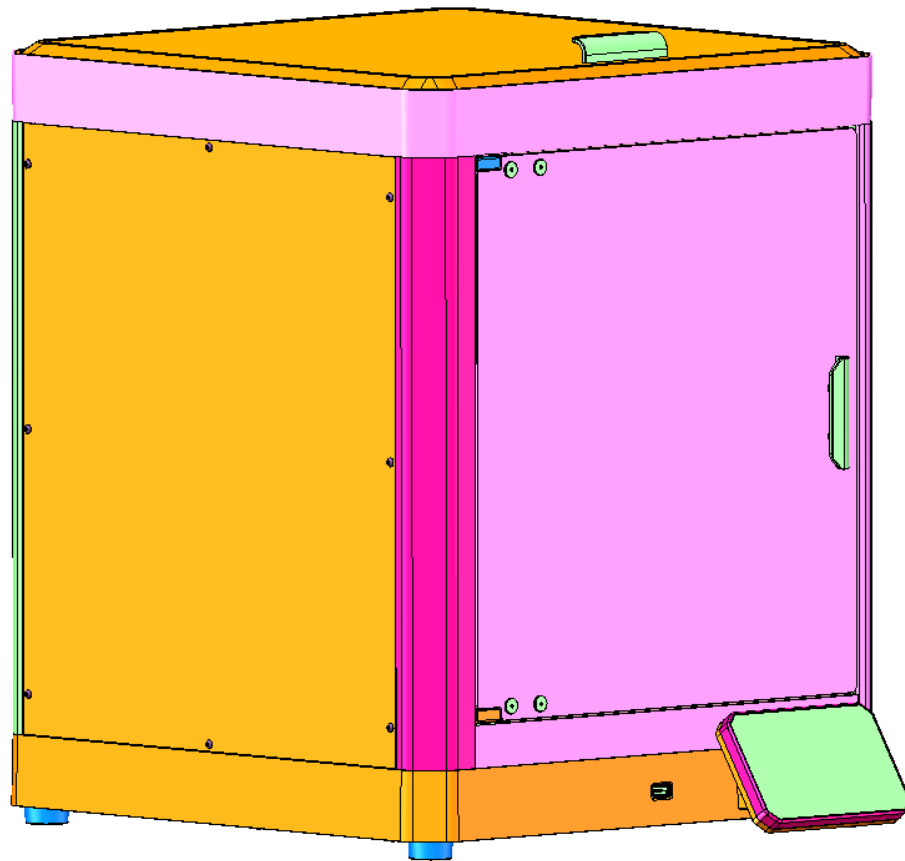



20.202.0042
裸机
Bare Machine

20.206.0042
Top Glass Cover Assembly
Cat # 001762

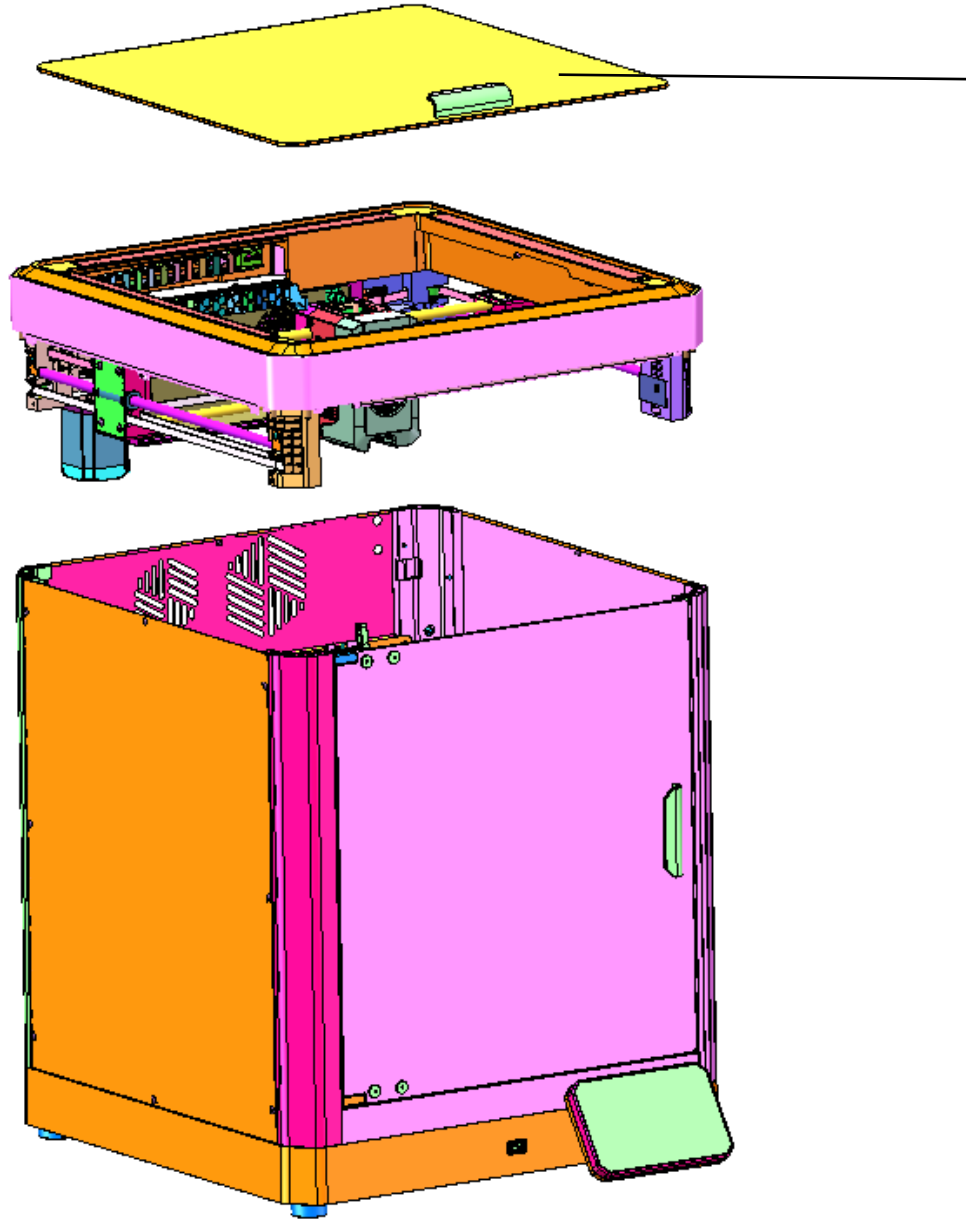


001762

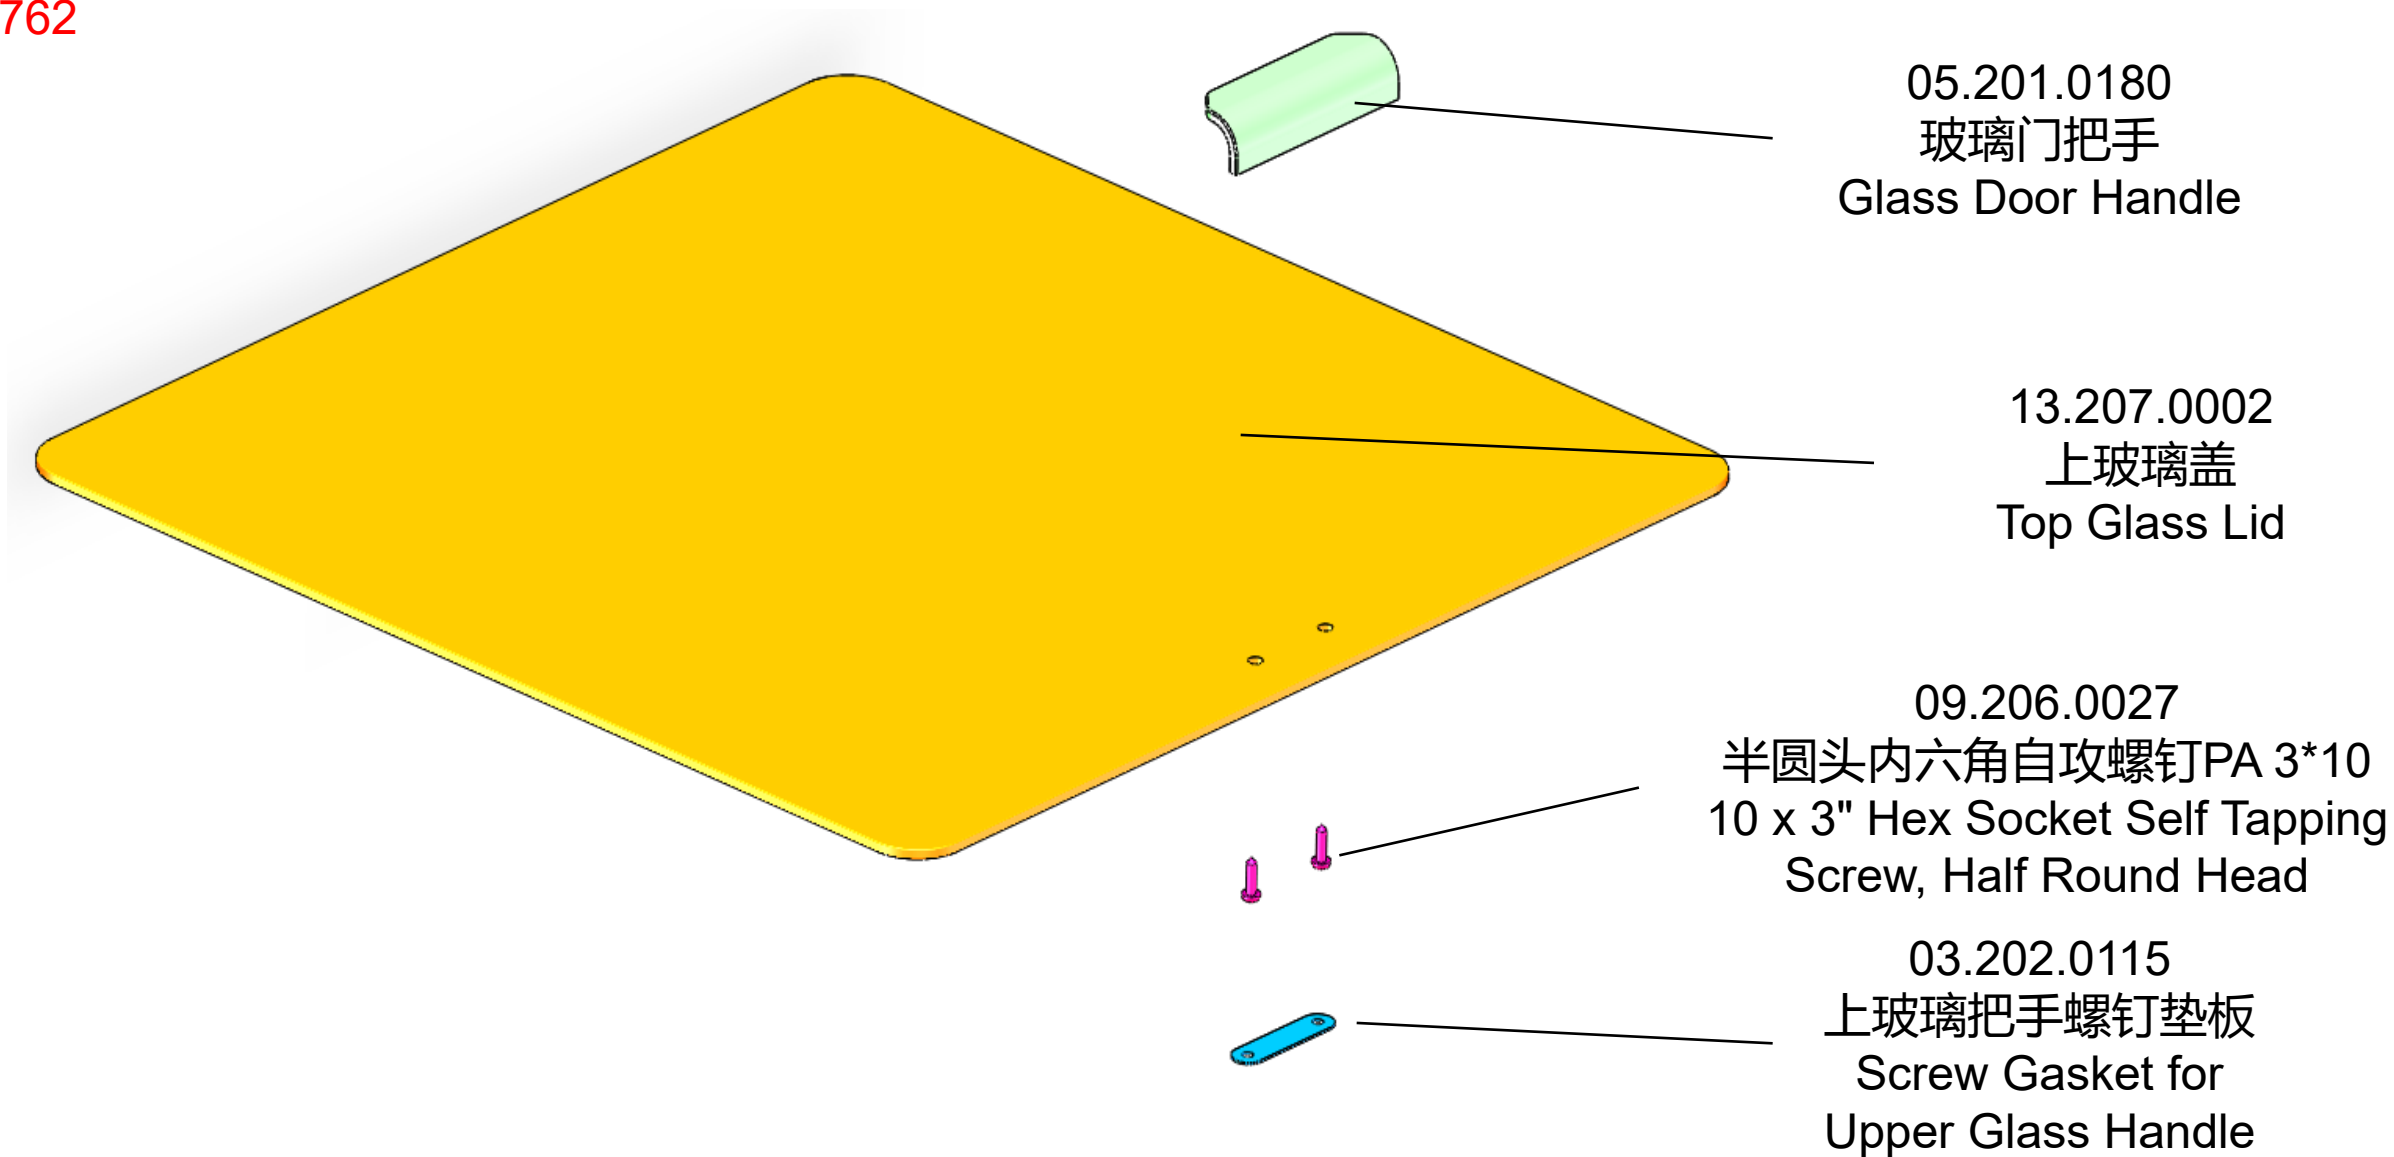


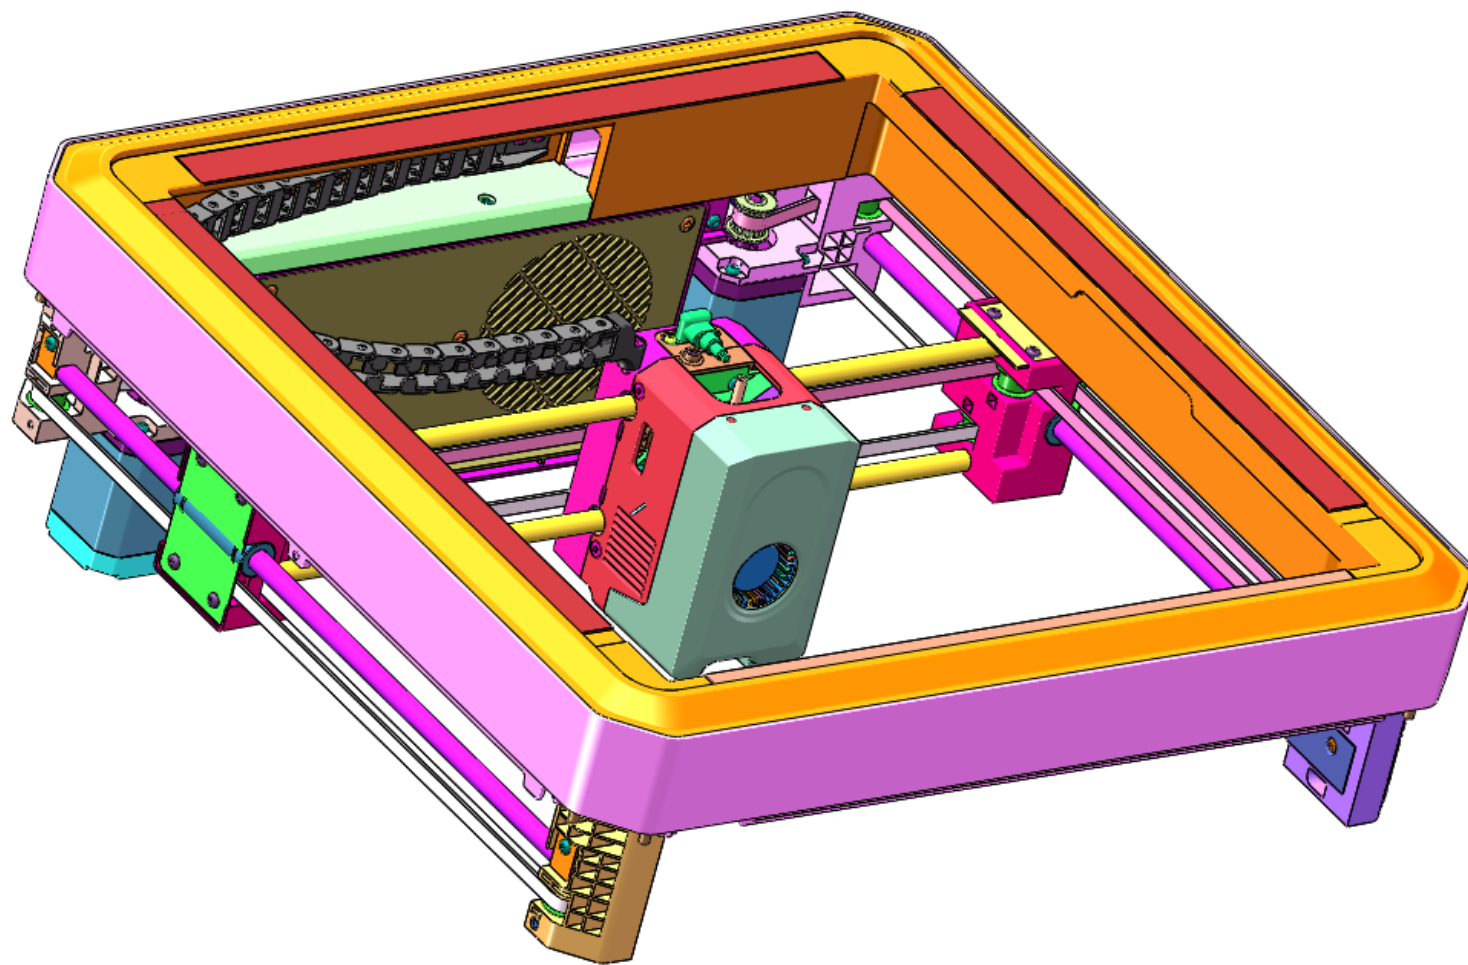


20.203.0077
上层运动套件
Upper Moving Kit

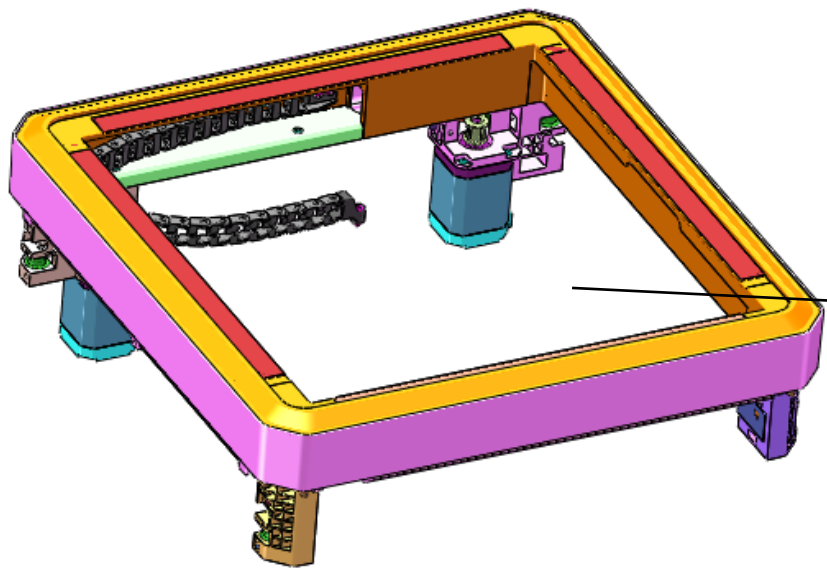

20.204.0192
上框架套件
Upper Frame Kit

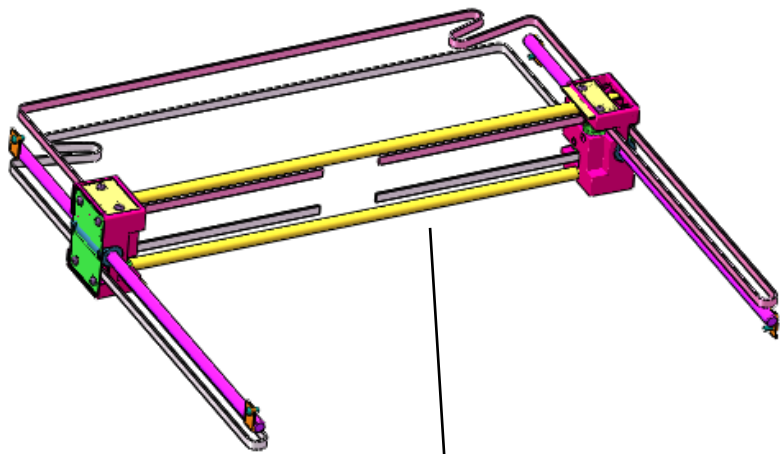


20.204.0193
XY轴套件
X & Y Axis Kit

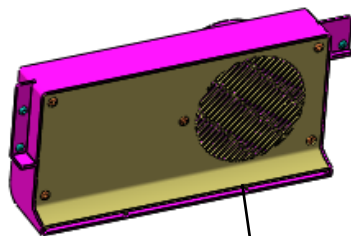

20.204.0194
辅助模型冷却风扇组件
Model Cooling Fan
Assembly



20.204.0195
挤出机套件
Extruder Kit

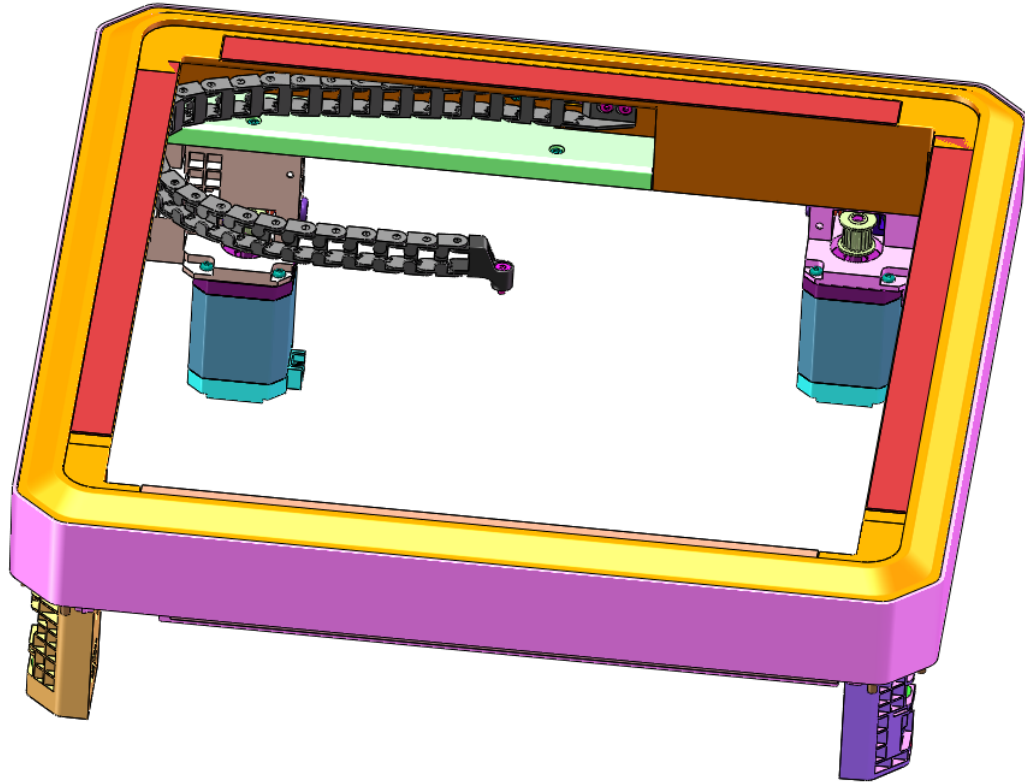

20.204.0192
上框架套件
Upper Frame Kit

20.205.0115
上框架塑料外壳组件
Top Frame Plastic
Housing Assembly

20.205.0110
XY轴惰轮张紧器组件
X & Y Axis Idler Tensioner
Assembly

20.205.0111
XY左电机座组件
X & Y Axis Left Motor
Base




20.205.0113
左前惰轮固定组件
Left Front Idler Fixation
Assembly


20.205.0110
XY轴惰轮张紧器组件
X & Y Axis Idler Tensioner
Assembly

20.205.0112
XY右电机座组件
X & Y Axis Right Motor
Base

20.205.0116
挤出头拖链组件
Extruder Cable Chain
Assembly


20.205.0114
右前惰轮固定组件
Right Front Idler
Fixation Assembly

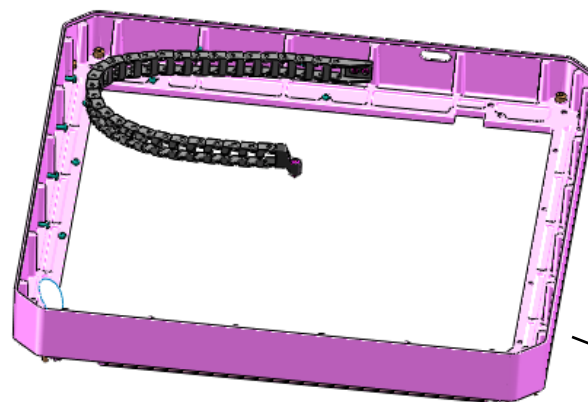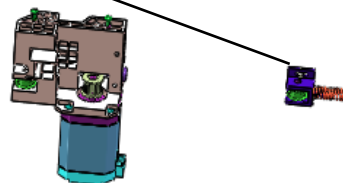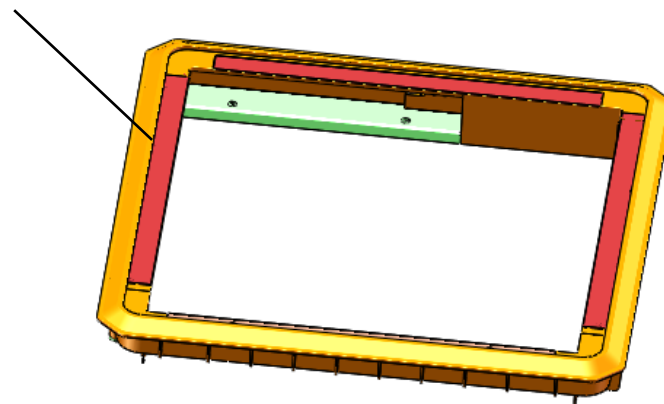


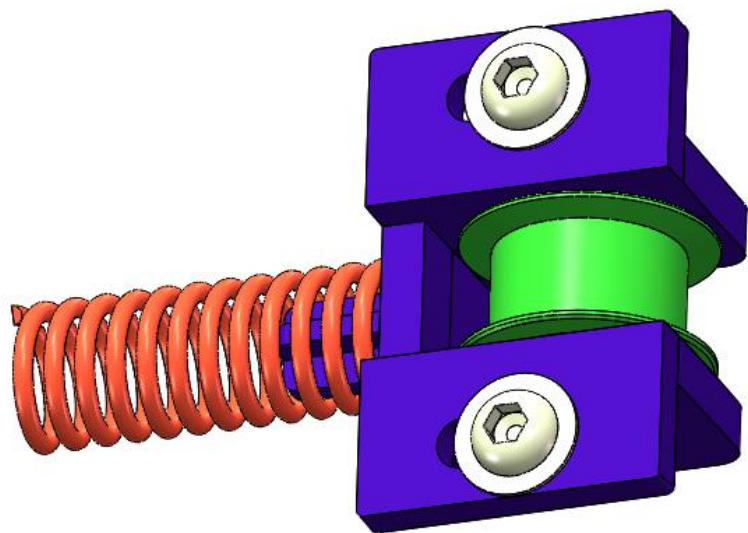


20.205.0110
XY轴惰轮张紧器组件
X & Y Axis Idler
Tensioner Assembly

09.202.0064
内六角半圆头带垫片螺钉 M3*6
M3 x 6 Half Round Head
Hex Socket Screw with Gasket

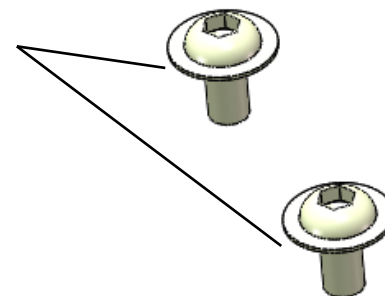


05.201.0214
XY轴皮带张紧惰轮支架
Idler Holder of the X & Y
Axis Belt Tensioner

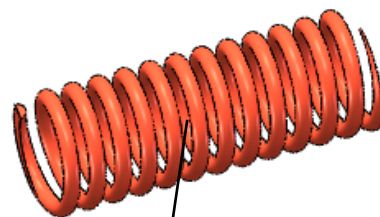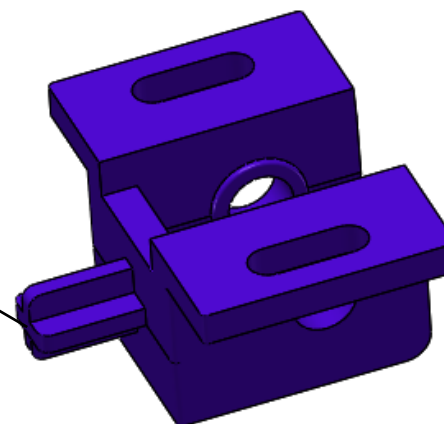


06.204.0017
X/Y轴同步带张紧弹簧
Tension Spring of the
X & Y Axis Timing Belt


06.210.0004
同步带惰轮
Idler of the
Timing Belt

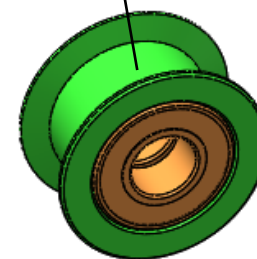

06.208.0004
φ5x15mm销钉轴
φ5 x 15 mm Pin Shaft

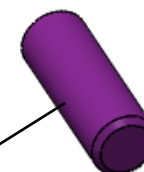

20.205.0111
XY左电机座组件
X & Y Axis Left Motor
Base

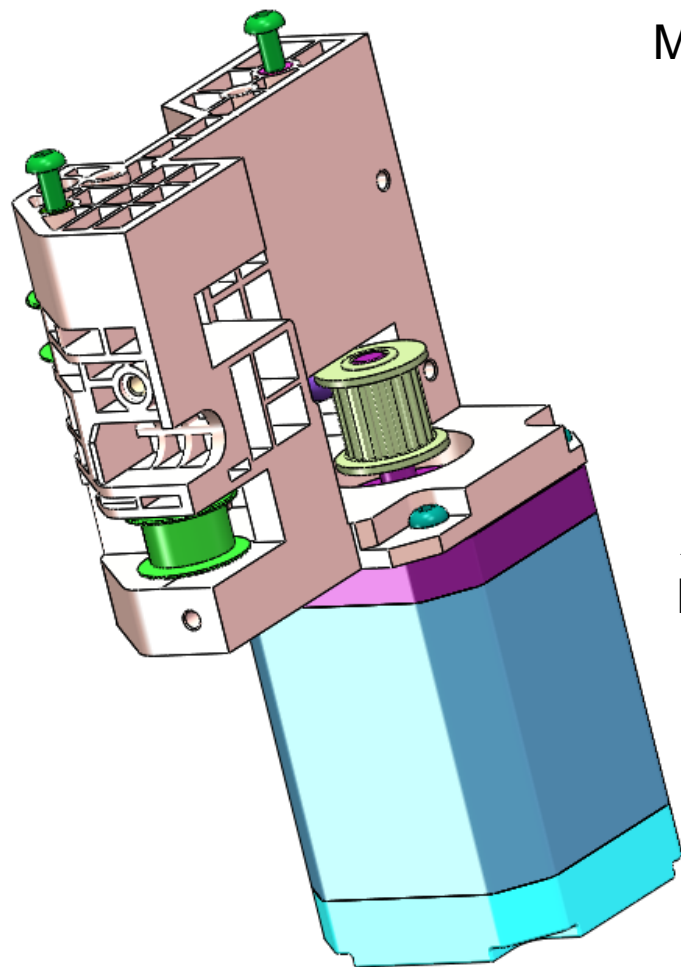

09.202.0031
内六角半圆头螺钉 M3*6
M3 x 6 Hex Socket Screw,
Half Round Head

06.210.0004
同步带惰轮
Idler of the
Timing Belt


05.201.0238
X/Y电机左固定座-B版本
Left Fixation Base of the
X & Y Axis Motor for B
Version

06.208.0005
 $\phi 5 \times 20$ 销钉轴
 $\phi 5 \times 20$ mm Pin Shaft

09.202.0061
内六角半圆头螺钉 M3*10
M3 x 10 Half Round Head
Hex Socket Screw

09.206.0023
十字圆头平尾自攻螺钉PB
M5*14
M5 x 14 Phillips Flat Tail Self
Tapping Screw, Round Head

08.201.0029
42-60步进电机
42-60 Stepping Motor

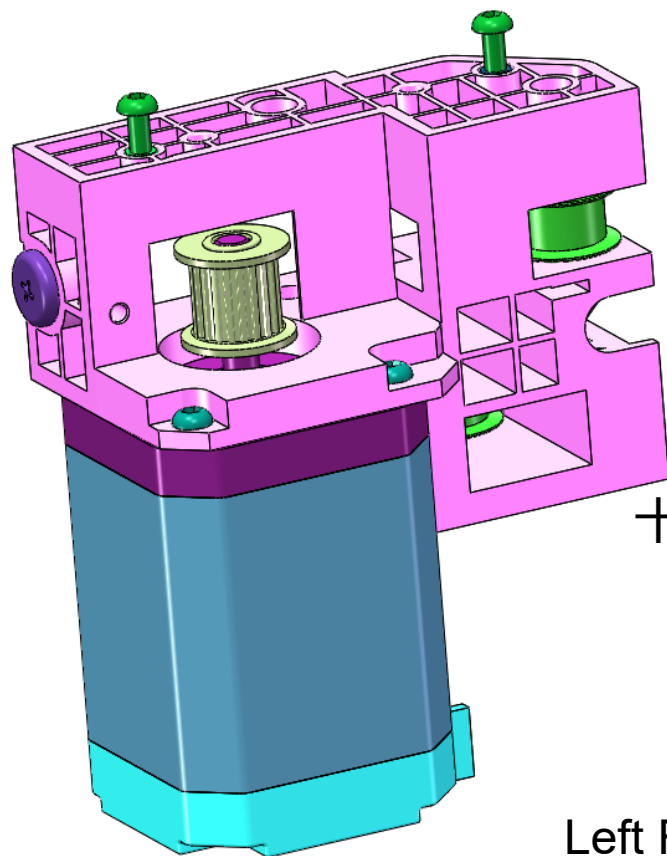

20.205.0112
XY右电机座组件
X & Y Axis Right Motor
Base

09.202.0061
内六角半圆头螺钉 M3*10
M3 x 10 Hex Socket Screw,
Half Round Head

09.202.0031
内六角半圆头螺钉 M3*6
M3 x 6 Hex Socket
Screw, Half Round Head


09.206.0023
十字圆头平尾自攻螺钉PB M5*14
M5 x 14 Phillips Flat Tail Self
Tapping Screw, Round Head

05.201.0239
X/Y电机右固定座-B版本
Left Fixation Base of the X & Y Axis
Motor for B Version


08.201.0029
42-60步进电机
42-60 Stepping Motor

06.210.0004
同步带惰轮
Idler of the
Timing Belt

06.208.0005
φ5x20销钉轴
φ5 x 20 mm Pin
Shaft

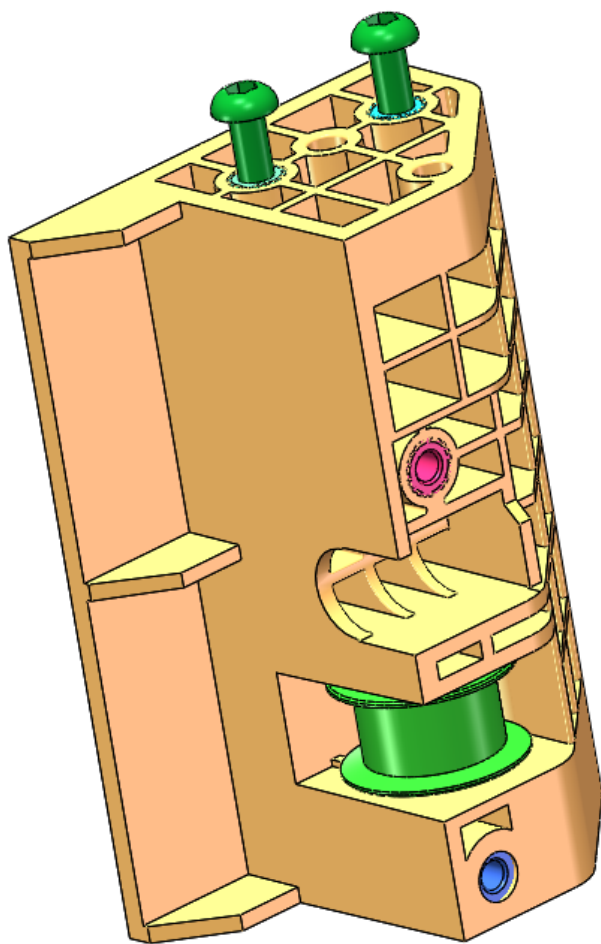

20.205.0113
左前惰轮固定组件
Left Front Idler Fixation
Assembly

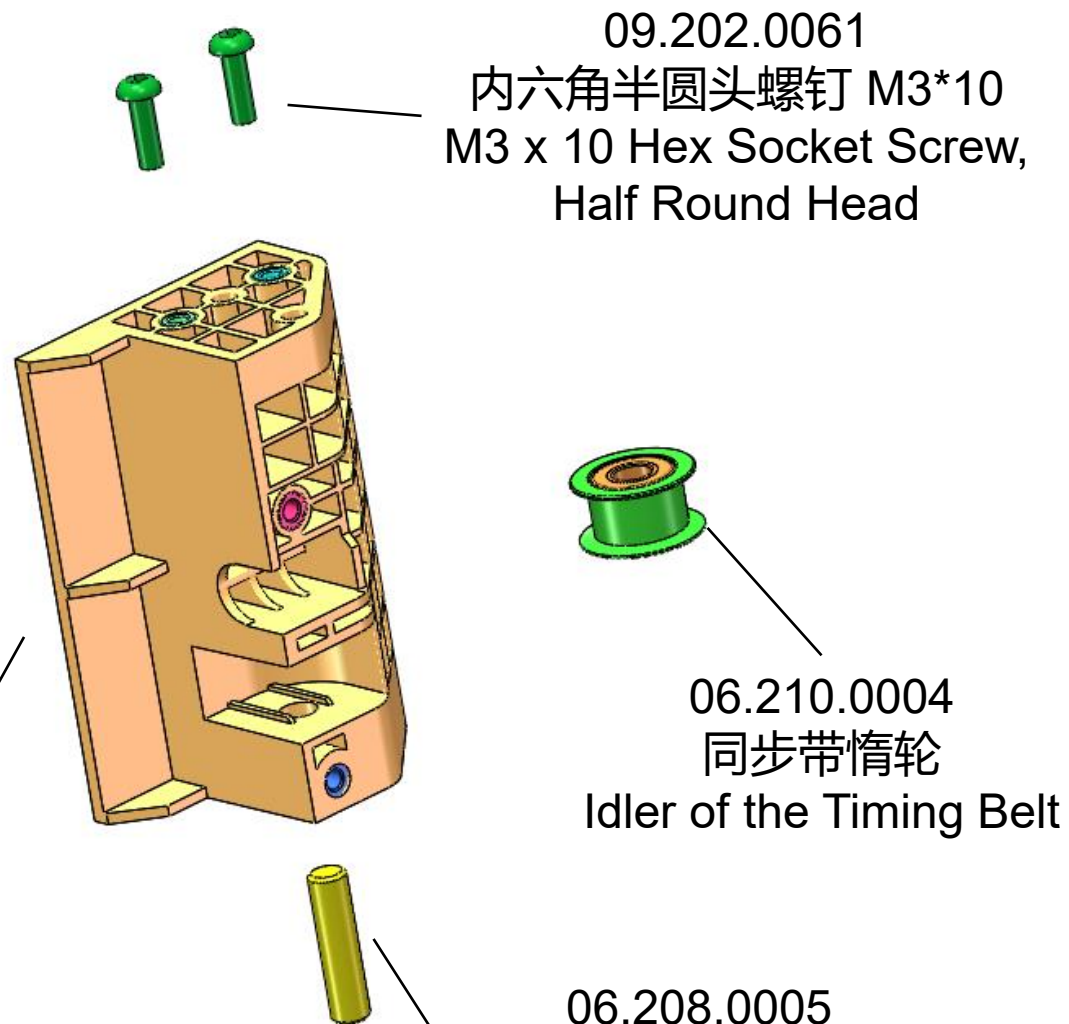

05.201.0240
左前惰轮固定件-B版本
Left Front Idler Fixation
Assembly-for B Version

09.202.0061
内六角半圆头螺钉 M3*10
M3 x 10 Hex Socket Screw,
Half Round Head




06.210.0004
同步带惰轮
Idler of the Timing Belt



06.208.0005
φ5x20销钉轴
φ5 x 20 mm Pin
Shaft


20.205.0114
右前惰轮固定组件
Left Front Idler Fixation Assembly

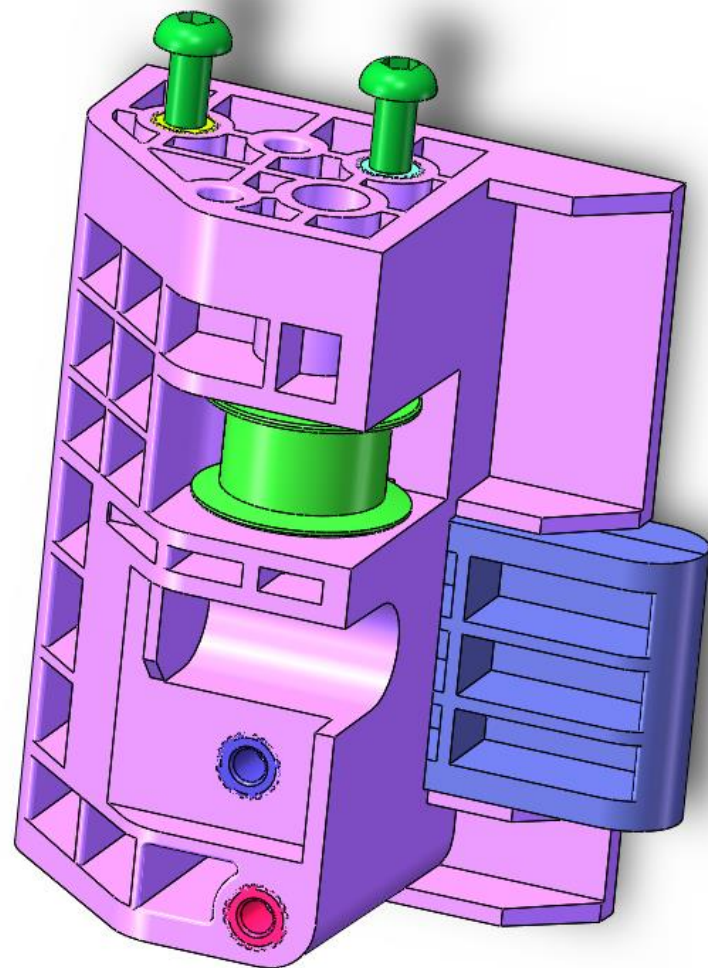

06.210.0004
同步带惰轮
Idler of the Timing Belt



05.201.0241
右前惰轮固定件-B版本
Left Front Idler Fixation
Assembly-for B Version

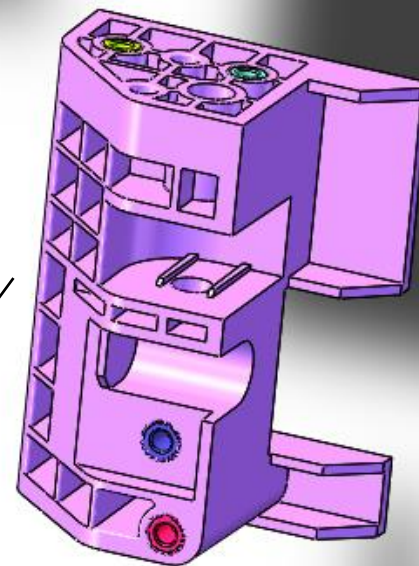


06.208.0005
φ5x20销钉轴
φ5 x 20 mm
Pin Shaft



09.202.0061
内六角半圆头螺钉 M3*10
M3 x 10 Hex Socket Screw,
Half Round Head

09.202.0060
内六角半圆头螺钉 M3*12
M3 x 12 Hex Socket Screw,
Half Round Head

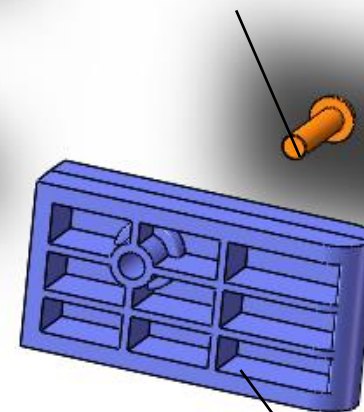

05.201.0188
切刀撞击块
Cutter Collision block

09.206.0028
"薄头内六角平尾自攻螺钉M3*6"
M3 x 6 Hex Socket Flat Tail Self
Tapping Screw, Thin Type


12.204.0064
上玻璃盖EVA泡棉-17.5
EVA Foam of the Top Glass Cover

20.205.0115
上框架塑料外壳组件
Top Frame Plastic
Housing Assembly

12.204.0059
上玻璃盖EVA泡棉-H10


09.202.0034
内六角半圆头螺M3*40
M3 x 40 Hex Socket
Screw, Half Round Head

09.202.0045
内六角半圆头螺M3*25
M3 x 25 Hex Socket
Screw, Half Round Head

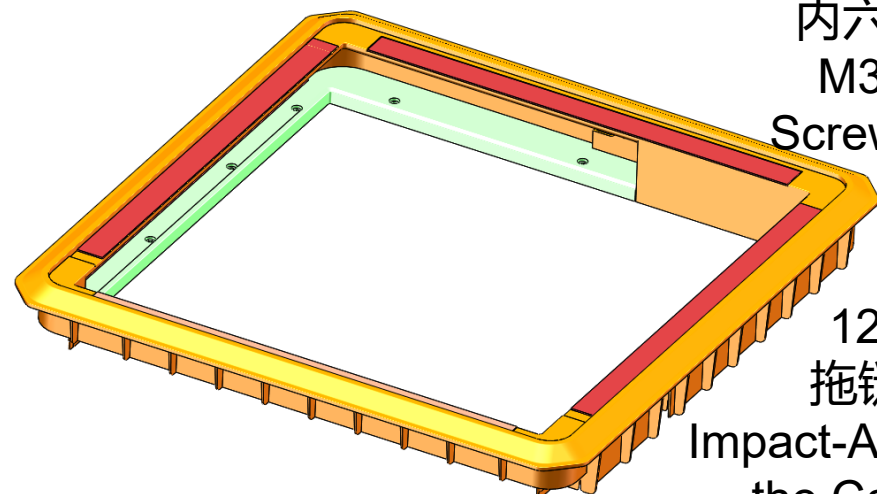

05.201.0243
上框架塑料底壳-B版本
Bottom Cover of the Top Frame
Plastic Housing for B Version


12.204.0075B
拖链侧边防撞棉
Impact-Absorbent Foma on
the Cable Chain Side

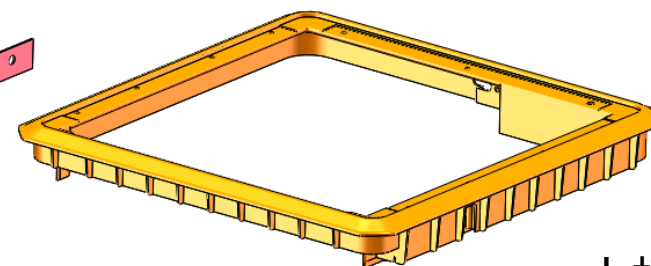



05.201.0242
上框架塑料包裹件-B版本
Top Frame Plastic
Packaging Kit-for B
Version

04.210.0029
照明灯带
Strip Light


05.201.0244
灯带压块
Pressing Block of the Strip Light

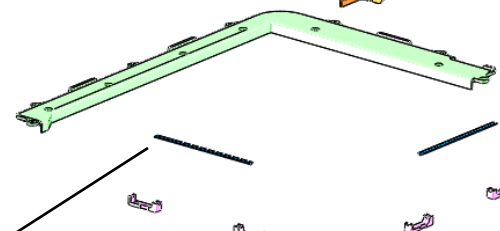


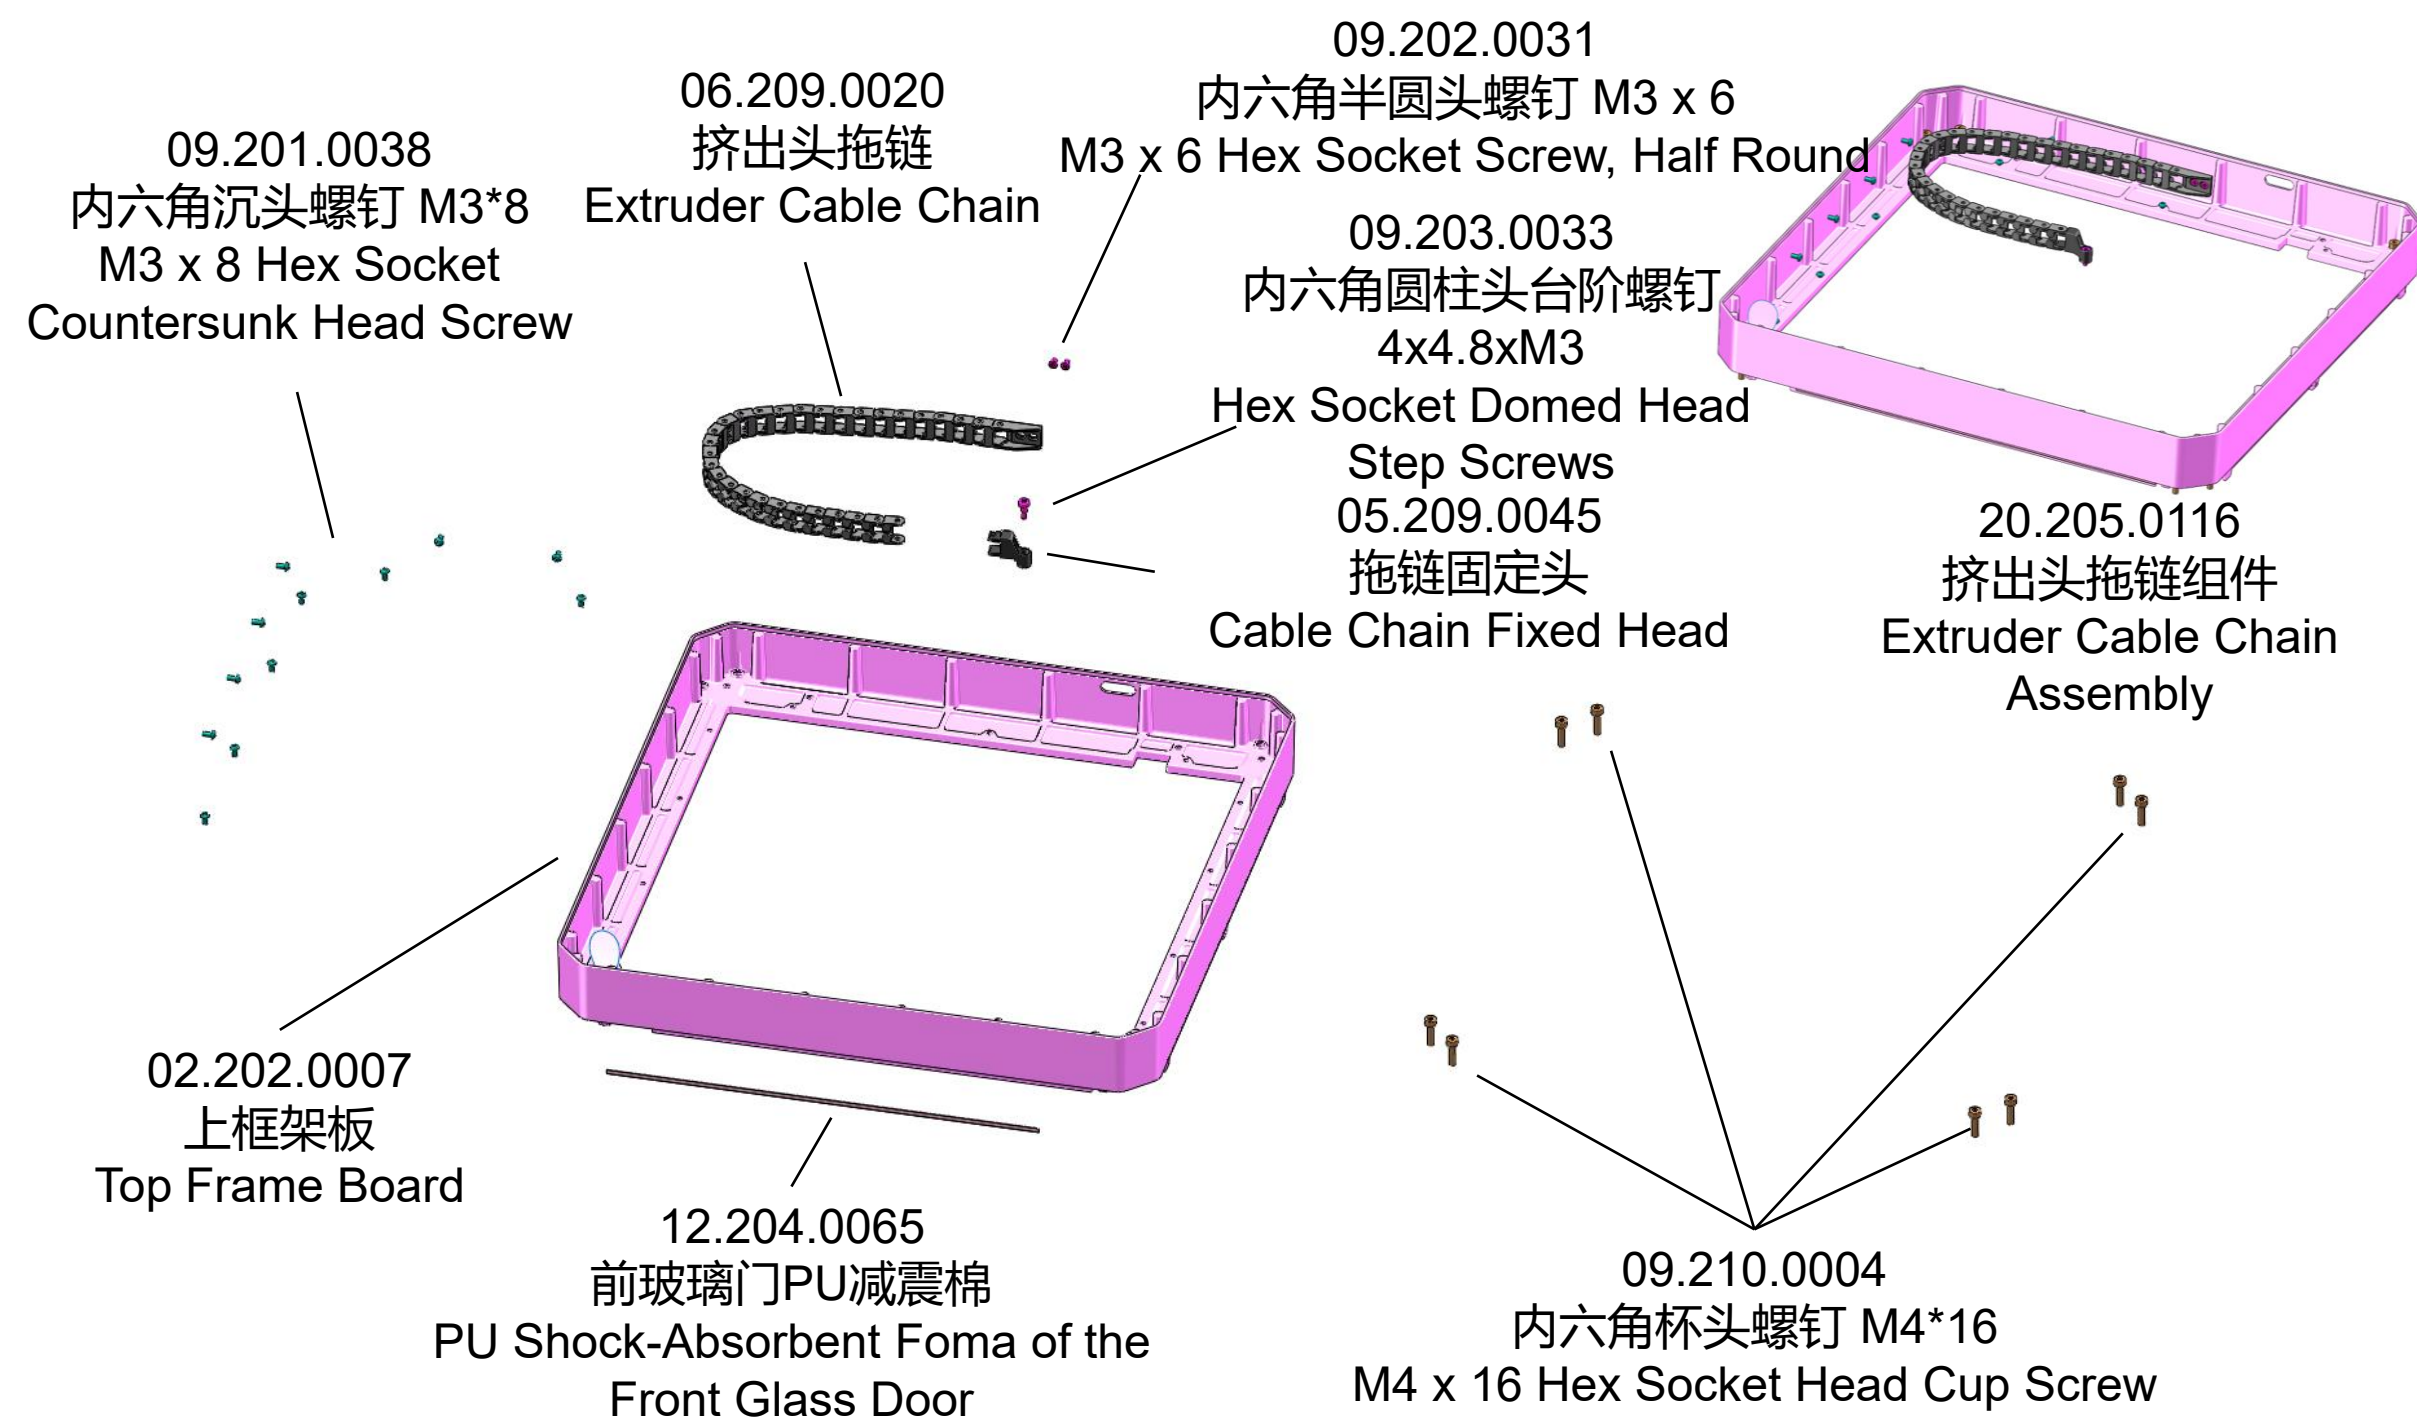

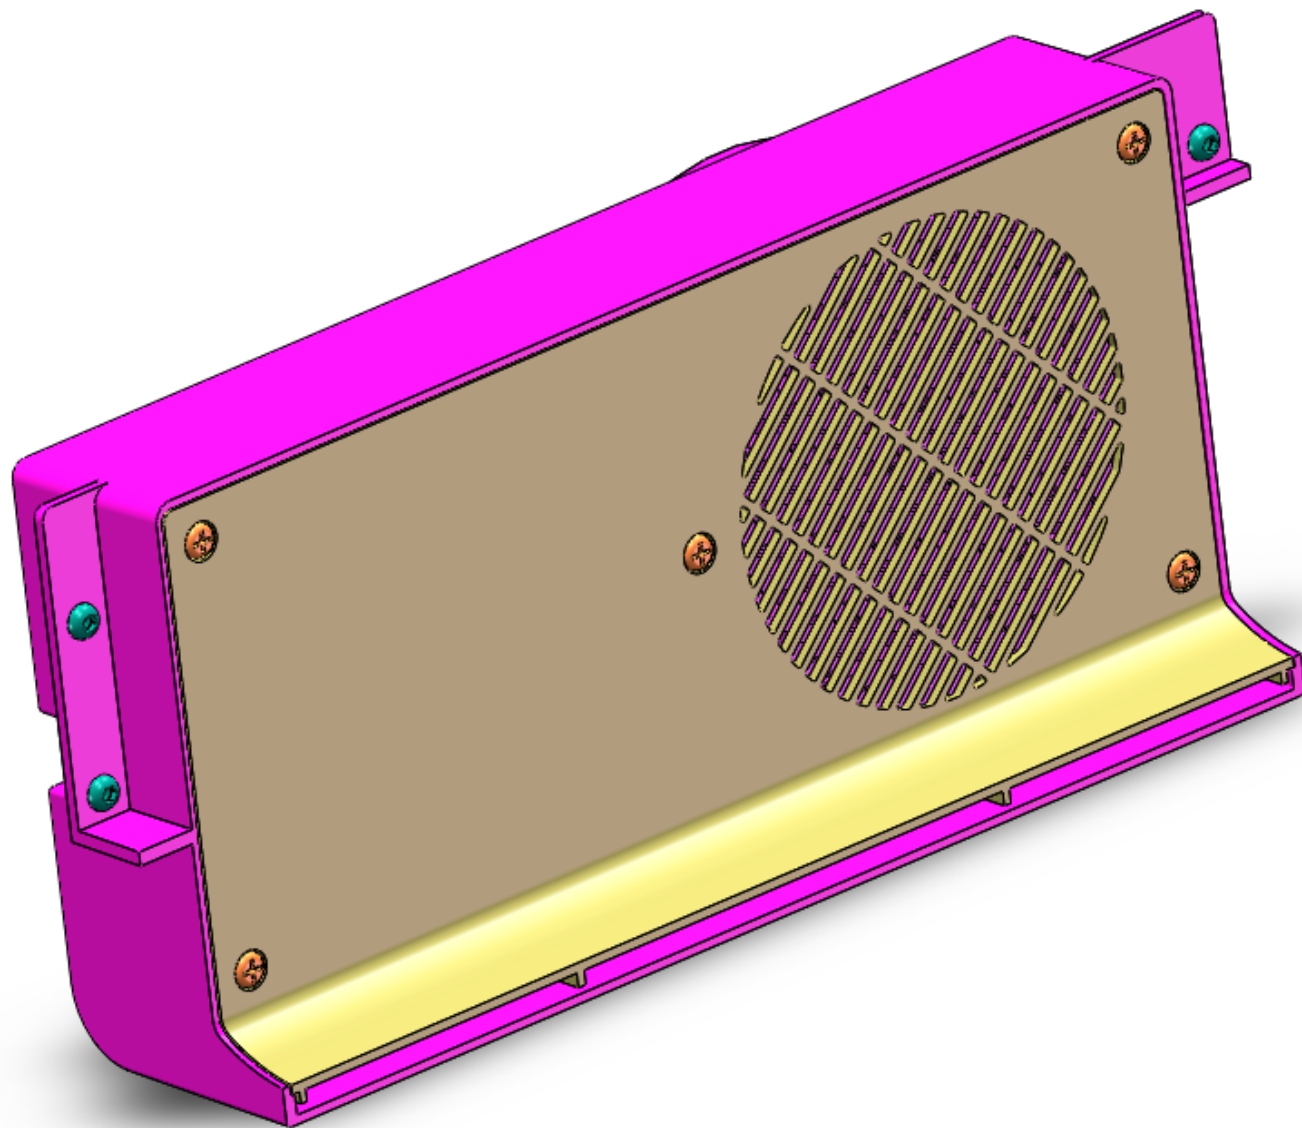



20.204.0194
辅助模型冷却风扇组件
Modeling Cooling Fan Assembly

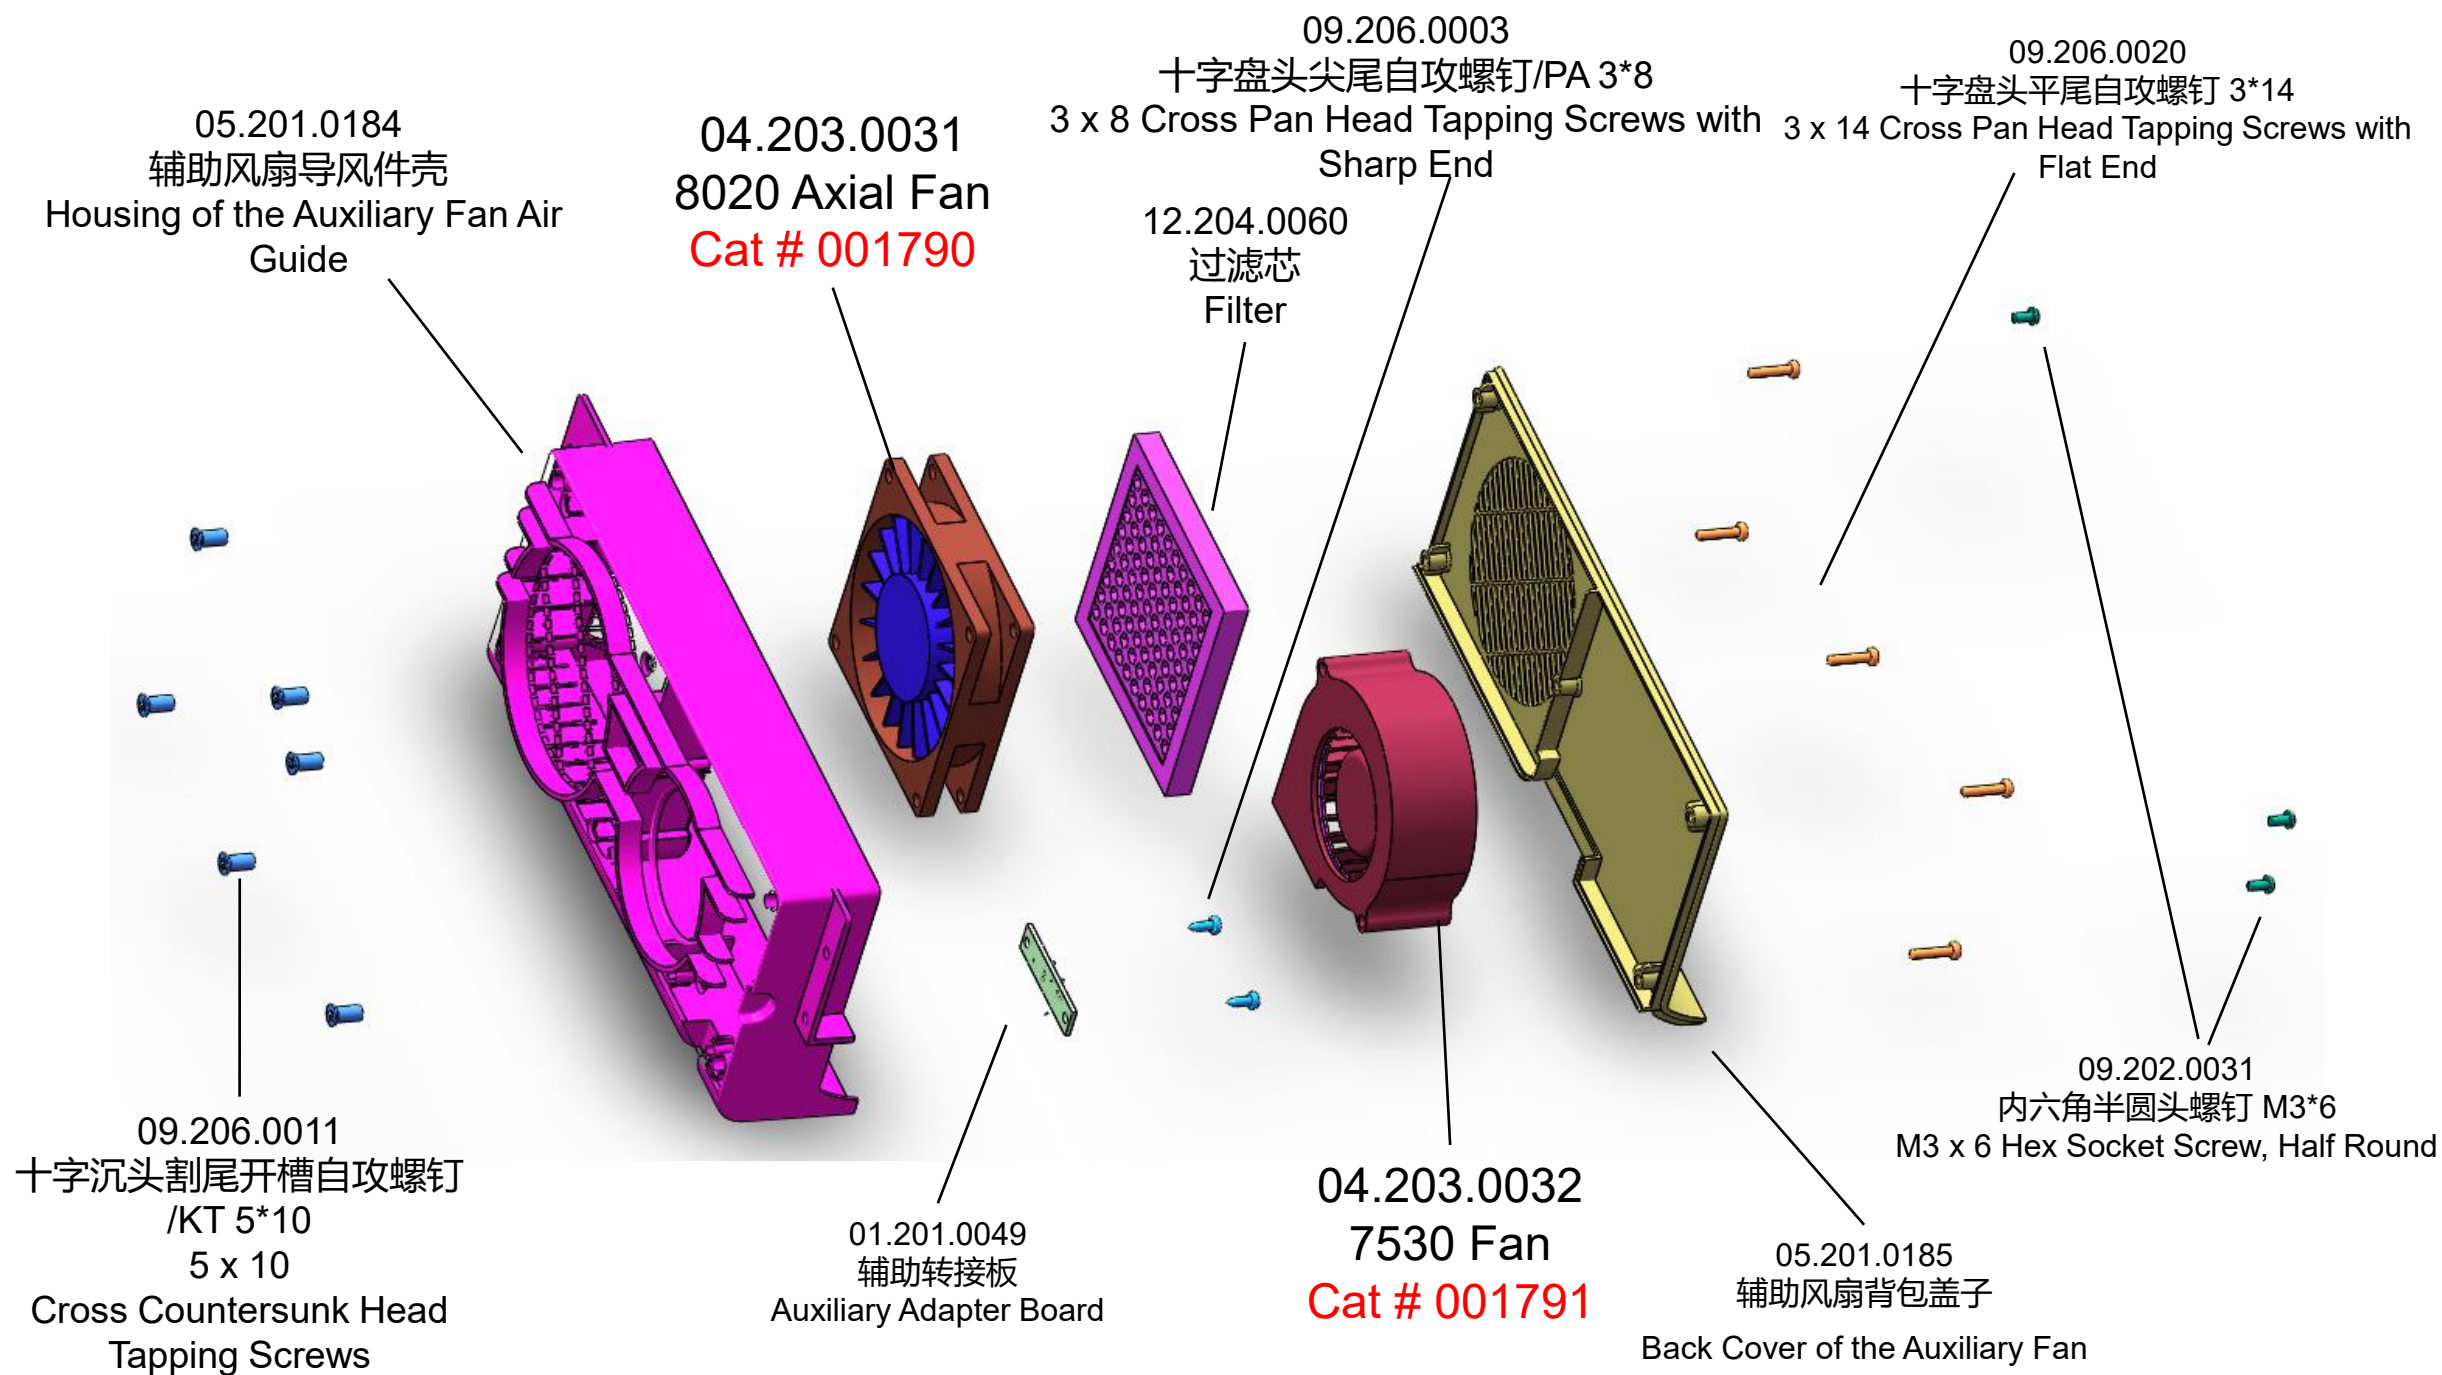

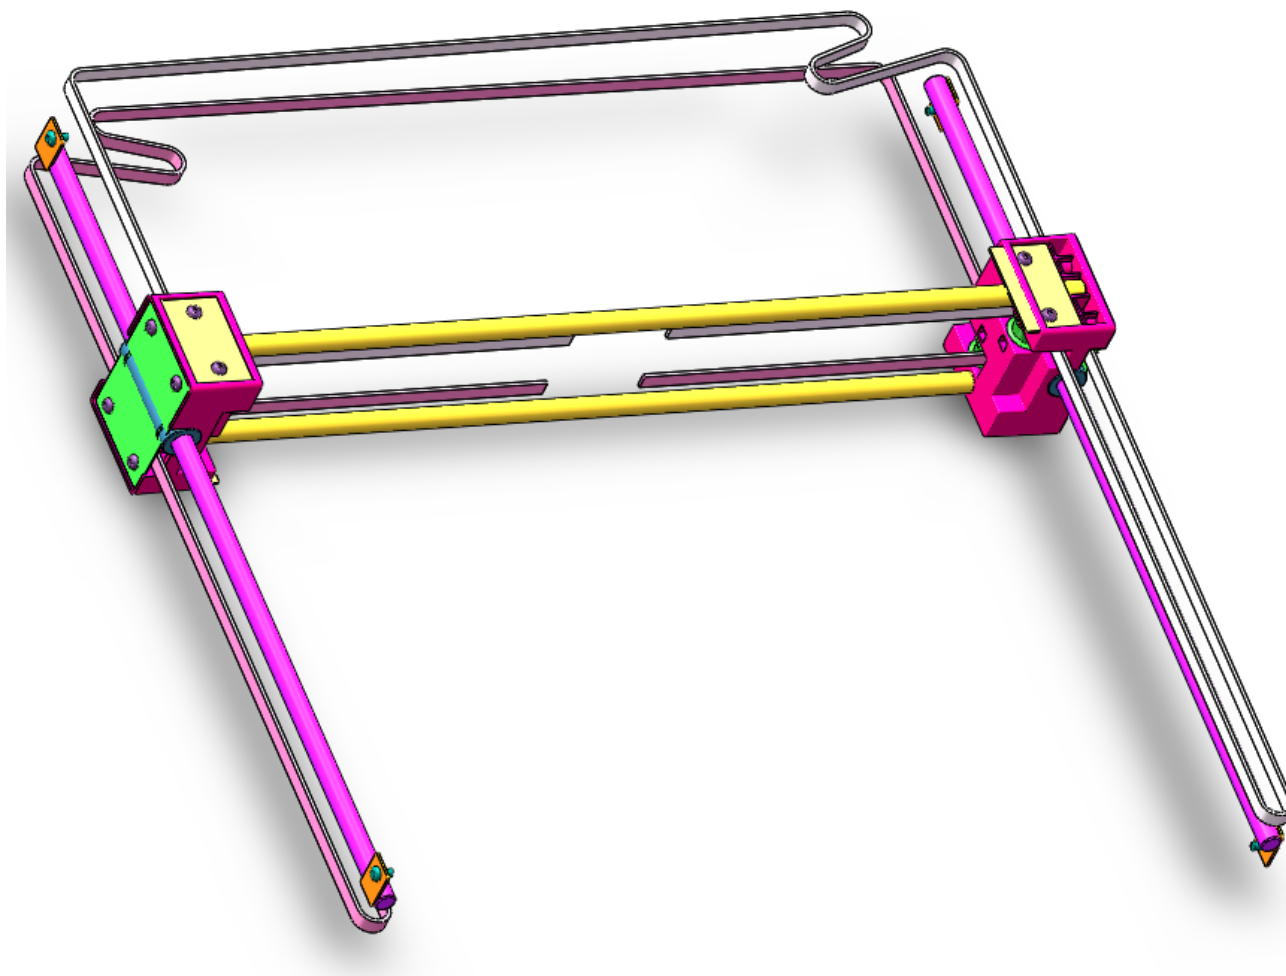

20.204.0193
XY轴套件
X & Y Axis Kit

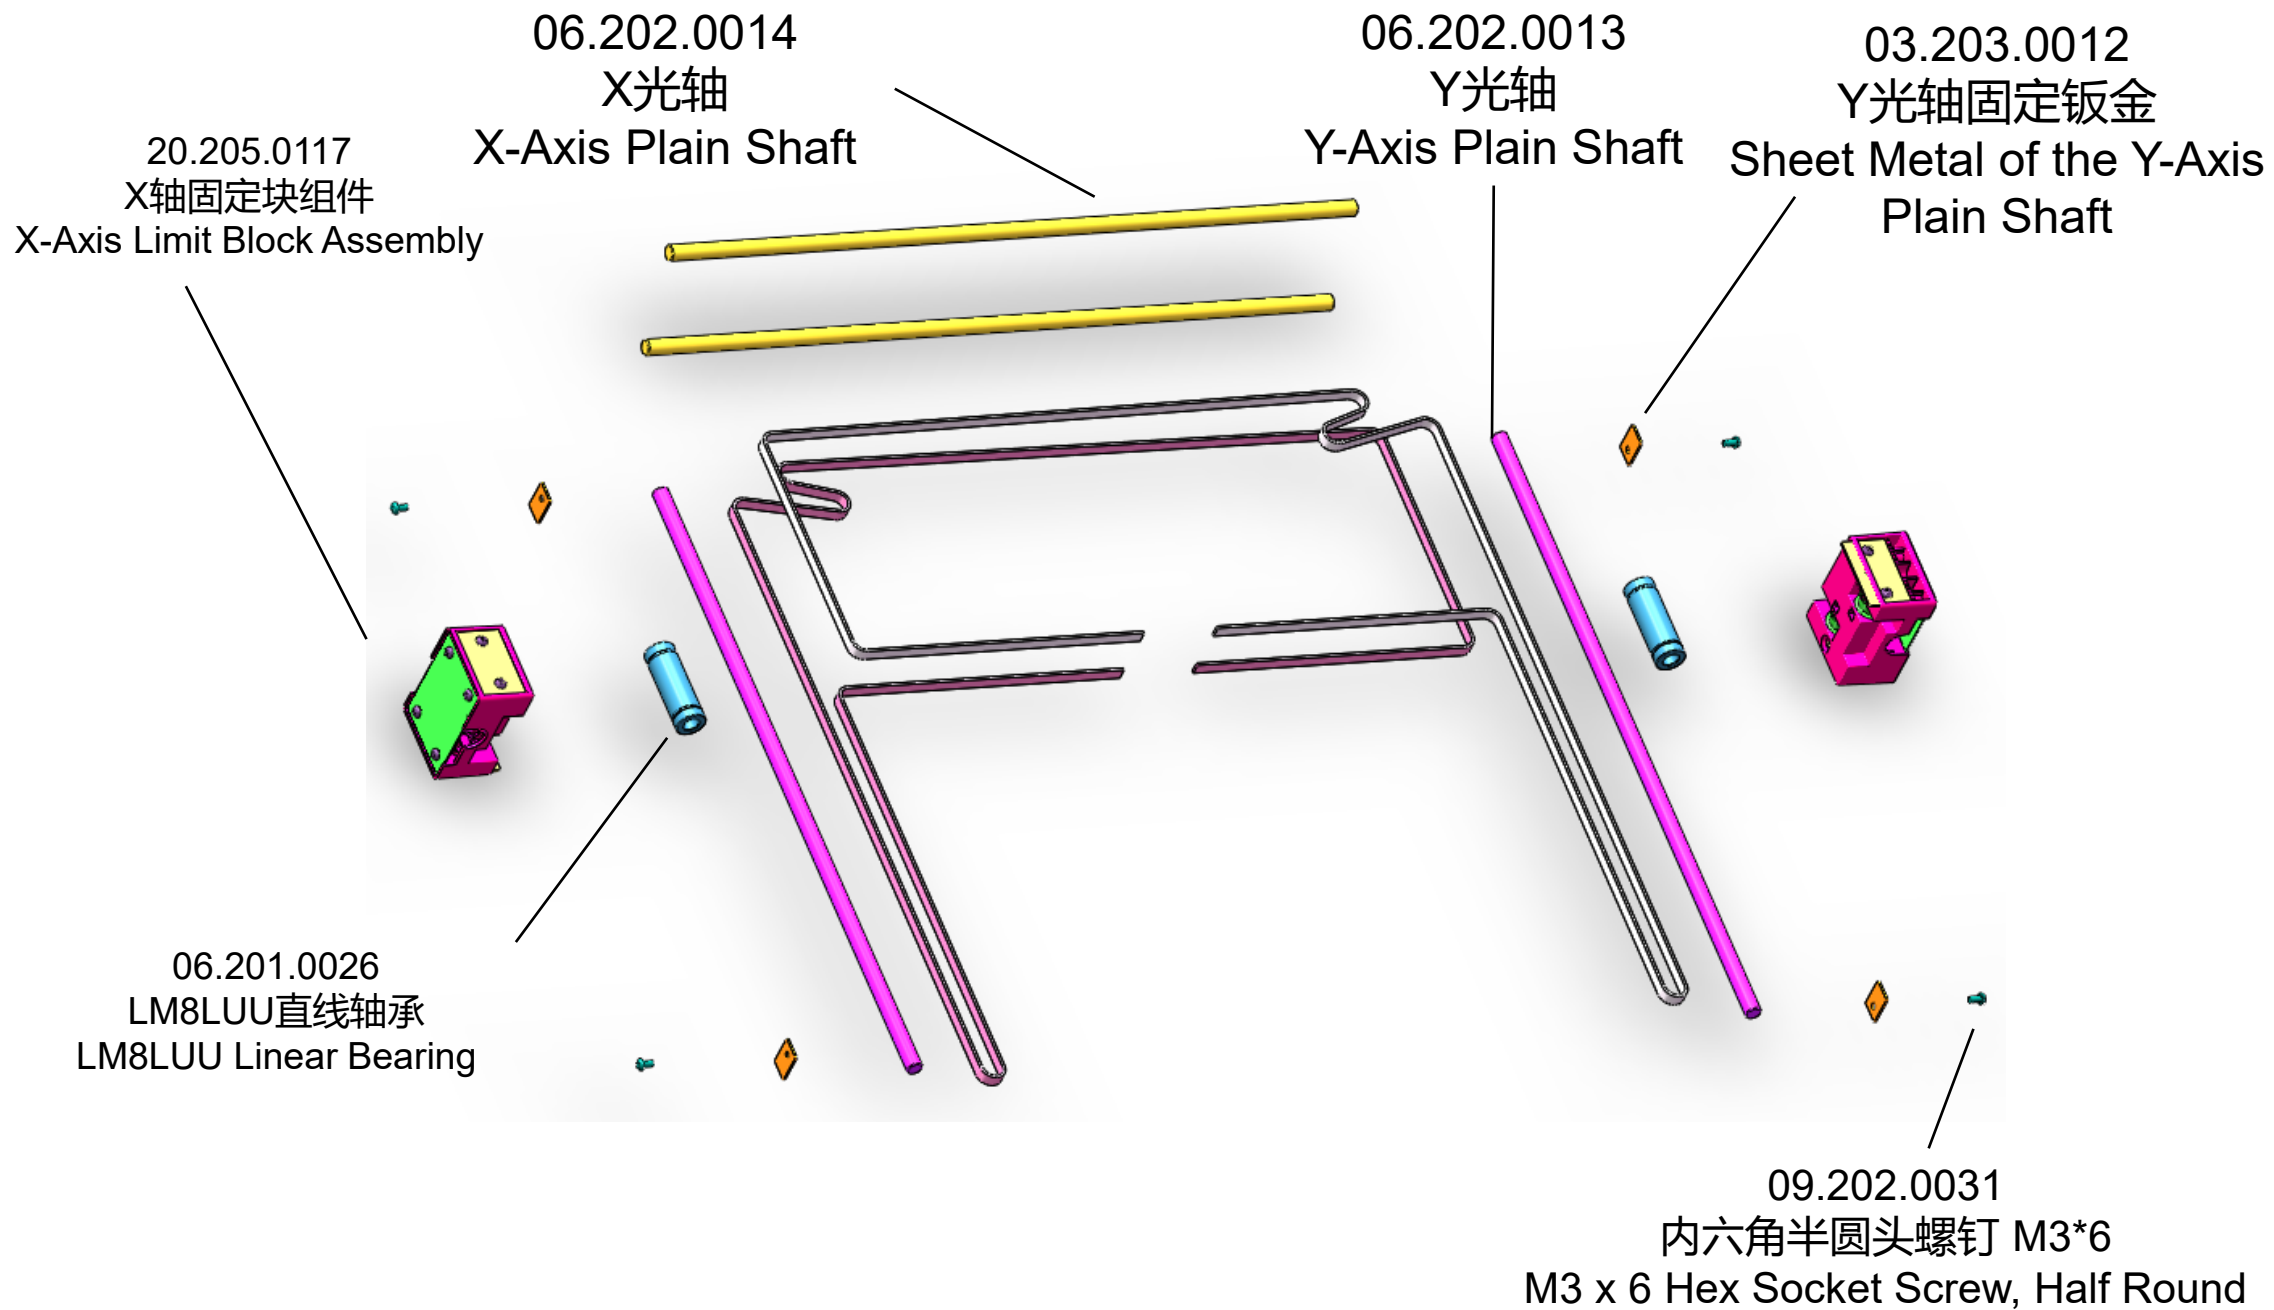

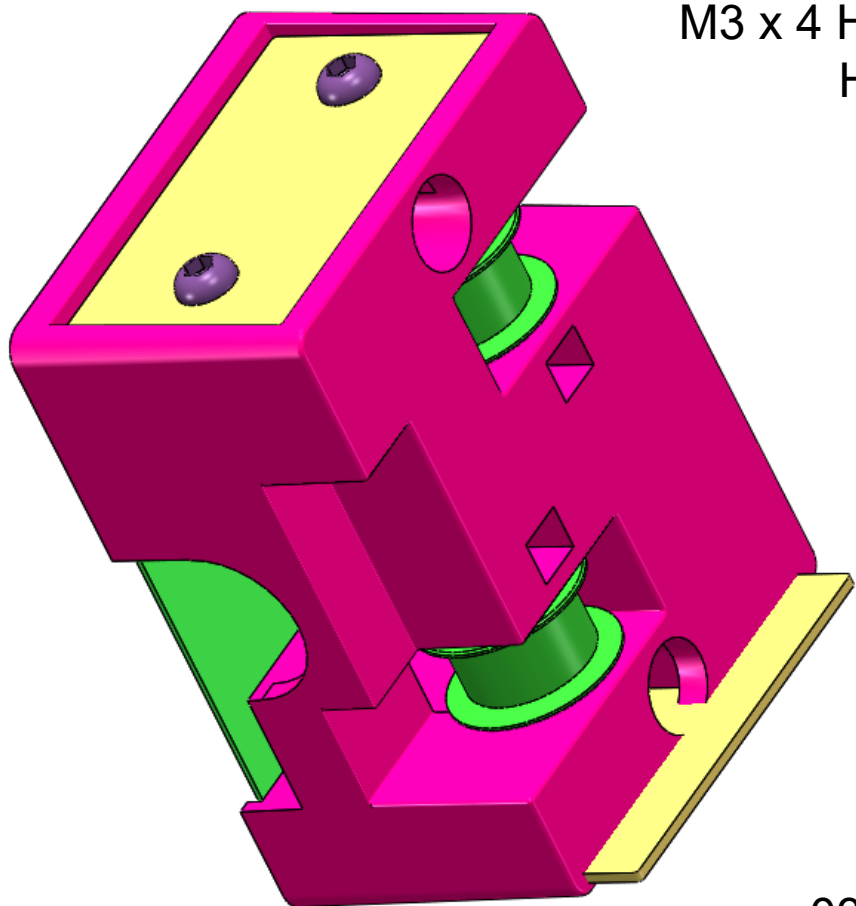

09.202.0058
内六角半圆头螺钉 M3*4
M3 x 4 Hex Socket Screw,
Half Round

03.203.0011
X光轴固定钣金
Sheet Metal of the X-
Axis Plain Shaft


06.208.0005
 $\phi 5 \times 20$ 销钉轴
 $\phi 5 \times 20$ Pine Roll

20.205.0117
X轴固定块组件
X-Axis Limit Block
Assembly

03.203.0013
Y轴轴承固定钣金
Sheet Metal of the Y-
Axis Bearing

05.201.0190
Y轴光轴固定块
Y-Axis Plain
Shaft Limit Block

06.210.0004
同步带惰轮
Timig Belt Idler Pulley

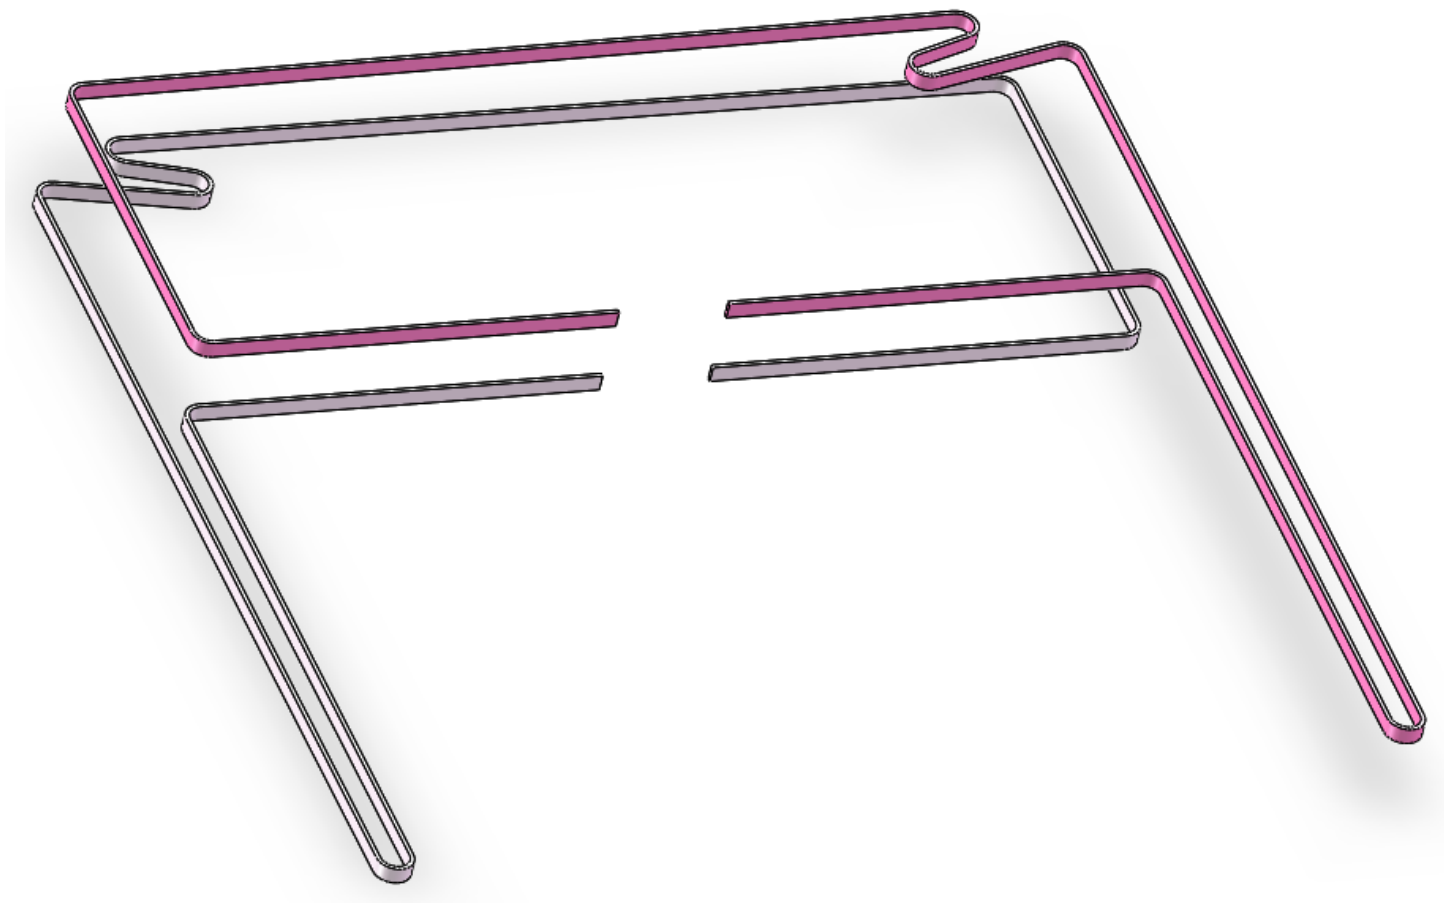

20.205.0118
X & Y Axis Timing Belt Assembly
Cat # 001759

05.202.0001
2M-W6开口同步带
2M-W6 Open Timing Belt

05.201.0203
挤出机前滑块板
Front Slider Plate of the
Extruder


09.202.0060
内六角半圆头螺钉 M3*12
M3 x 12 Hex Socket Screw,
Half Round

05.201.0211
XY皮带固定卡片
X & Y Axis Clip

06.201.0027
LMS8LUU直线轴承
LMS8LUU Linear
Bearing

09.202.0060
内六角半圆头螺钉 M3*12
M3 x 12 Hex Socket Screw,
Half Round

05.201.0204
挤出机后滑块板
Rear Slider Plate of the
Extruder

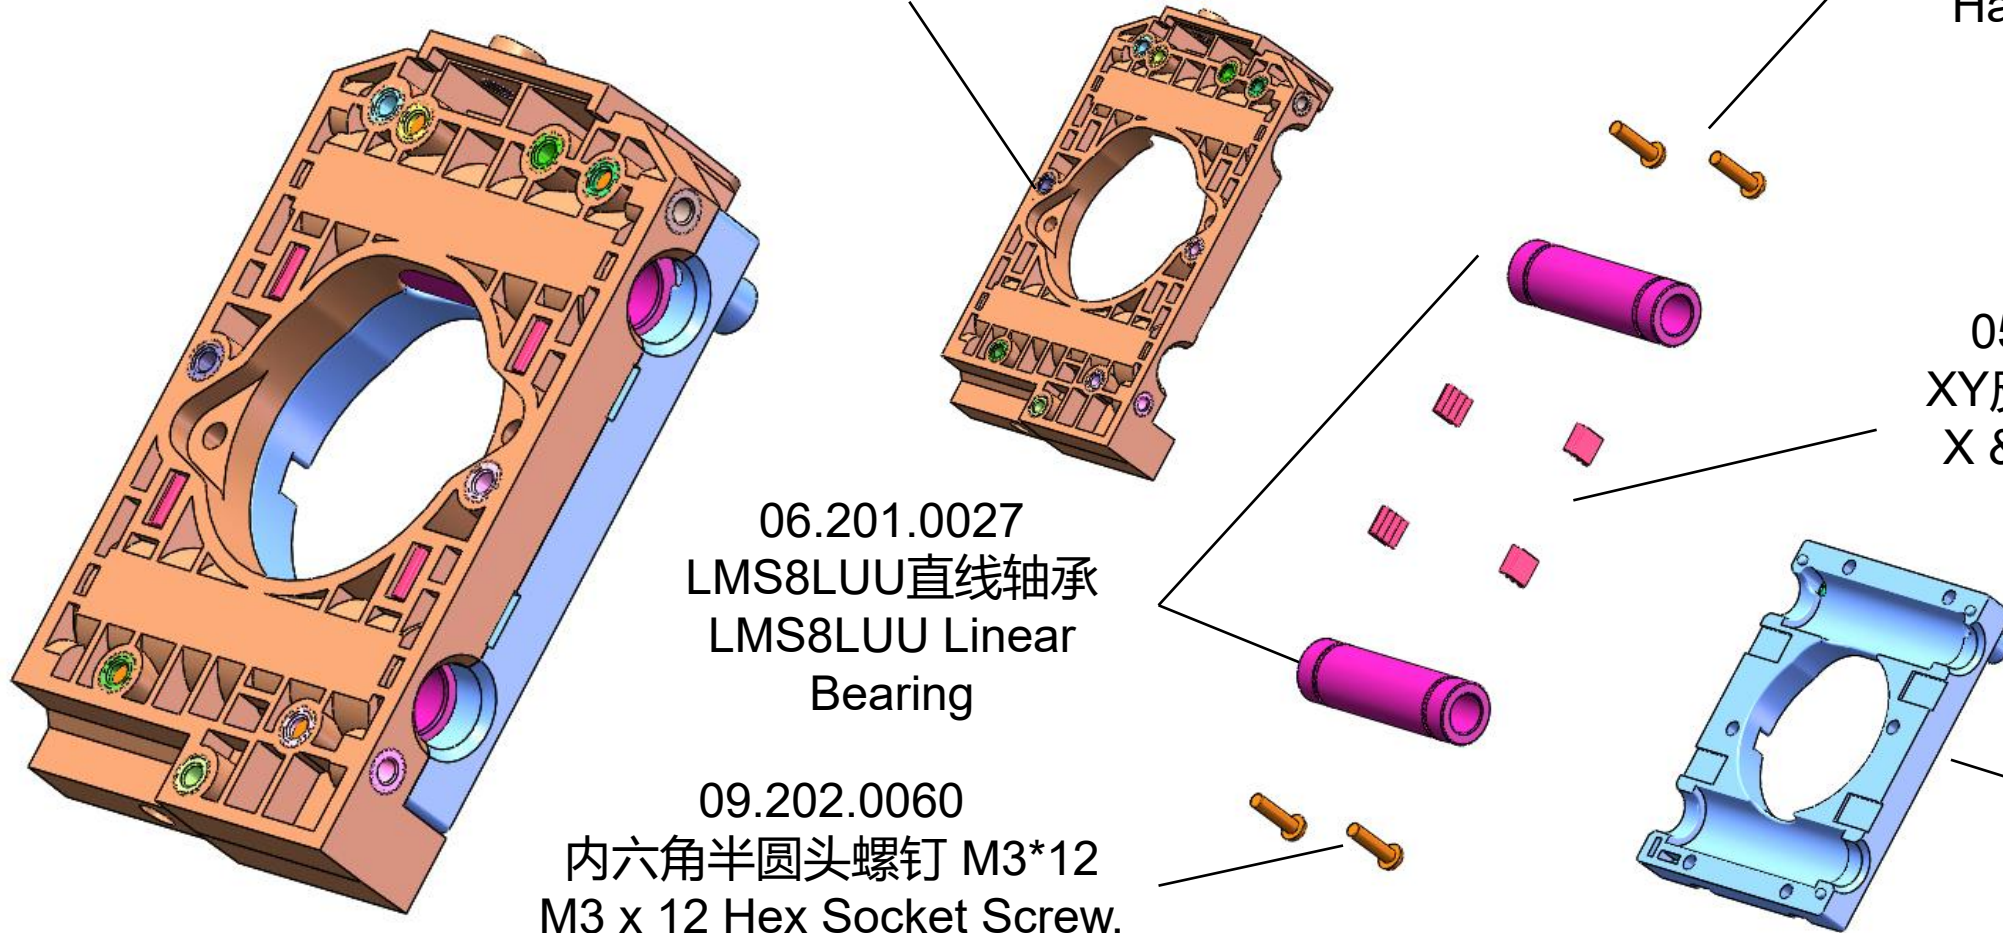




20.204.0195
挤出机套件
Extruder Kit


09.202.0061
内六角半圆头螺钉 M3*10
M3 x 10 Hex Socket Screw,
Half Round

05.201.0206
挤出头后壳
Extruder Back Cover

20.205.0123
挤出头外壳组件
Extruder Housing Assembly


20.205.0124
挤出头风道组件
Extruder Air Duct Assembly

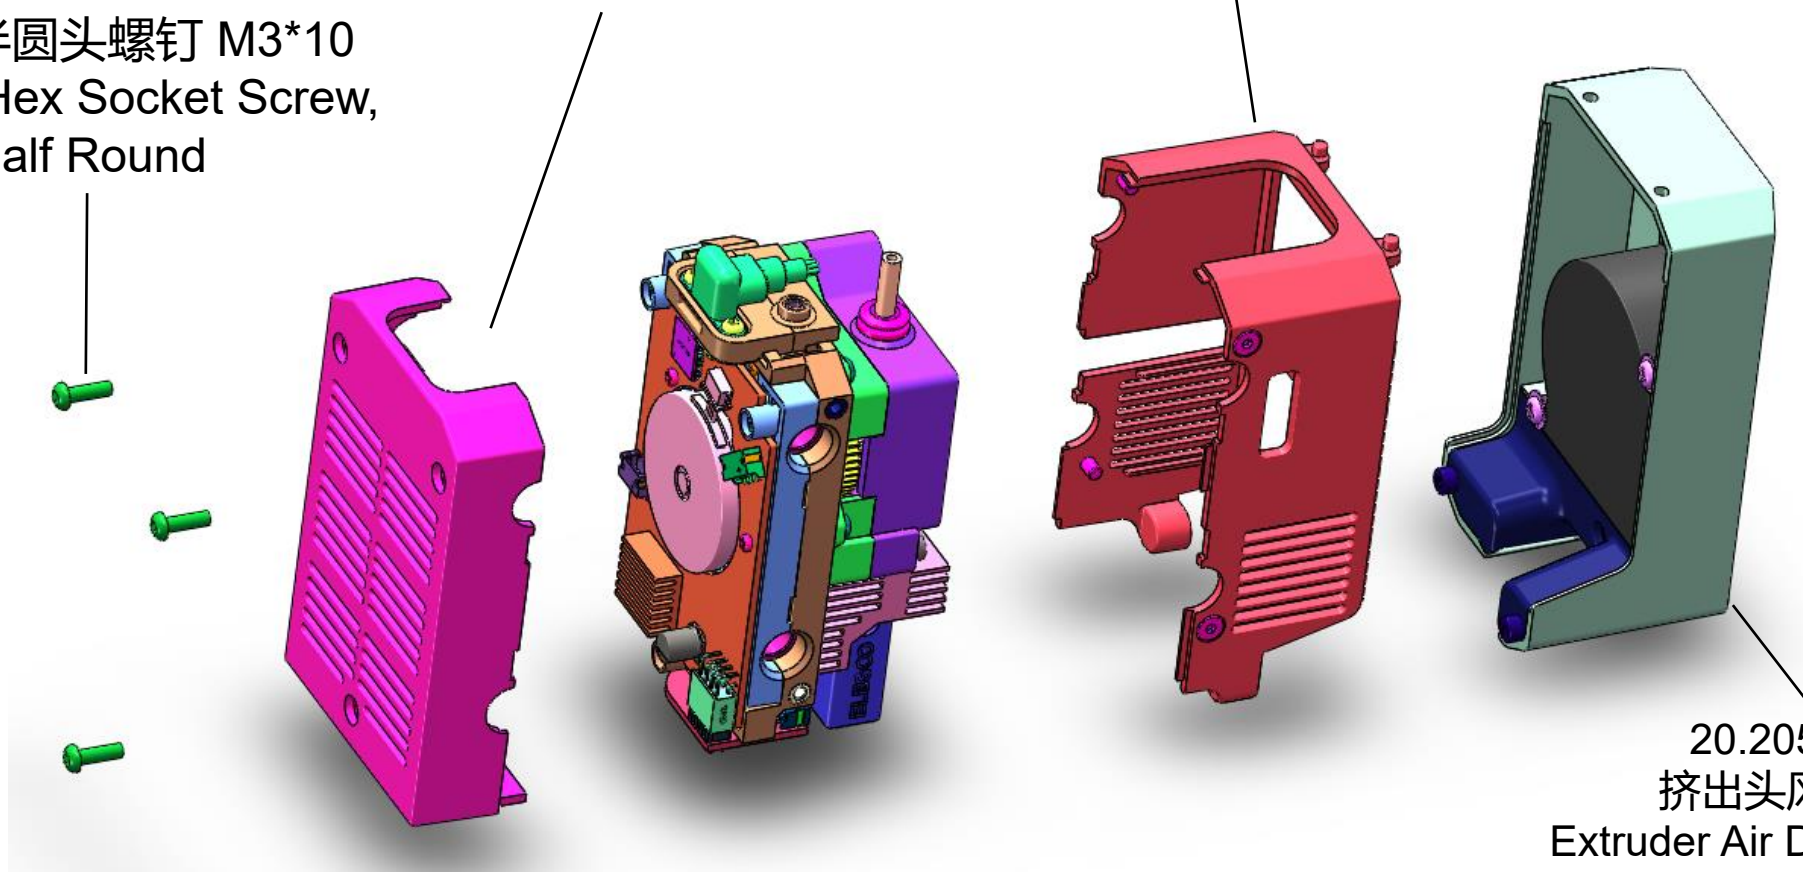

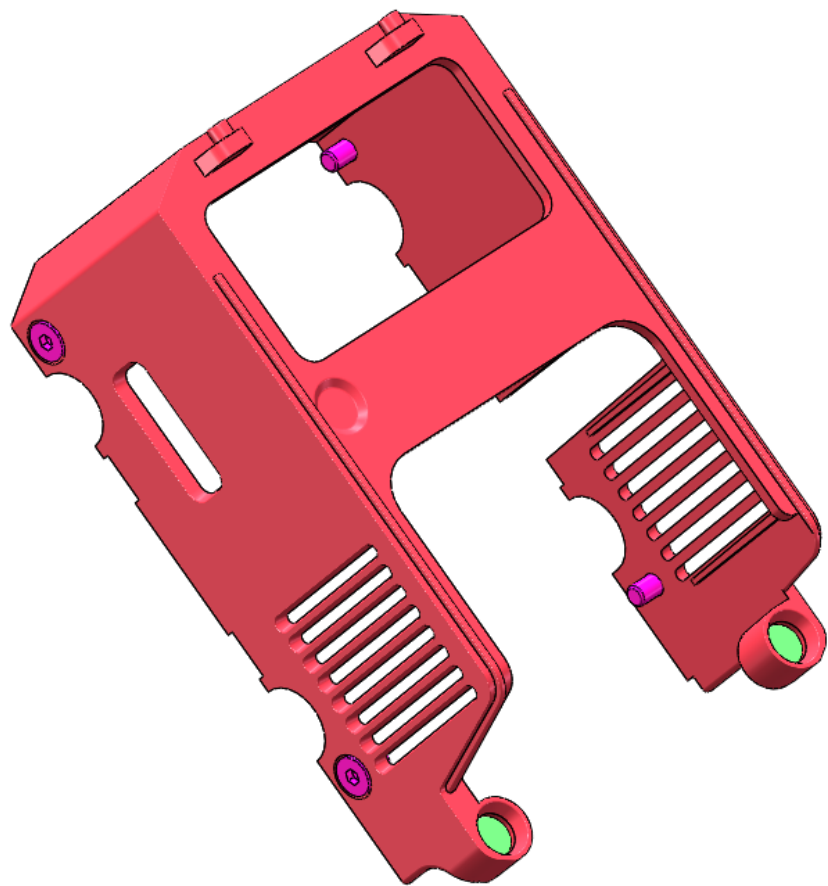

20.205.0123
挤出头外壳组件
Extruder Housing Assembly

05.201.0205
挤出头外壳
Extruder Housing

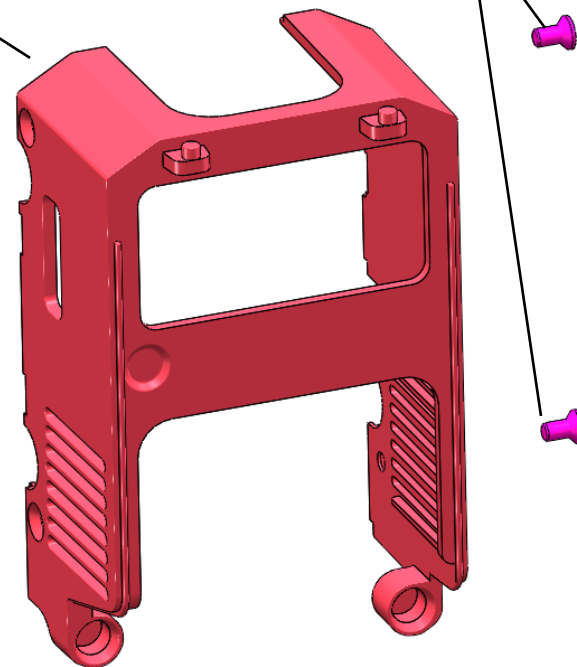


09.201.0032
内六角沉头螺钉 M3*6
M3 x 6 Hex Socket
Screw, Half Round

09.201.0032
内六角沉头螺钉 M3*6
M3 x 6 Hex Socket Screw, Half
Round




06.209.0021
挤出头盖磁铁
Extruder Magnetic Cover

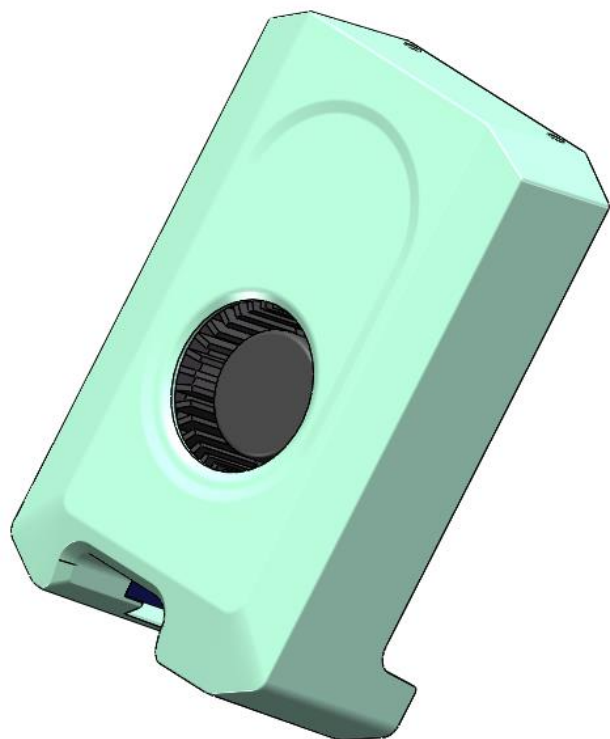

20.205.0124
挤出头风道组件
Extruder Air Duct
Assembly

04.203.0028
5020 Blower Fan
Cat # 001789

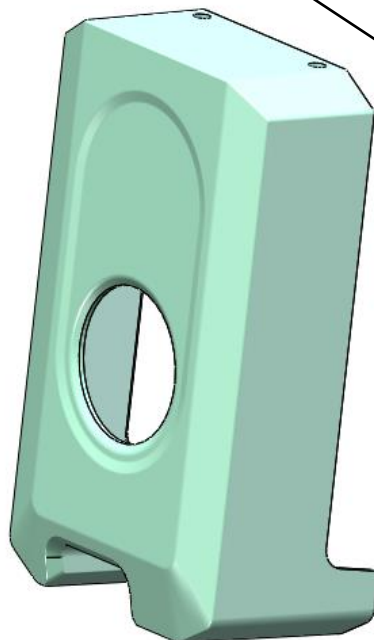


05.201.0227
挤出头磁吸风道壳
Extruder Magnetic Air
Duct Cover

05.201.0202
模型冷却风道
Model Cooling Air Duct





09.206.0025
圆柱头内六角平尾自攻螺钉 M3*5
M3*5 Hex Socket Domed Head Tapping
Screws, Flat Tail

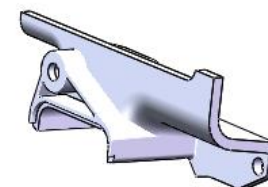


09.206.0019
十字圆头带介平尾自攻螺钉 2.6*14
2.6*14 Cross Round Washer Head
Tapping Screws, Flat Tail




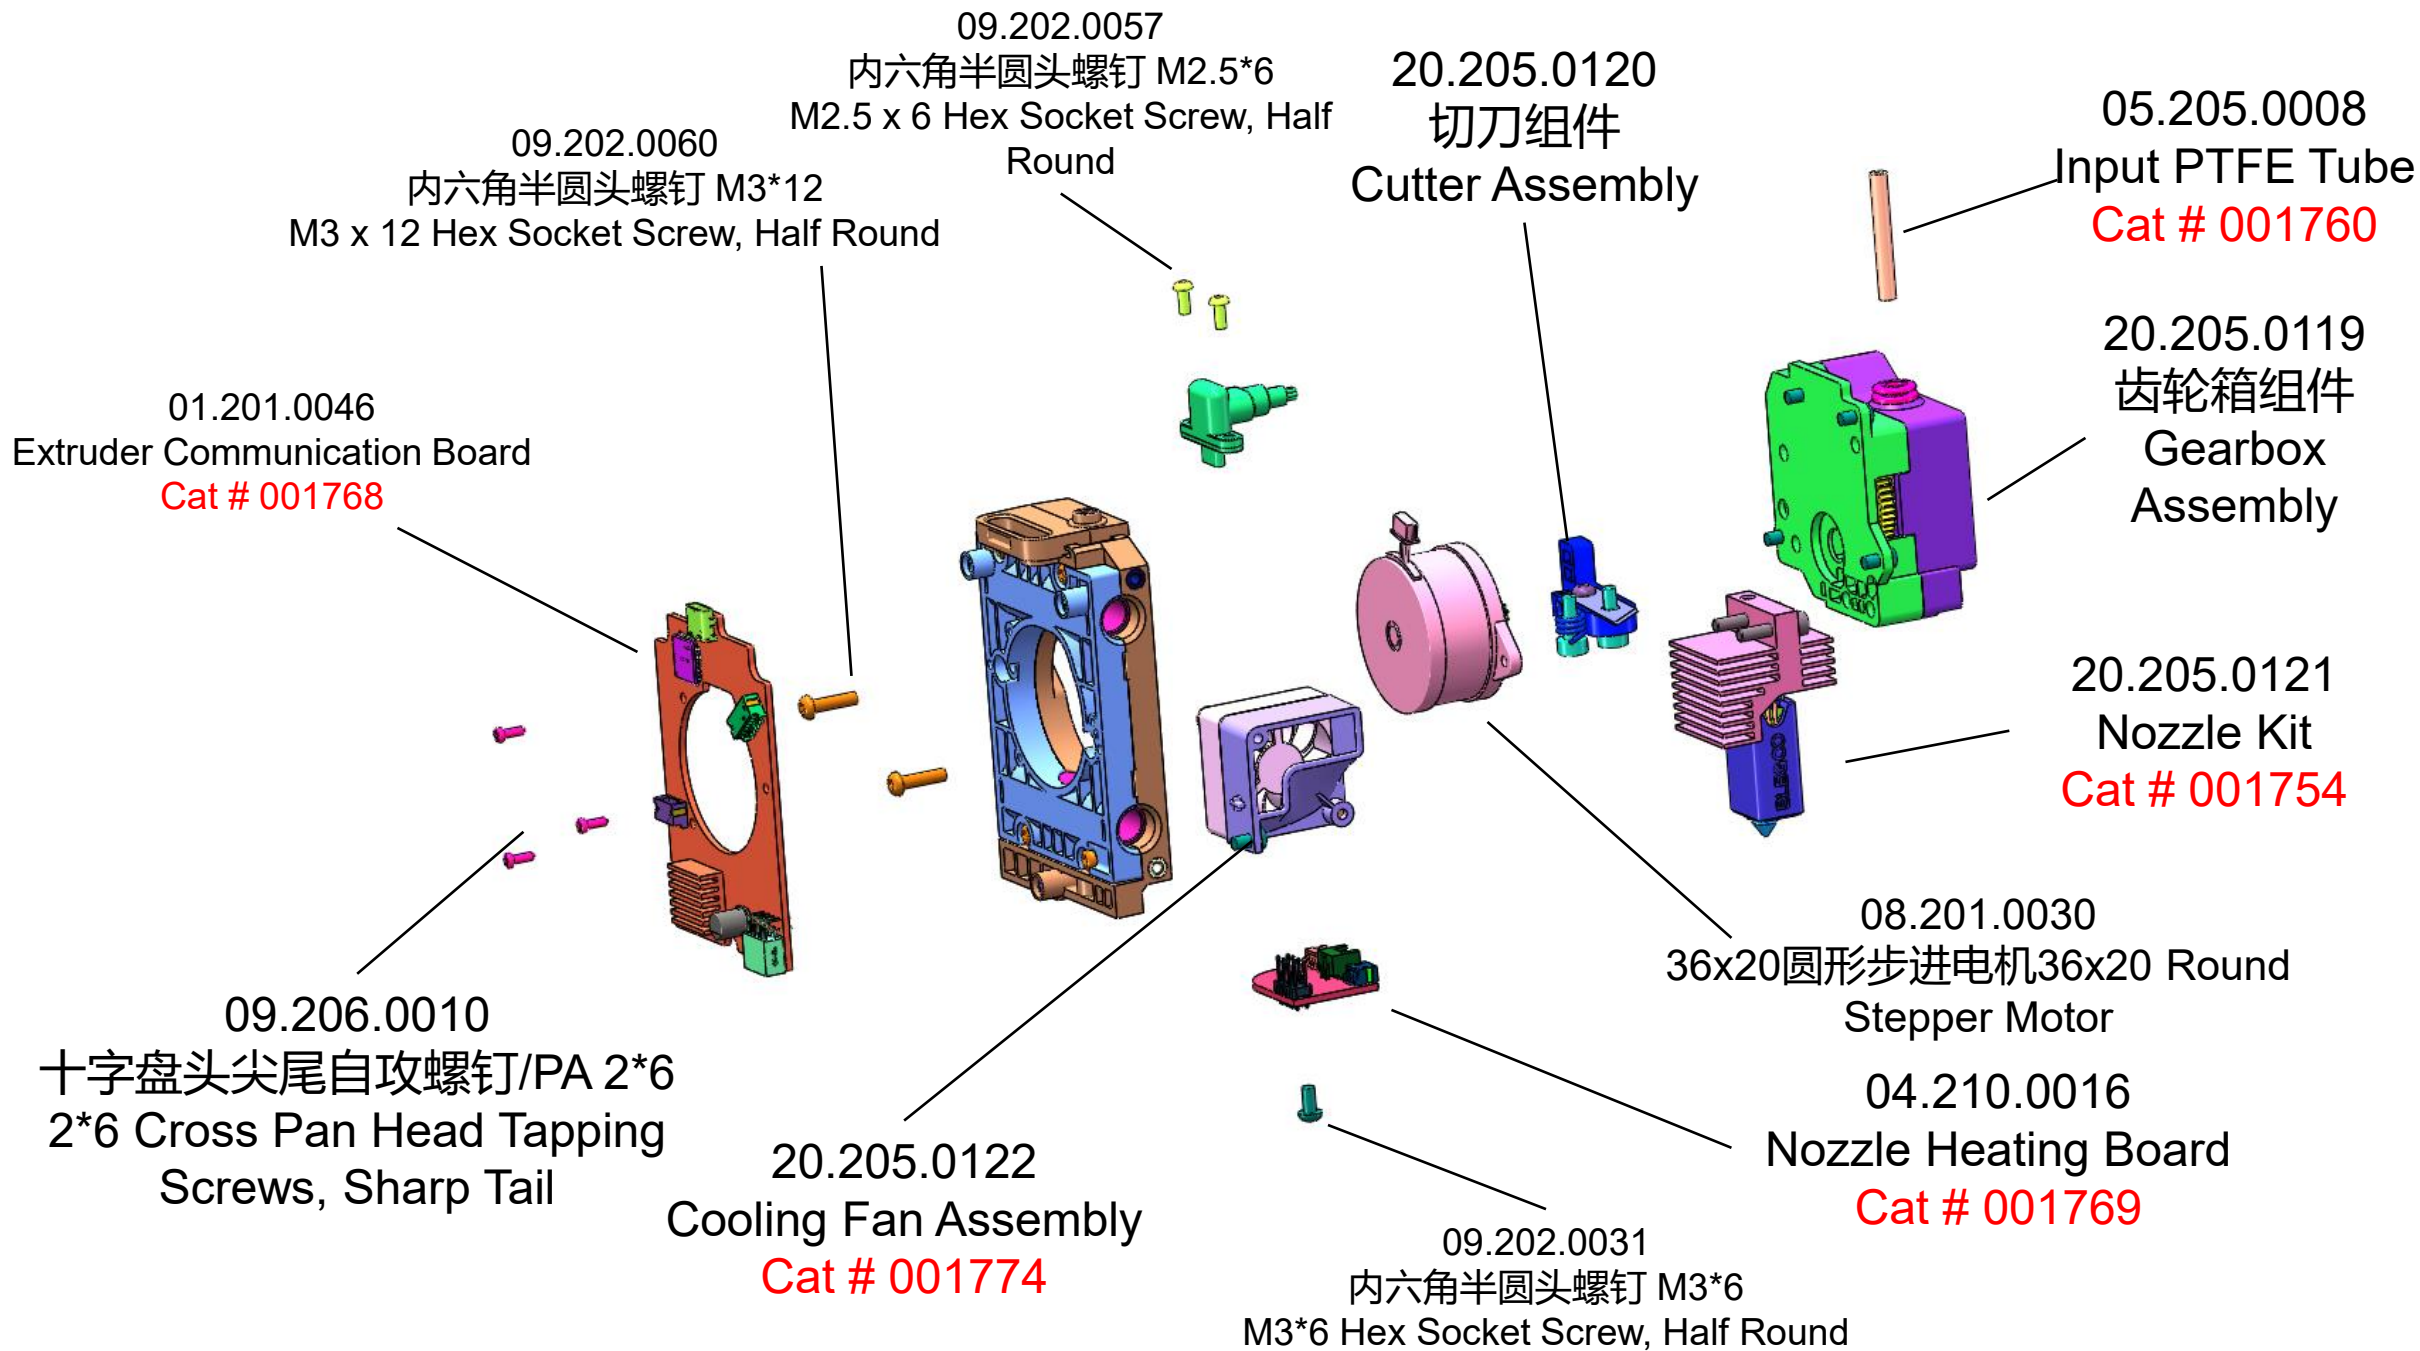

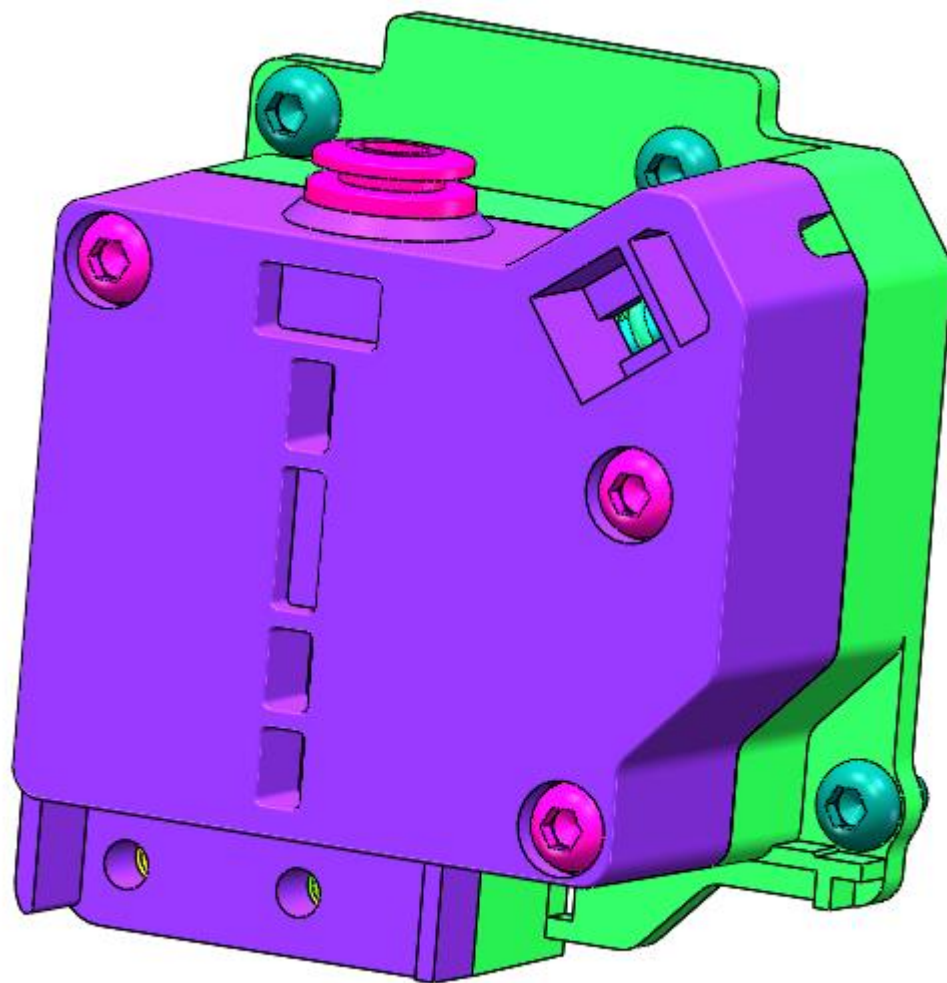

20.205.0119
齿轮箱组件
Gearbox Assembly

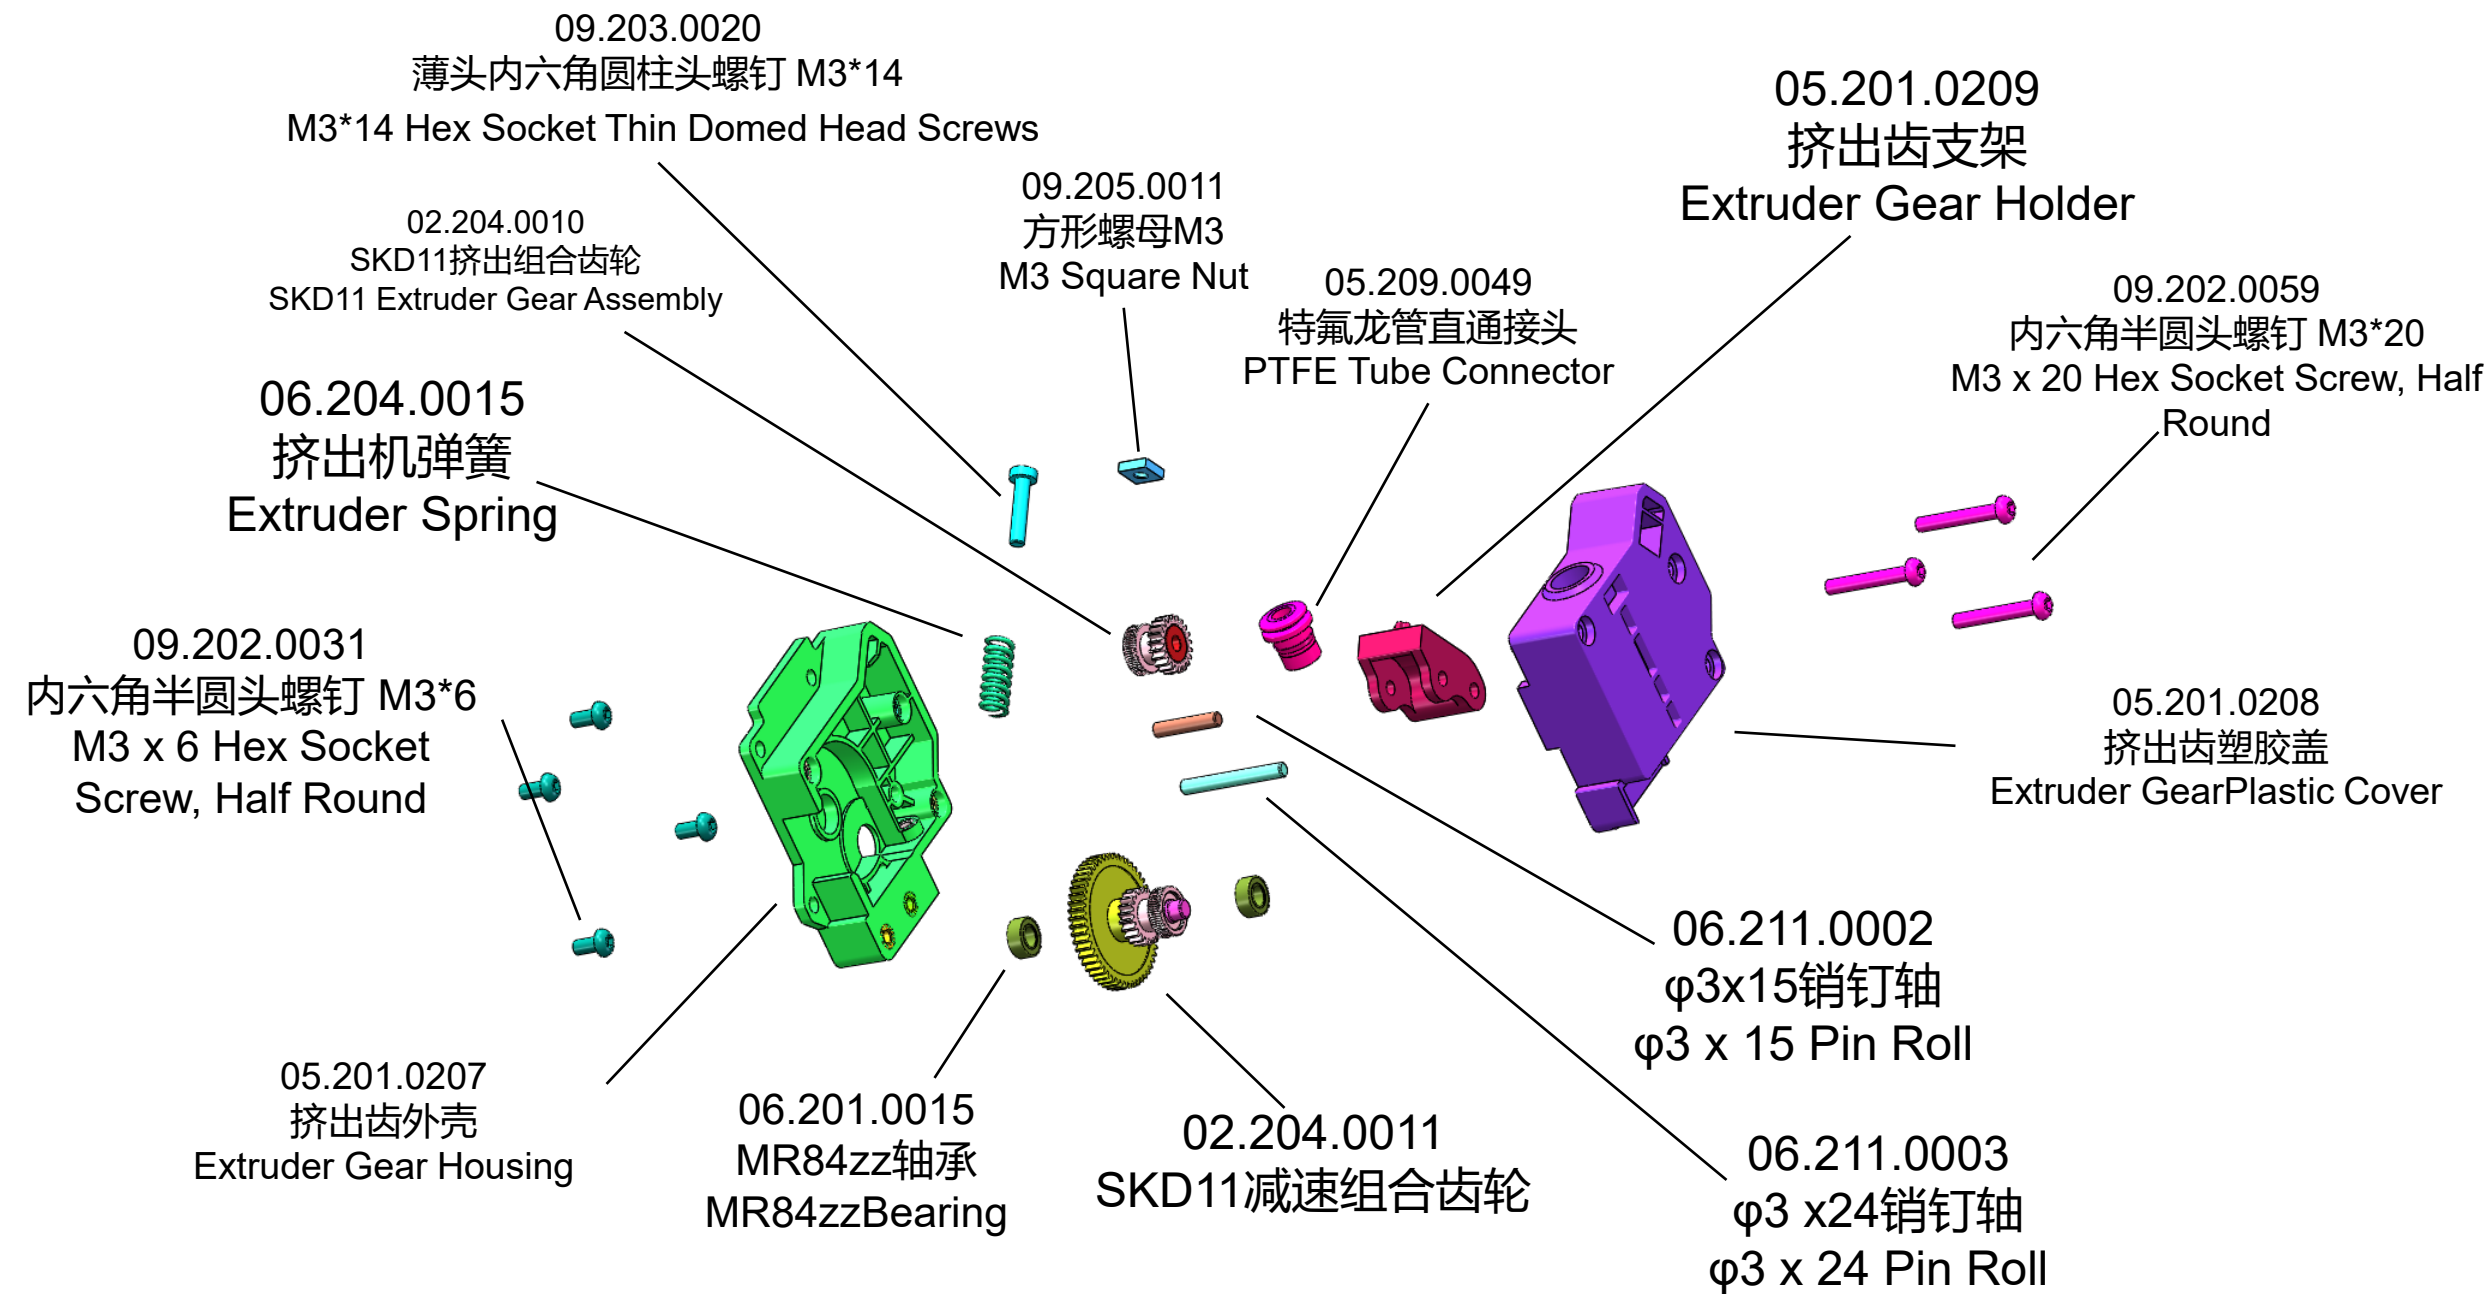

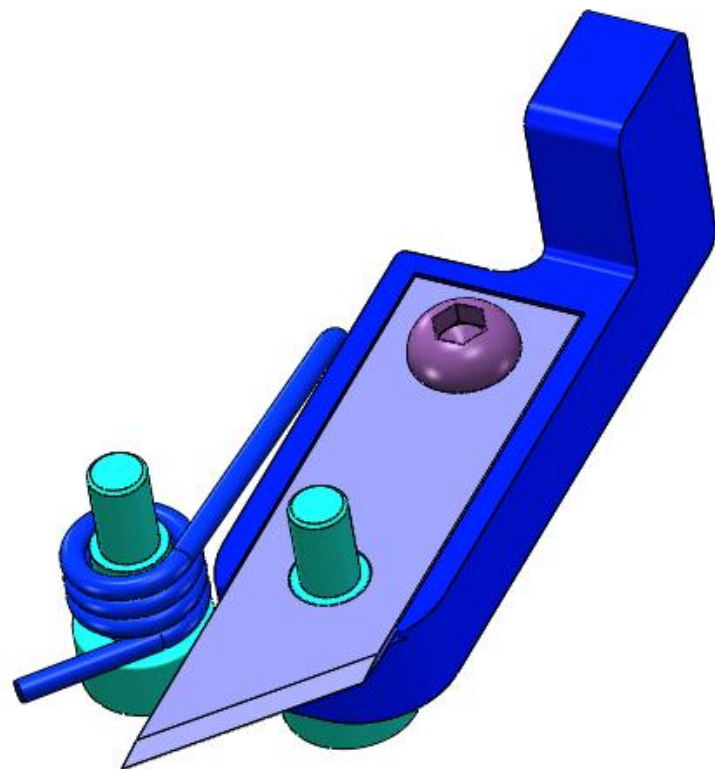


20.205.0120
切刀组件
Cutter Assembly


09.202.0058
内六角半圆头螺钉 M3*4
M3 x 4 Hex Socket Screw, Half Round




06.209.0019
耗材切刀
Filament Cutter

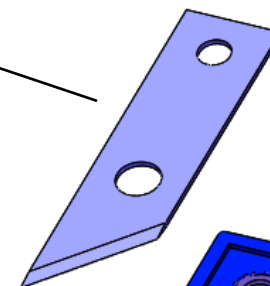

06.204.0016
切刀扭簧
Torsion Spring of the
Cutter

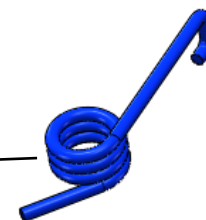


05.201.0210
切刀支架
Cutter Holder

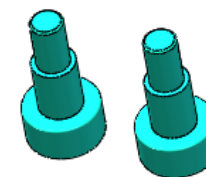


09.211.0008
扁平头内六角台阶螺钉
Hex Socket Flat Head Stepper Screws


20.205.0121
Nozzle Kit
Cat # 001754

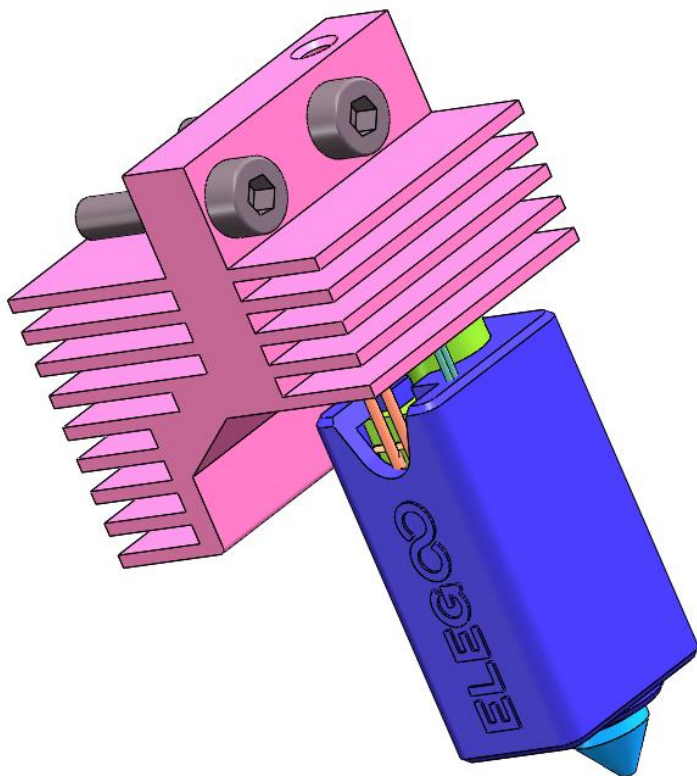


02.208.0008
Hot End Assembly
Cat # 001776

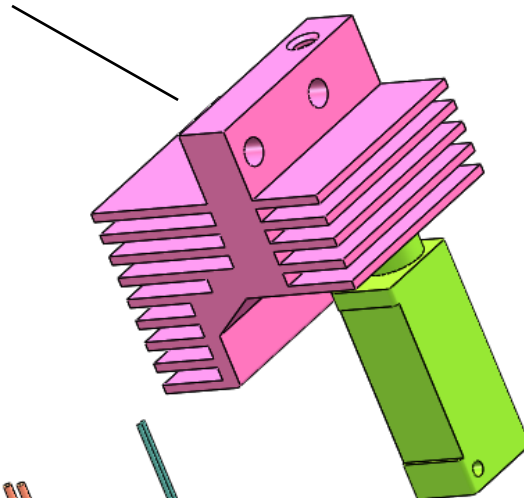


09.101.0230
杯头内六角螺丝
Hex Socket Cup Head Screw

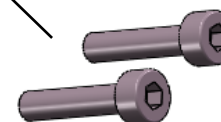


03.203.0008
加热片卡环
Heating Plate Clip

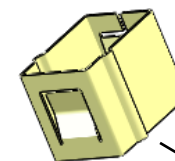

02.207.0055
Brass Hardened Steel Nozzle
Cat # 001778

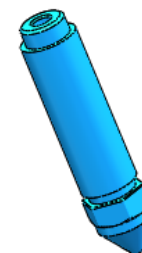

04.210.0018
陶瓷加热片
Ceramic Heating Plate

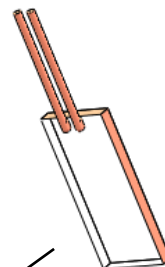

04.208.0020
Nozzle Thermistor
Cat # 001770




05.209.0038
加热块硅胶套
Silicone Case of the
Heating Block



09.206.0020


十字盘头平尾自攻螺钉 3*14

3*14 Cross Pan Head Tapping Screws, Flat Tail

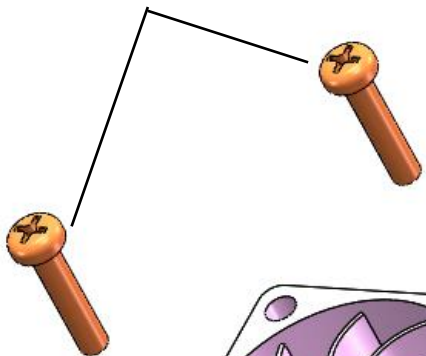

04.203.0029
3010 Axial Fan


Cat # 001775

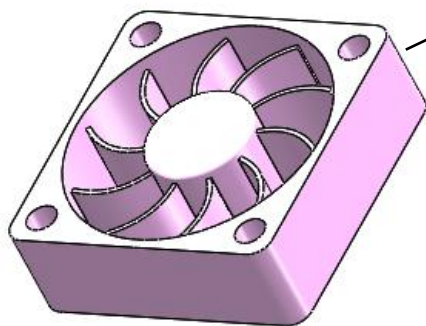

09.202.0031

内六角半圆头螺钉 M3*6

M3 x 6 Hex Socket
Screw, Half Round

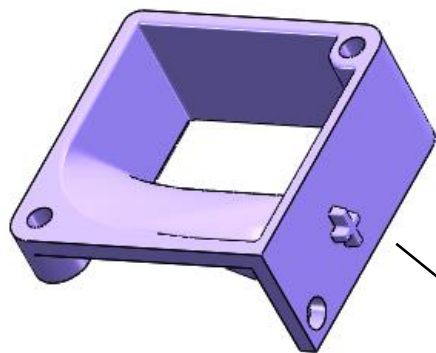



05.201.0201
散热片导风件
Heatsink Air Guide
Assembly

20.205.0122


Cooling Fan Assembly


Cat # 001774

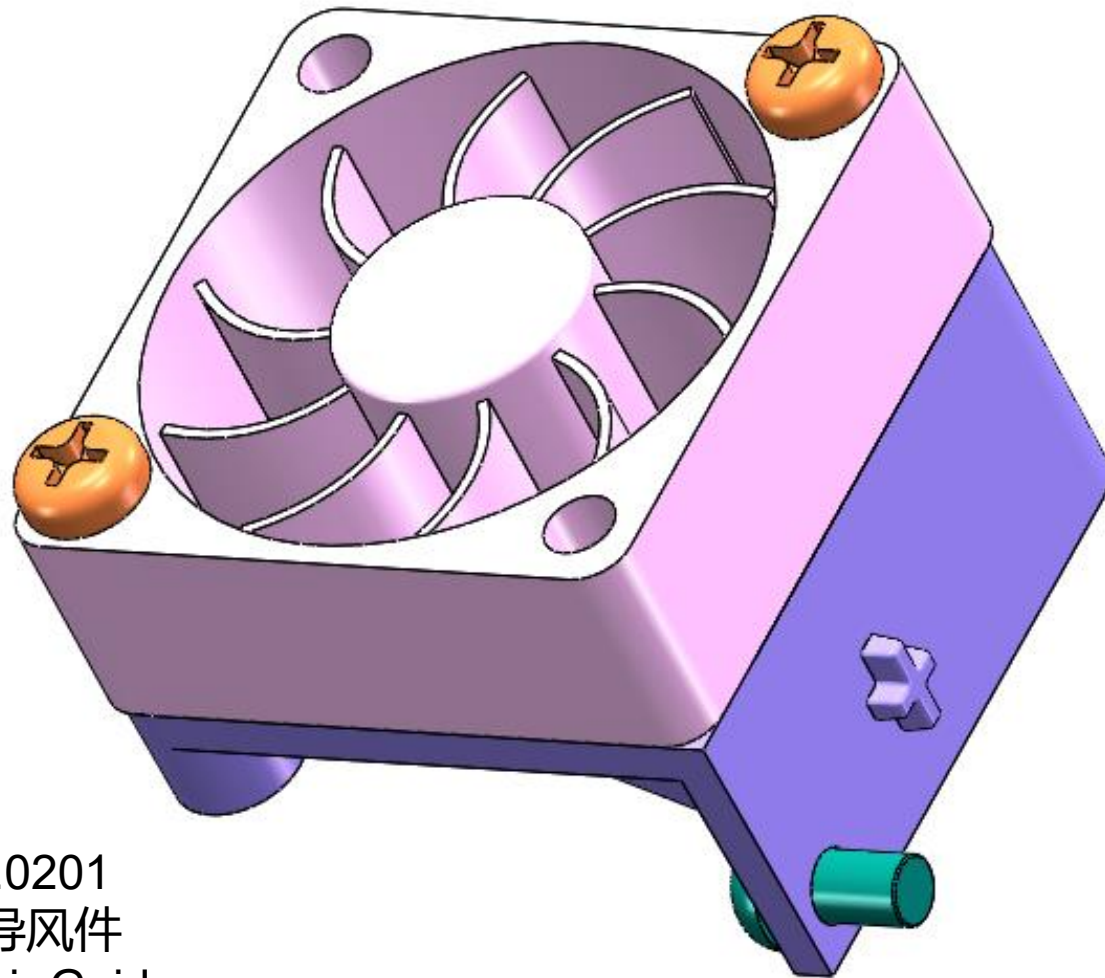

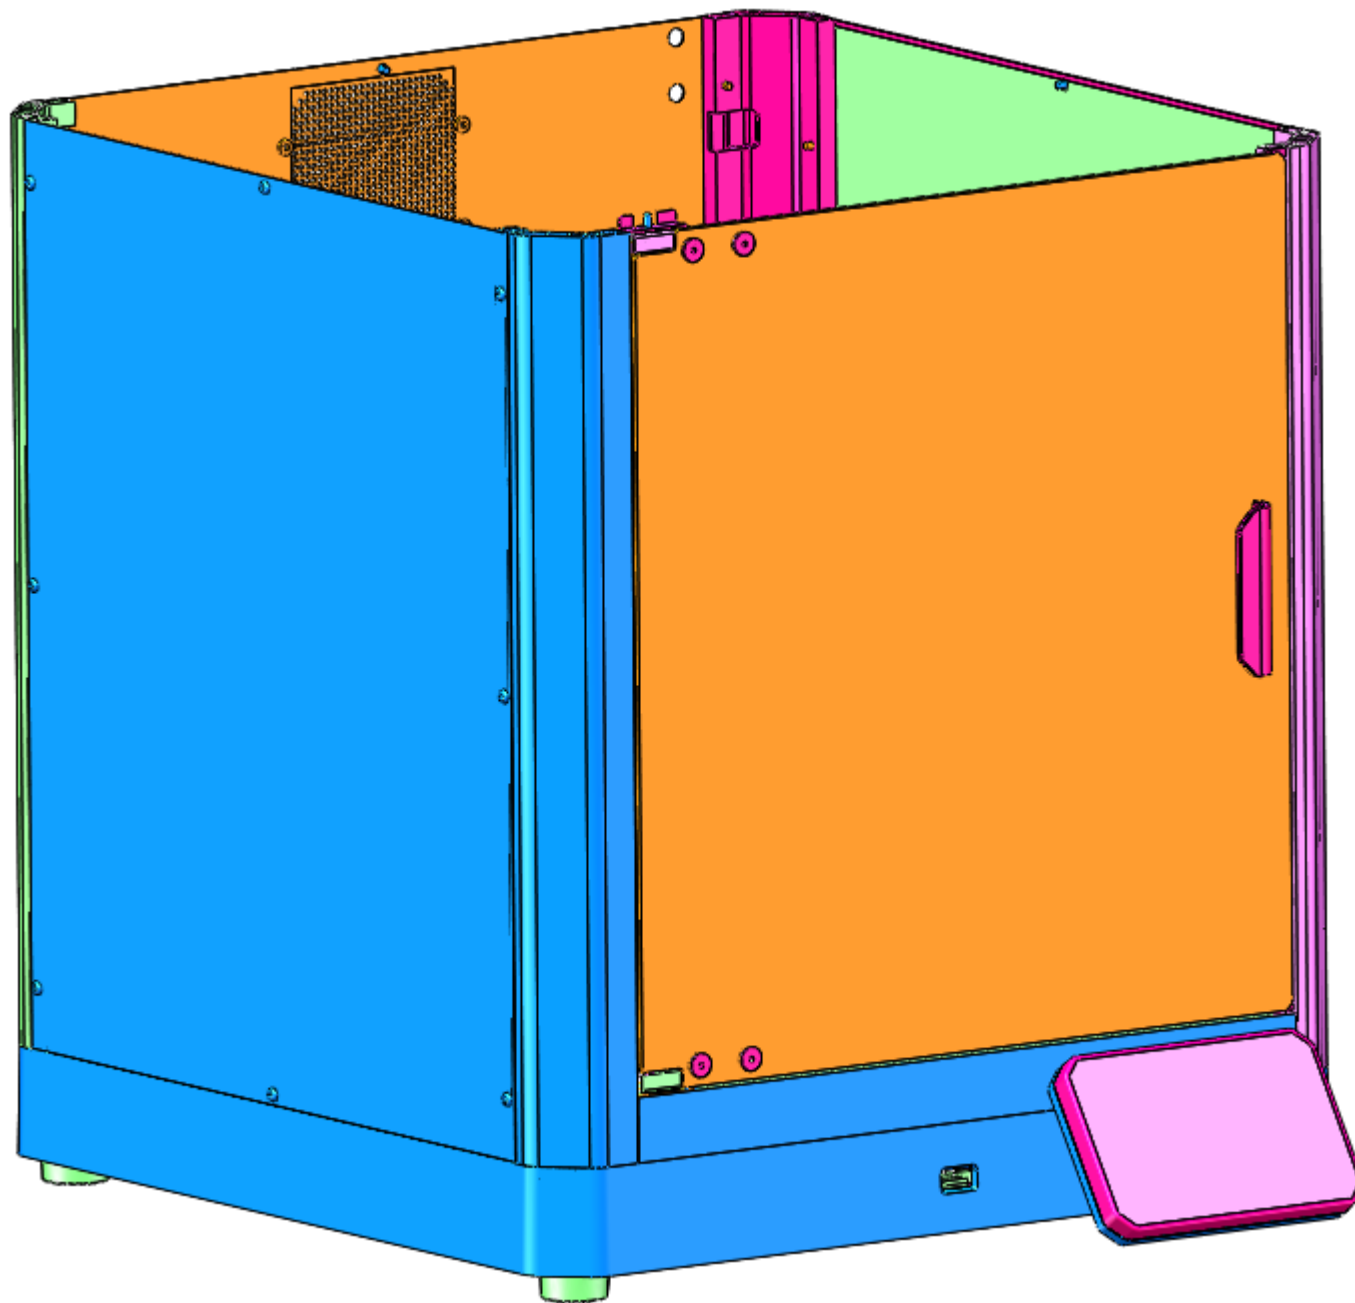


20.203.0078
下层套件
Lower Kit

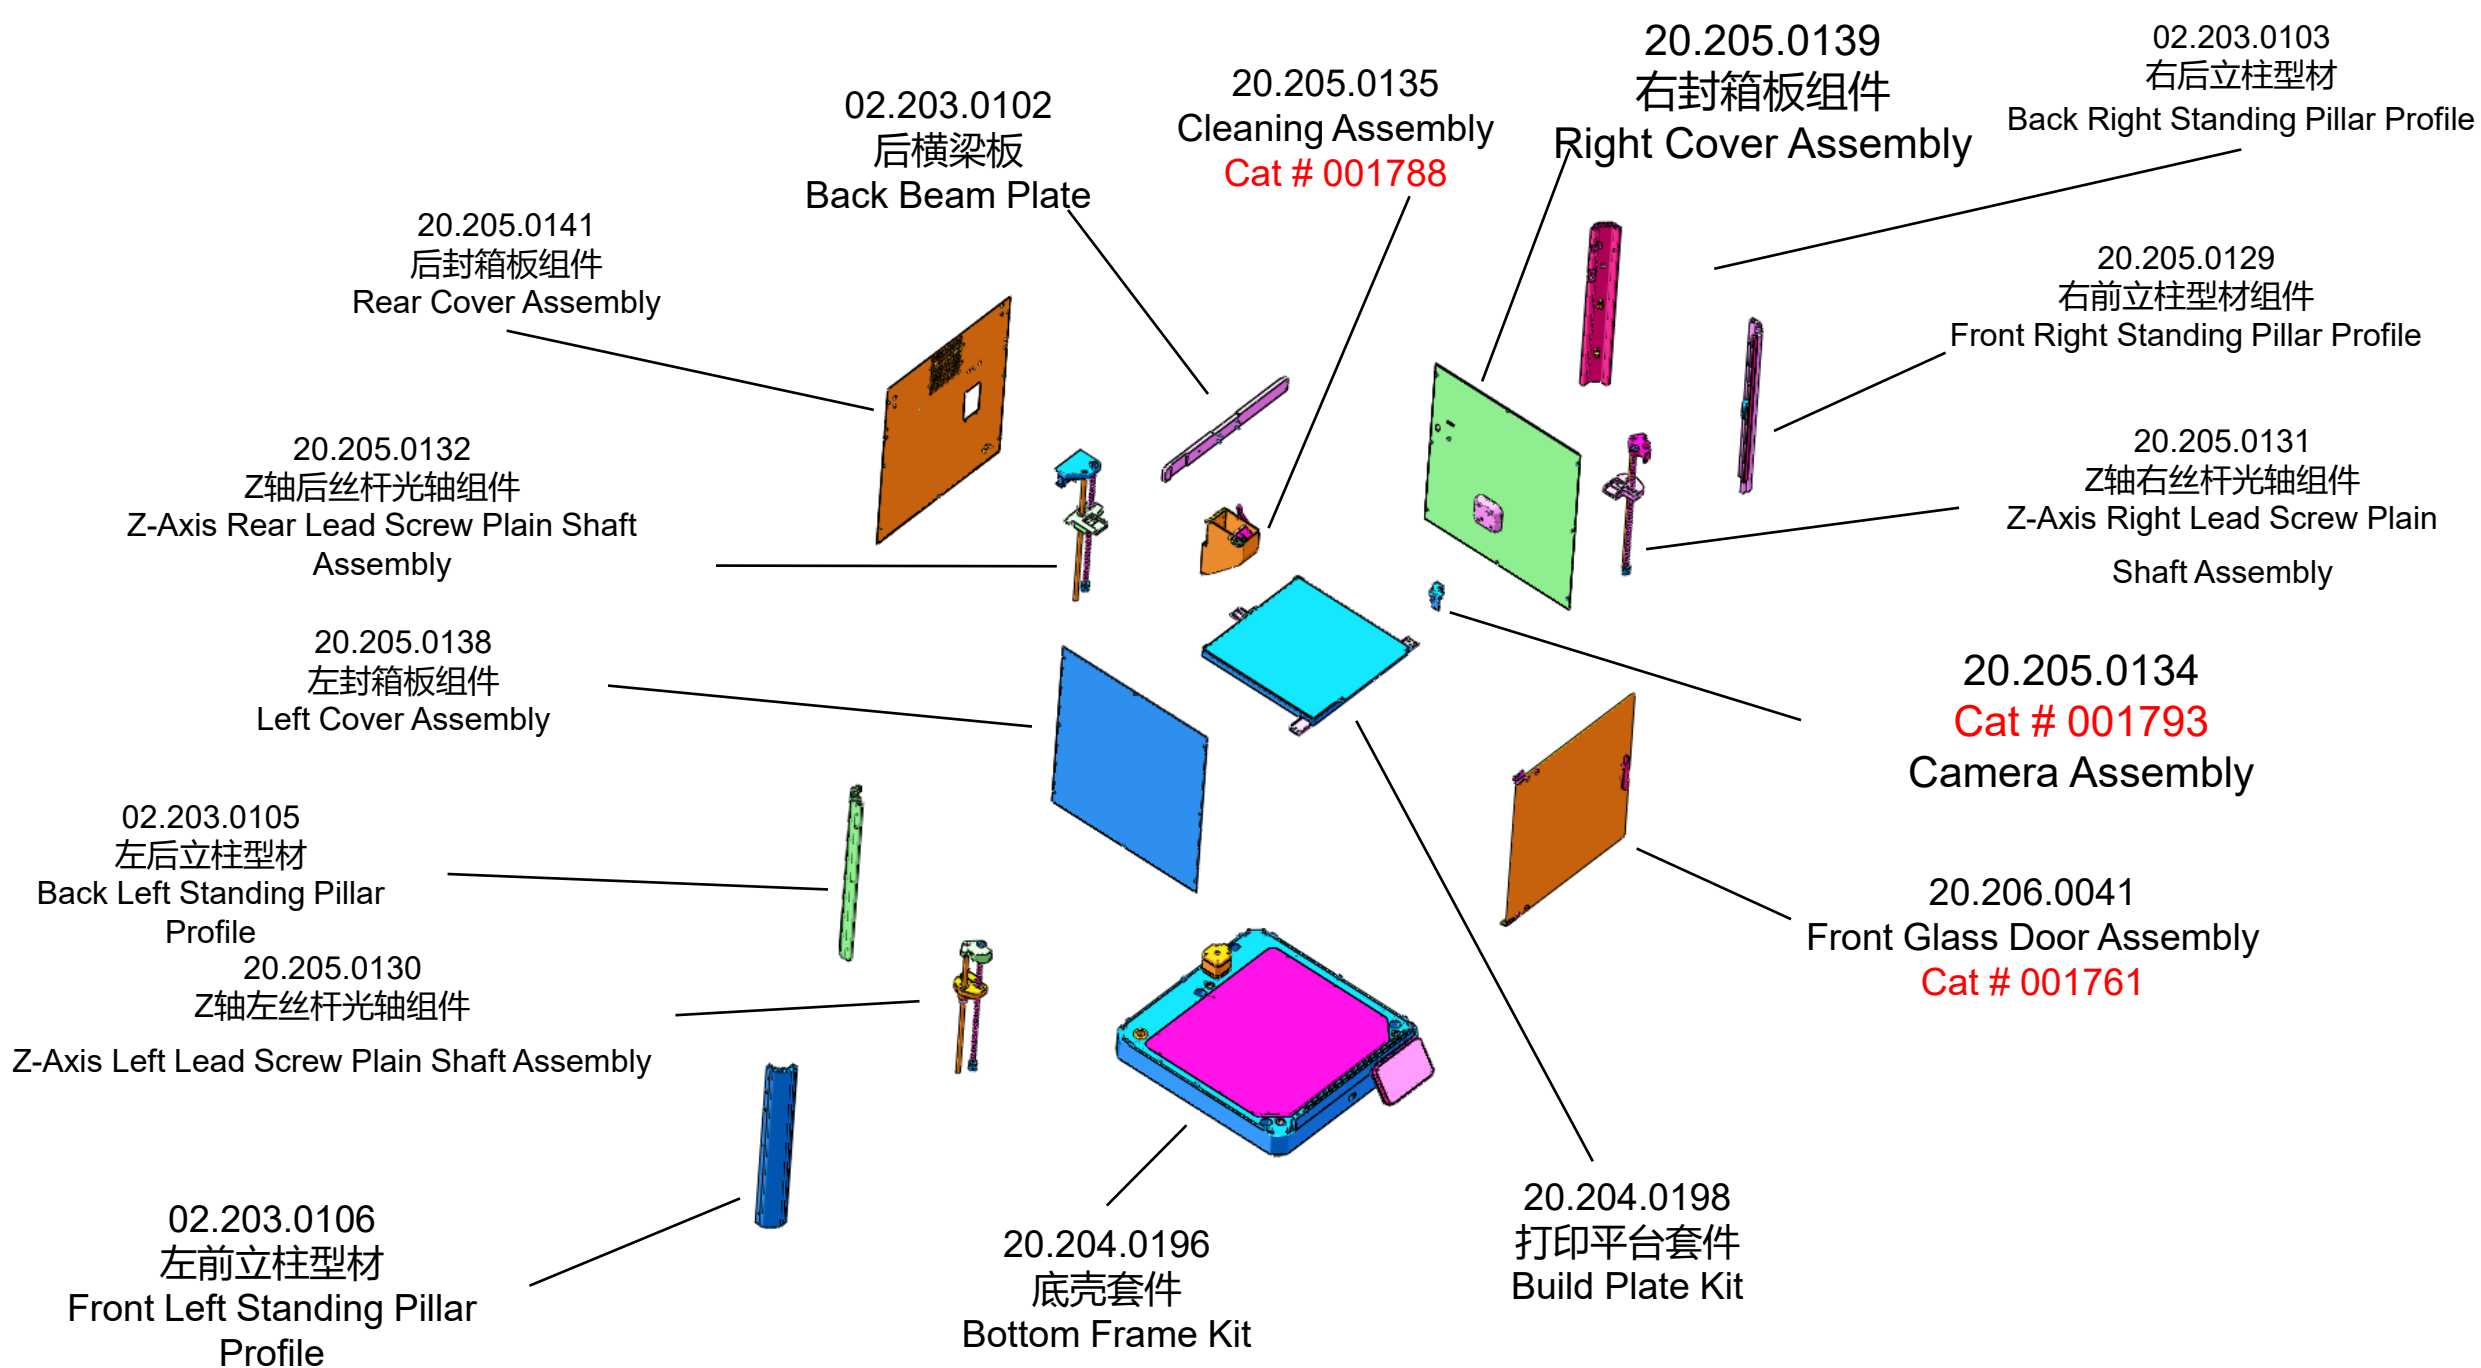

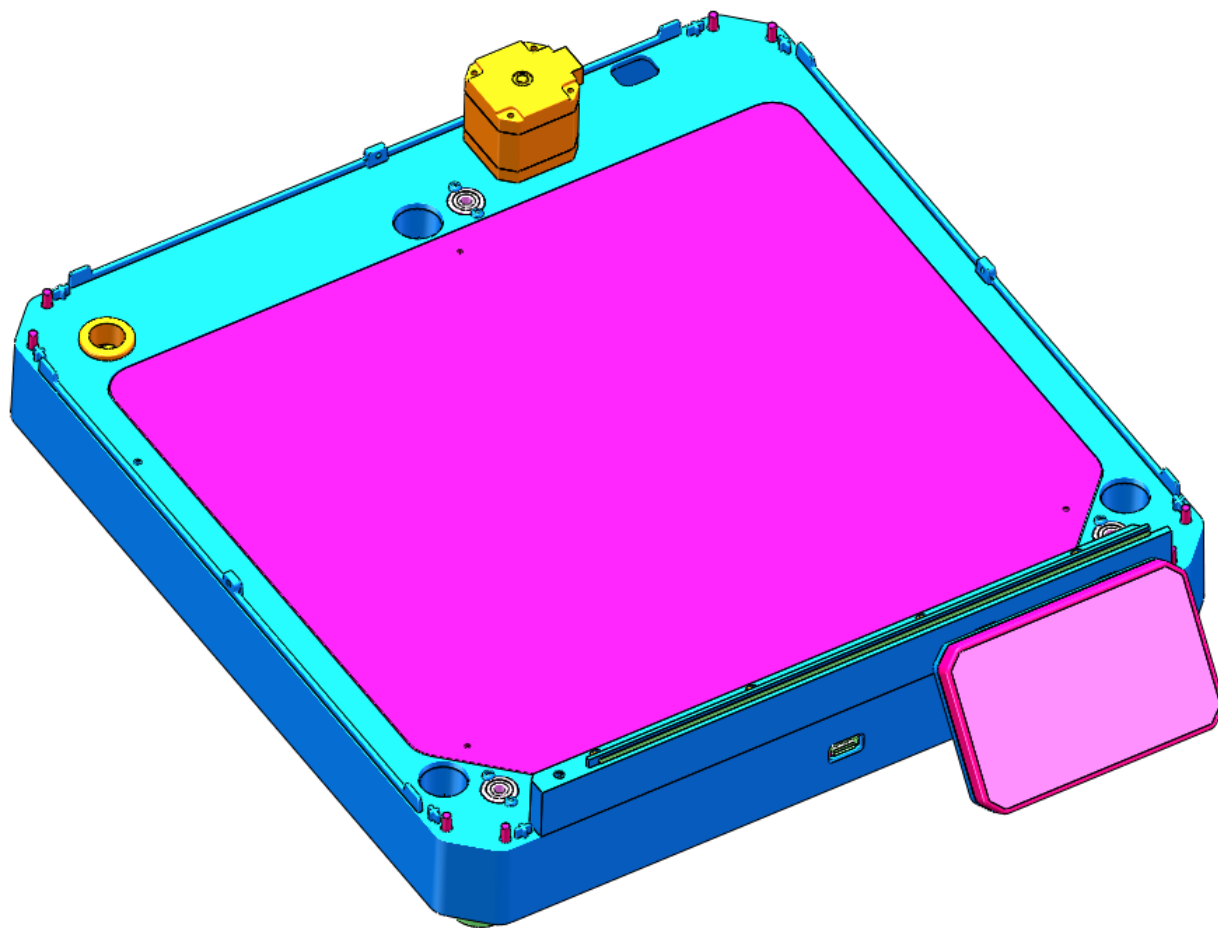

20.204.0196
底壳套件
Bottom Frame Kit

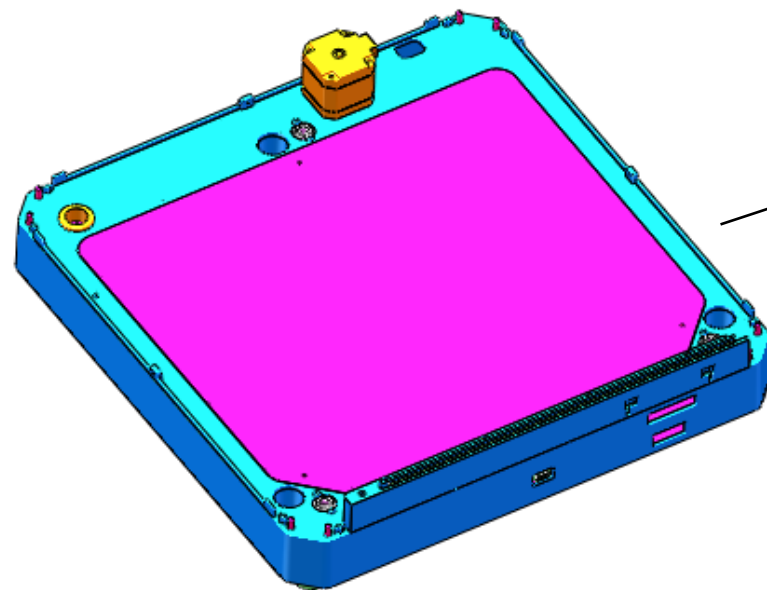


20.205.0125
底部框架组件
Bottom Frame Kit

20.205.0126
开关组件
Switch Assembly




20.205.0127
Z轴同步带张紧器组件
Z-Axis Timing Belt
Tensioner Assembly

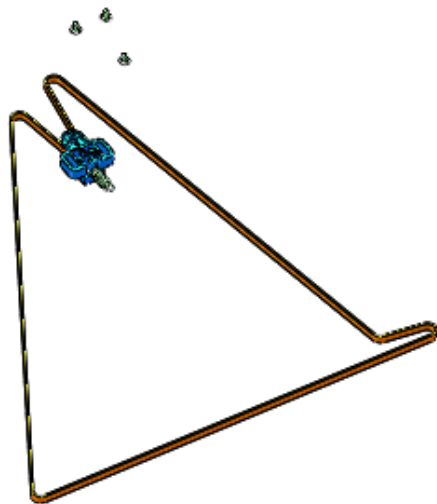


20.205.0128
Screen Assembly
Cat # 001773

Ribbon cable for
Screen
Cat # 001794


03.202.0117
底部盖板
Bottom Cover

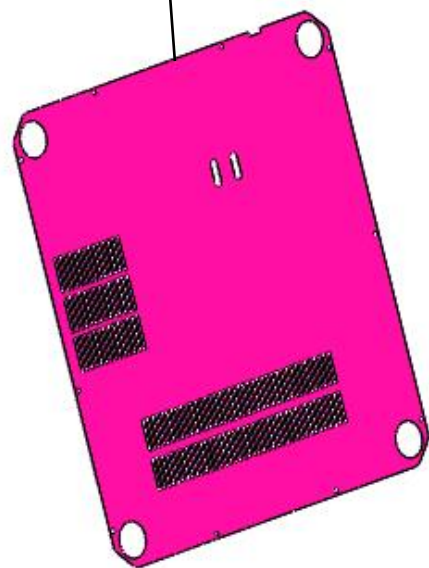


02.202.0010
底部框架板-B版本
Bottom Frame Plate-B Version

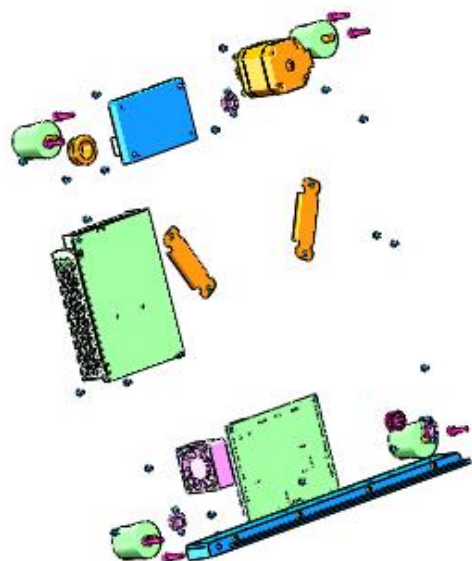


03.202.0103
压铸底壳上封闭板
Closed Plate of the Die Casting Pan

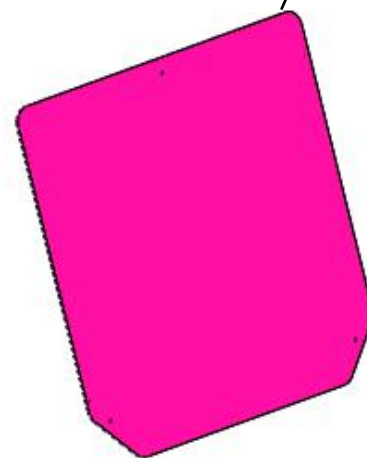

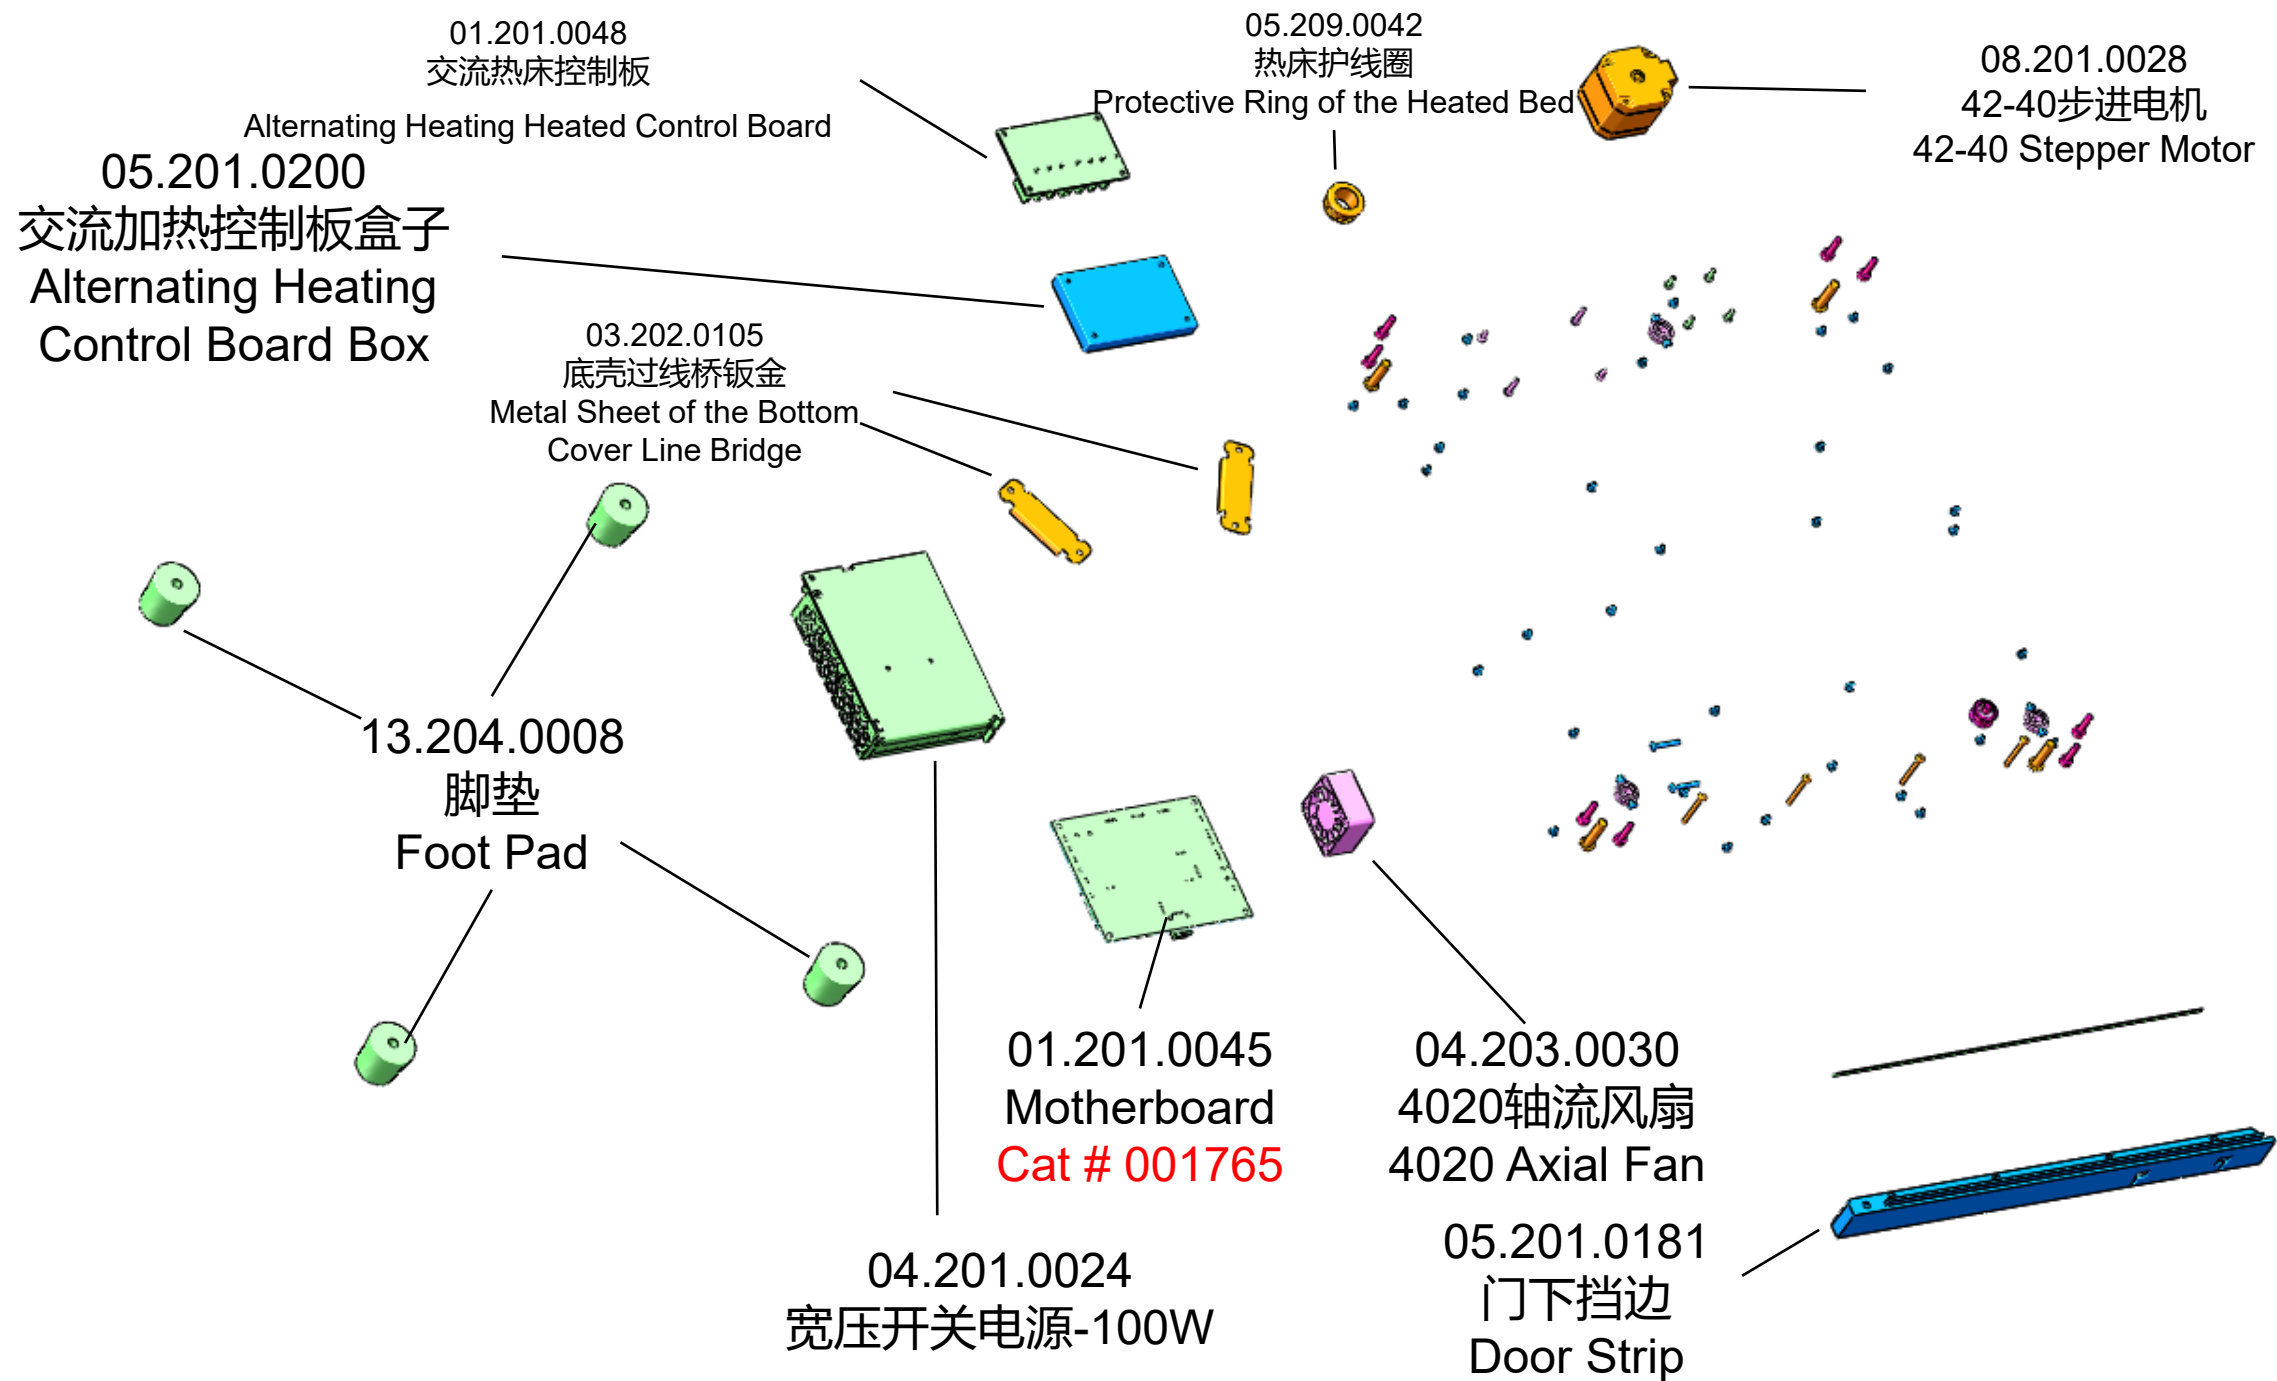





06.210.0004
同步带惰轮
Timing Belt Idler

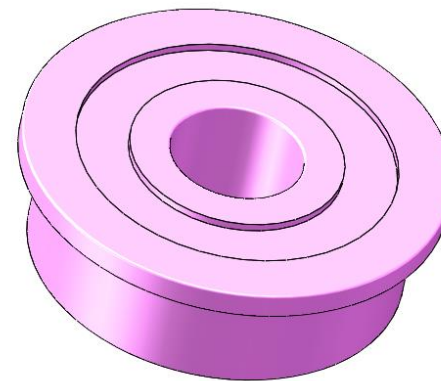

06.201.0030
F605ZZ法兰轴承
F605ZZ Flange Bearing

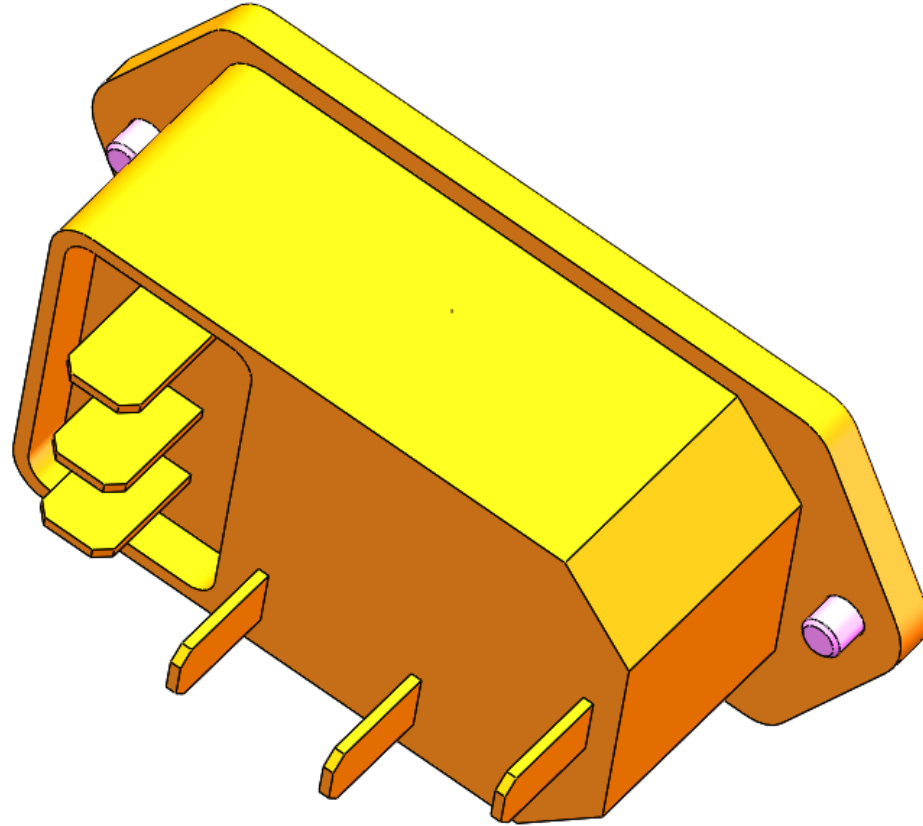

20.205.0146
开关组件
Switch Assembly

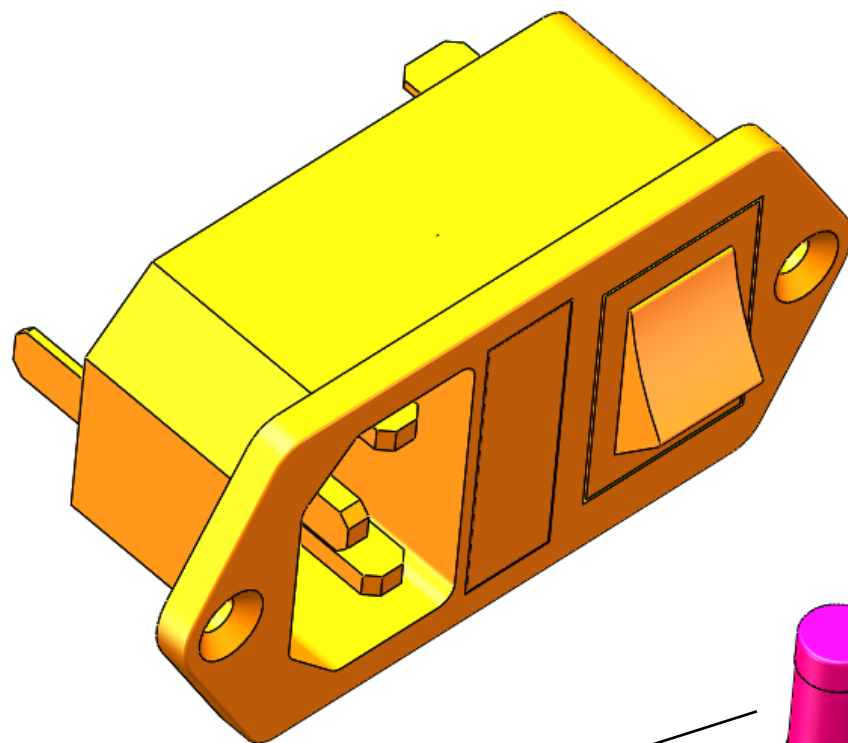

04.202.0010
组合开关
Switch Assembly

04.206.0002
保险丝
Fuse




09.201.0032
内六角沉头螺钉 M3*6
M3 x 6 Hex Socket Countersunk
Screws




20.205.0128
Screen Assembly
Cat # 001773

Ribbon cable for
Screen
Cat # 001794


09.202.0062
内六角半圆头螺钉 M3*8
M3 x 8 Hex Socket Screw, Half Round

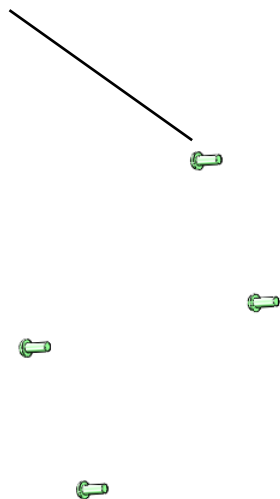


05.201.0198
屏幕后盖
Back Cover of the
Screen

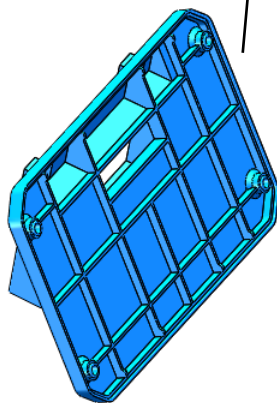


05.201.0197
屏幕壳
Screen Housing

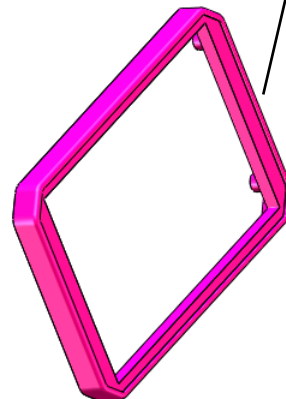

07.201.0010
显示屏
Screen

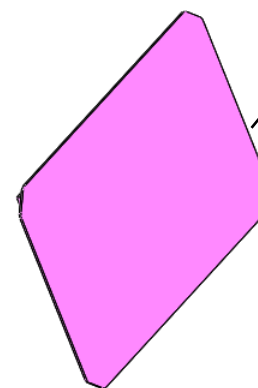

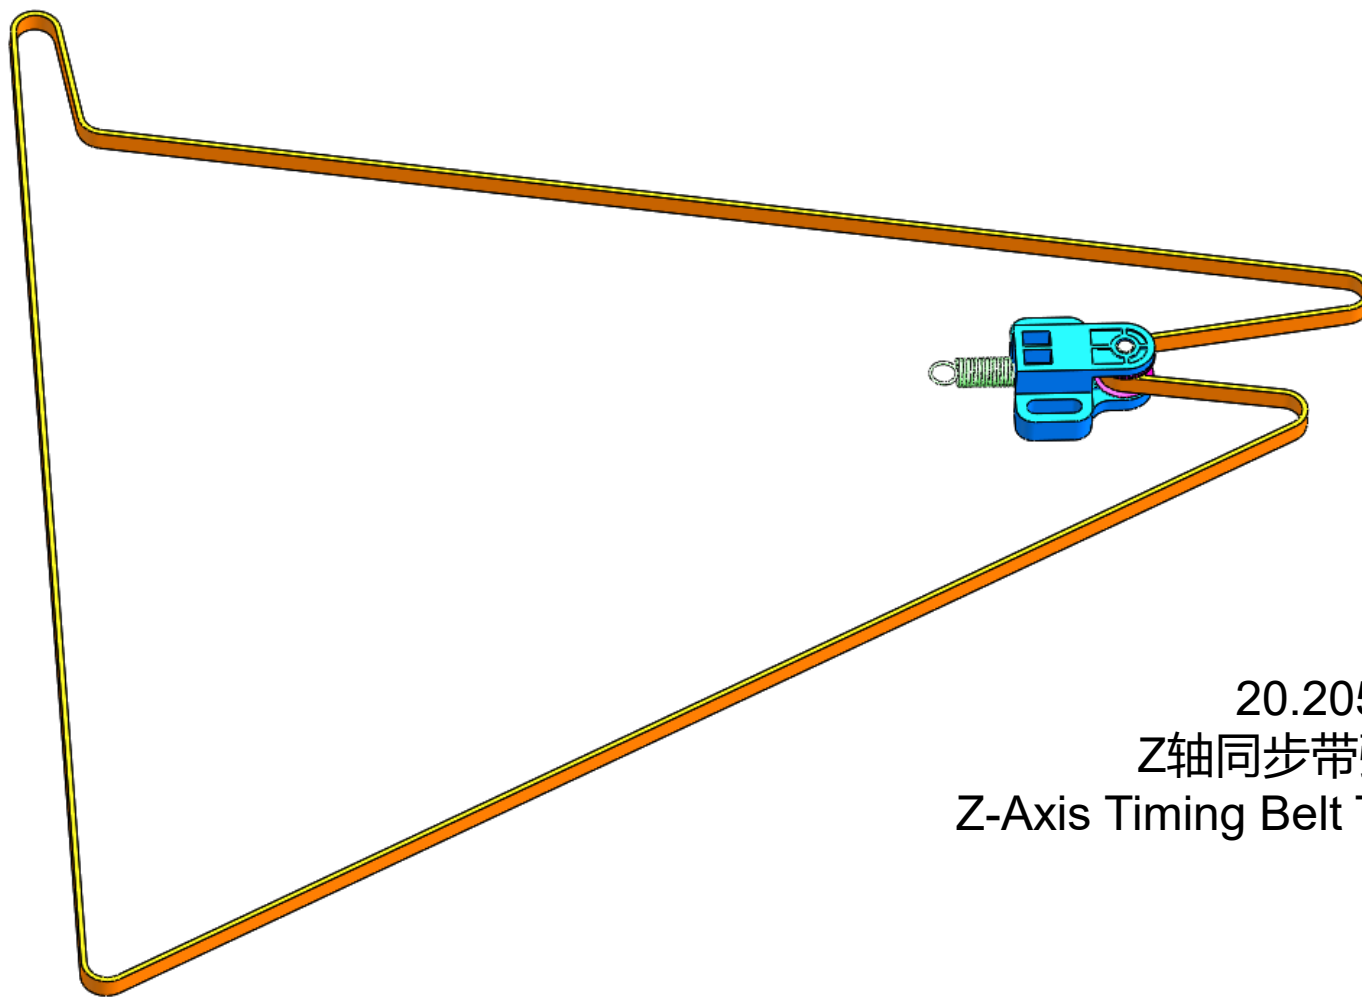

20.205.0127

Z轴同步带张紧器组件

Z-Axis Timing Belt Tensioner Assembly

05.201.0215

Z轴皮带张紧惰轮座
Z-Axis Belt Tensioner
Base

06.208.0004


φ5x15mm销钉轴
φ5x15mm Pin Roll


06.204.0018
Z轴同步带拉簧
Z-Axis Timing Belt
Spring

06.210.0004


同步带惰轮
Timing Belt Idler


05.202.0013
Z轴同步皮带
Z-Axis Timing Belt

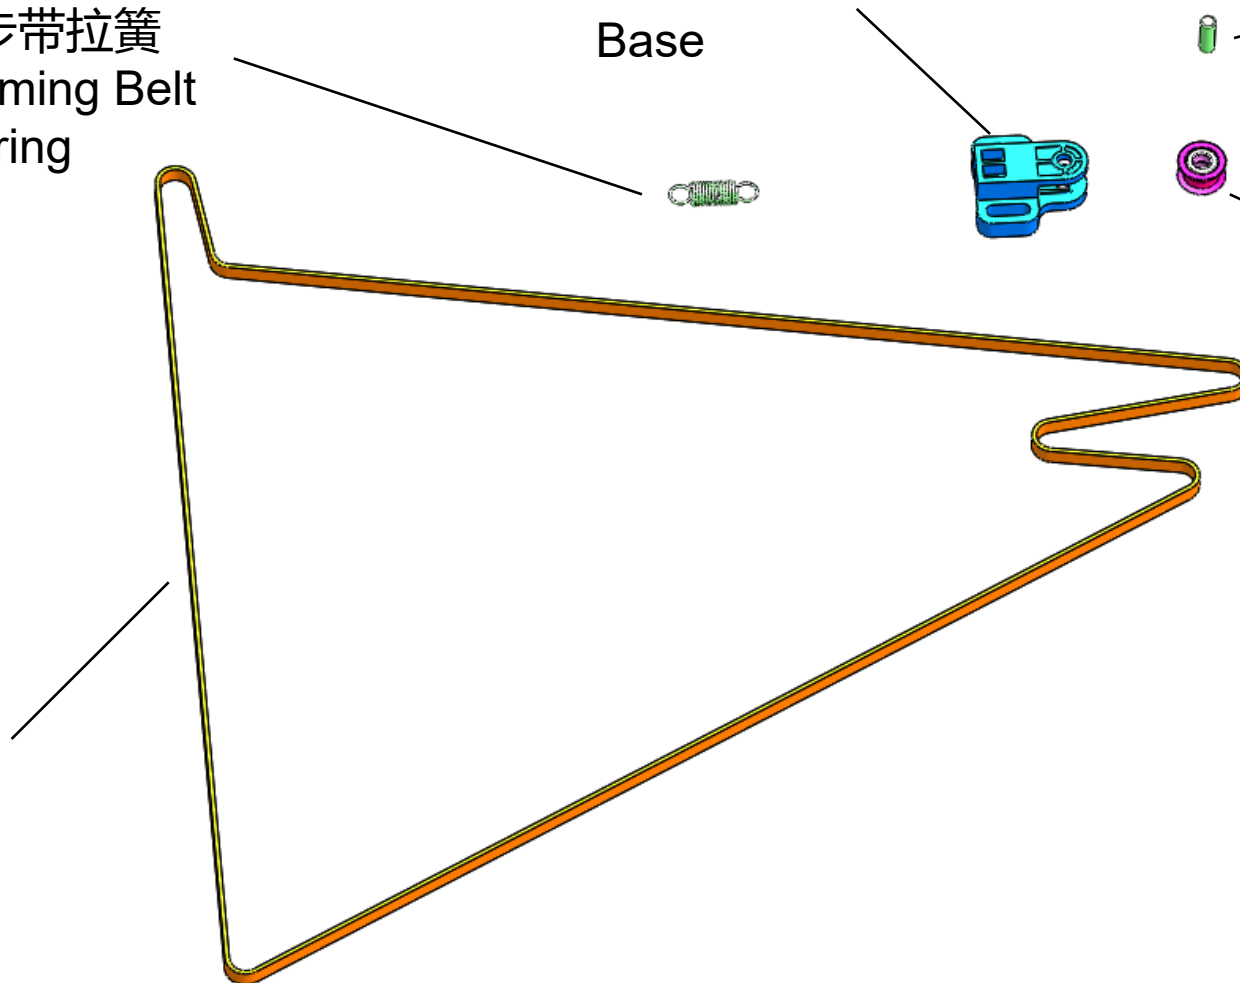

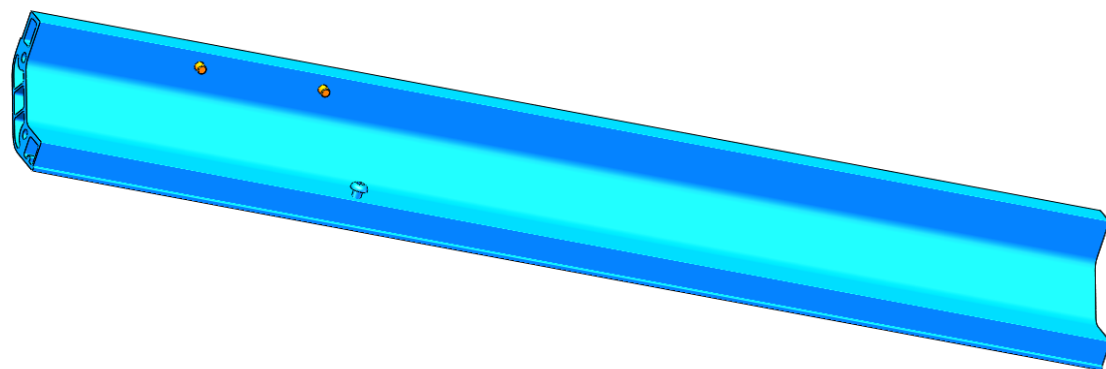



02.203.0106
左前立柱型材
Left Front Pillar Profile

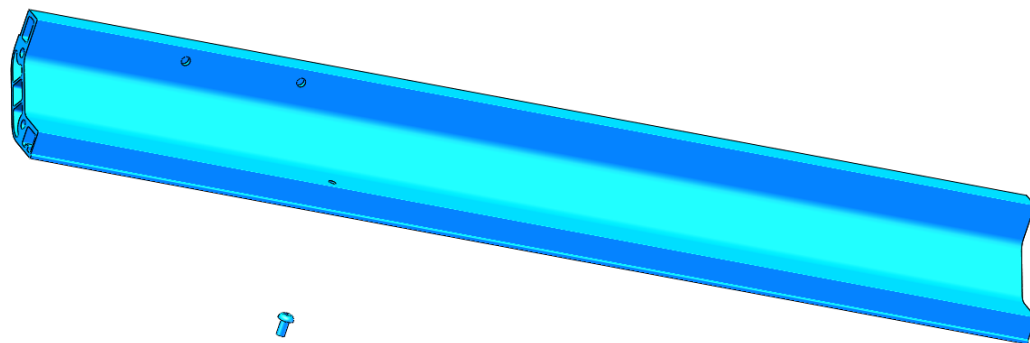

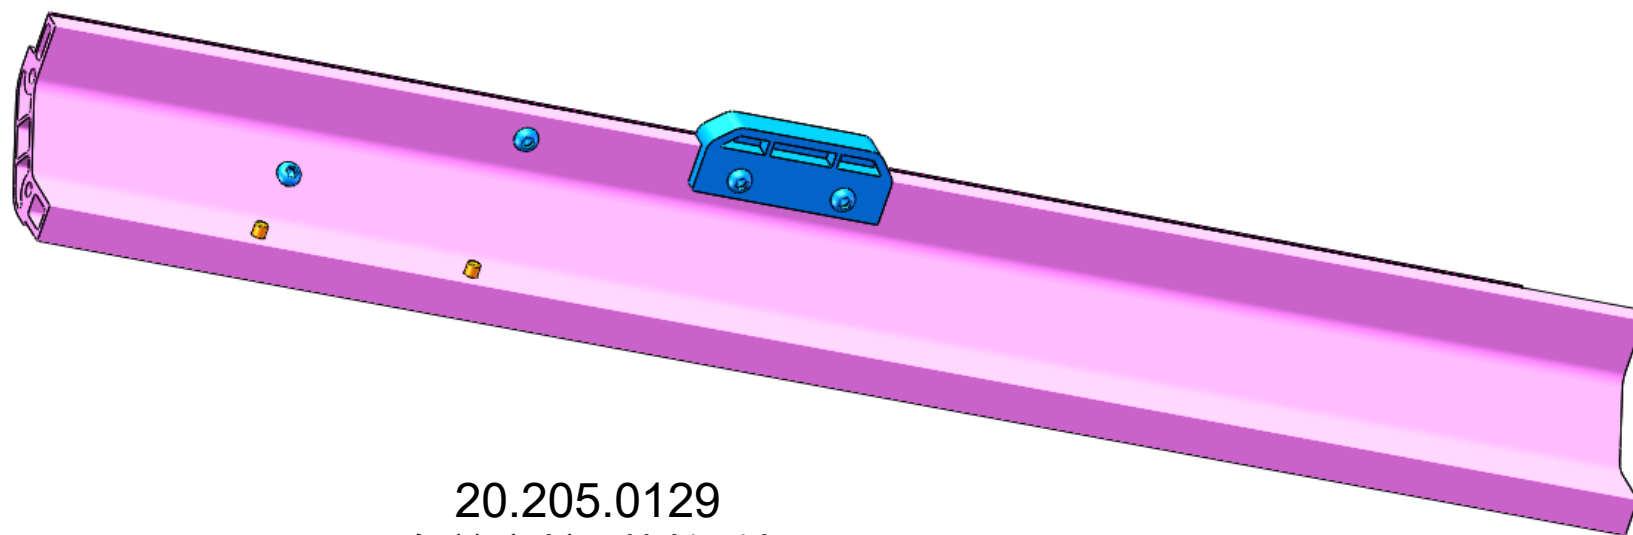

20.205.0129
右前立柱型材组件
Right Front Pillar Profile Assembly

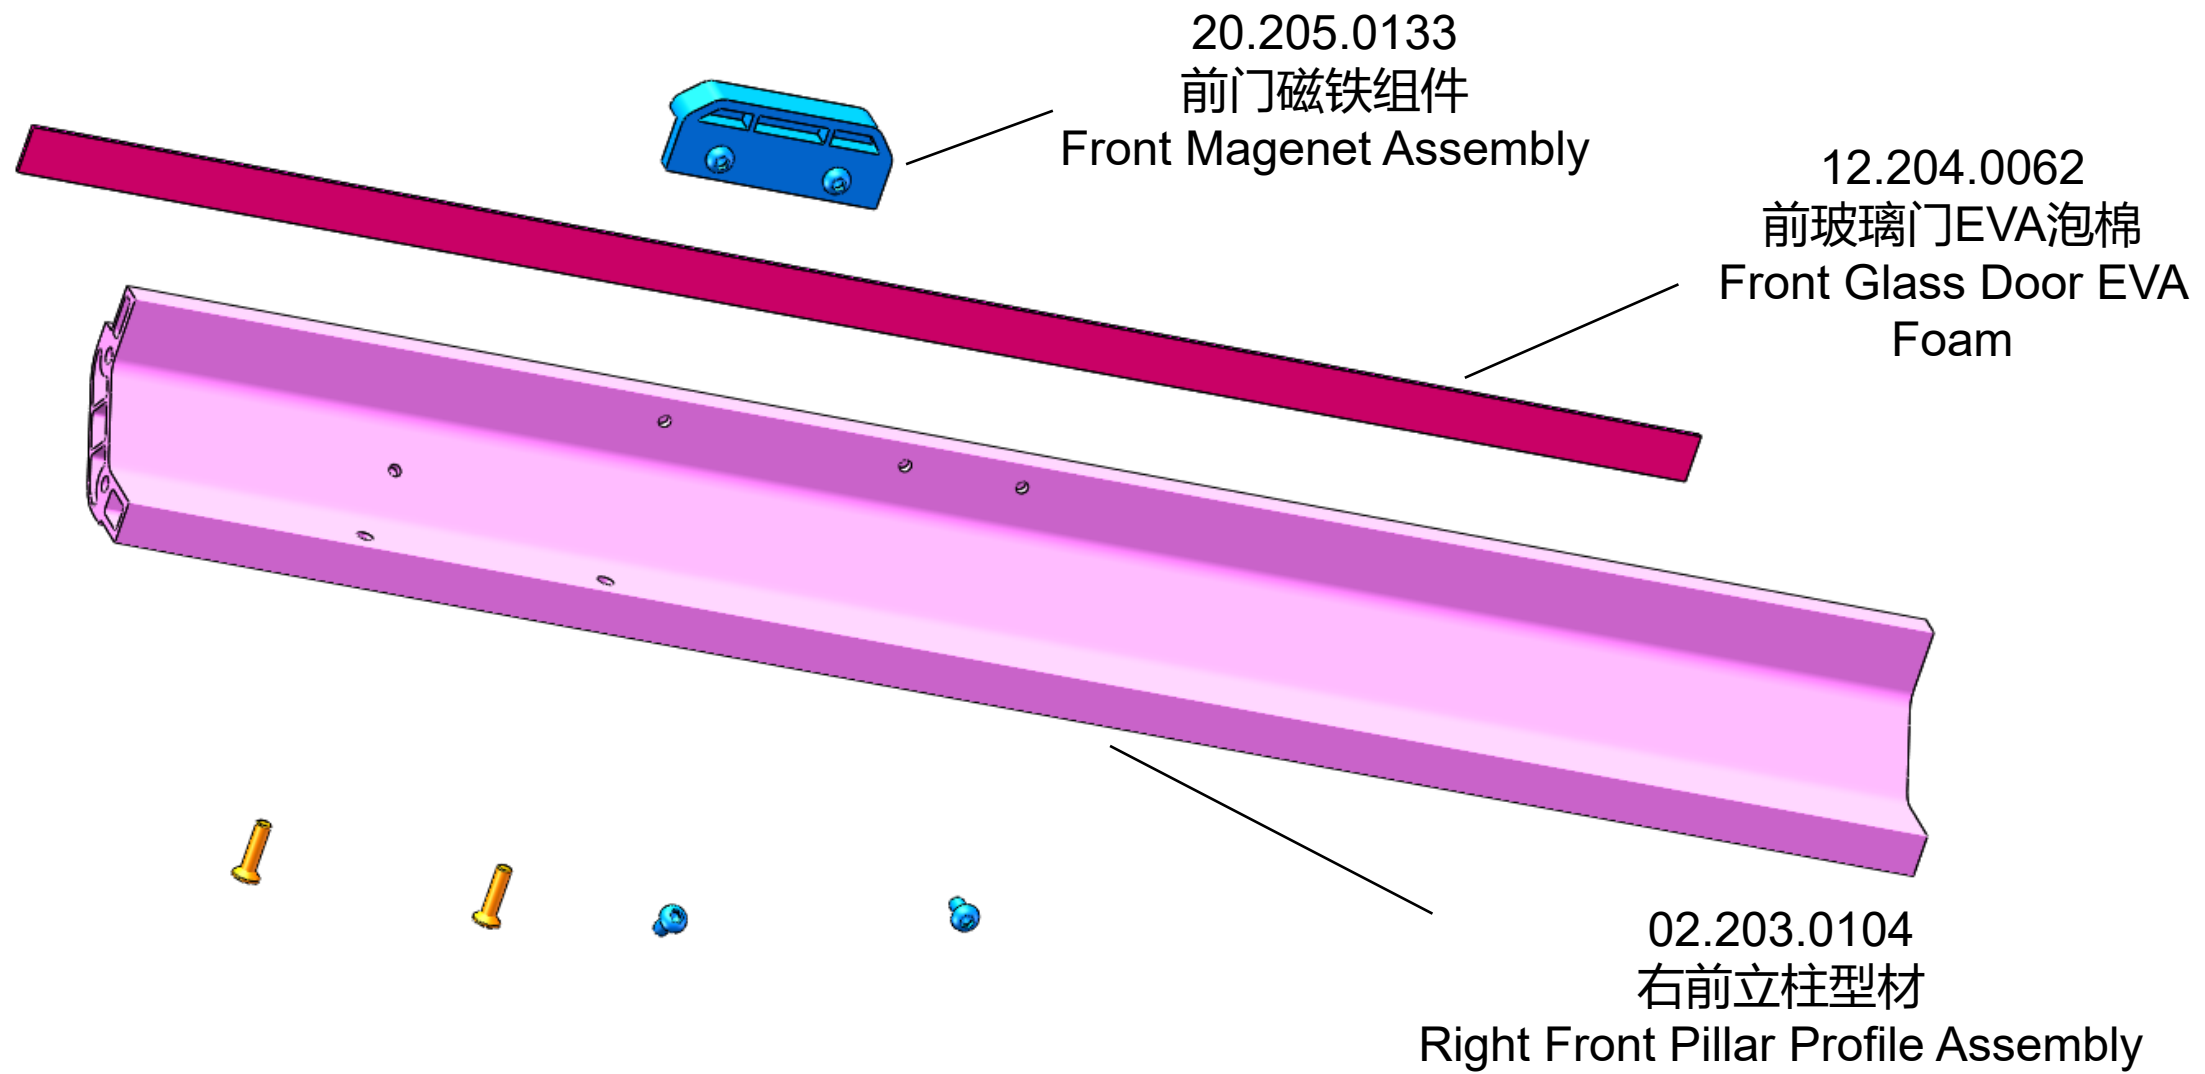

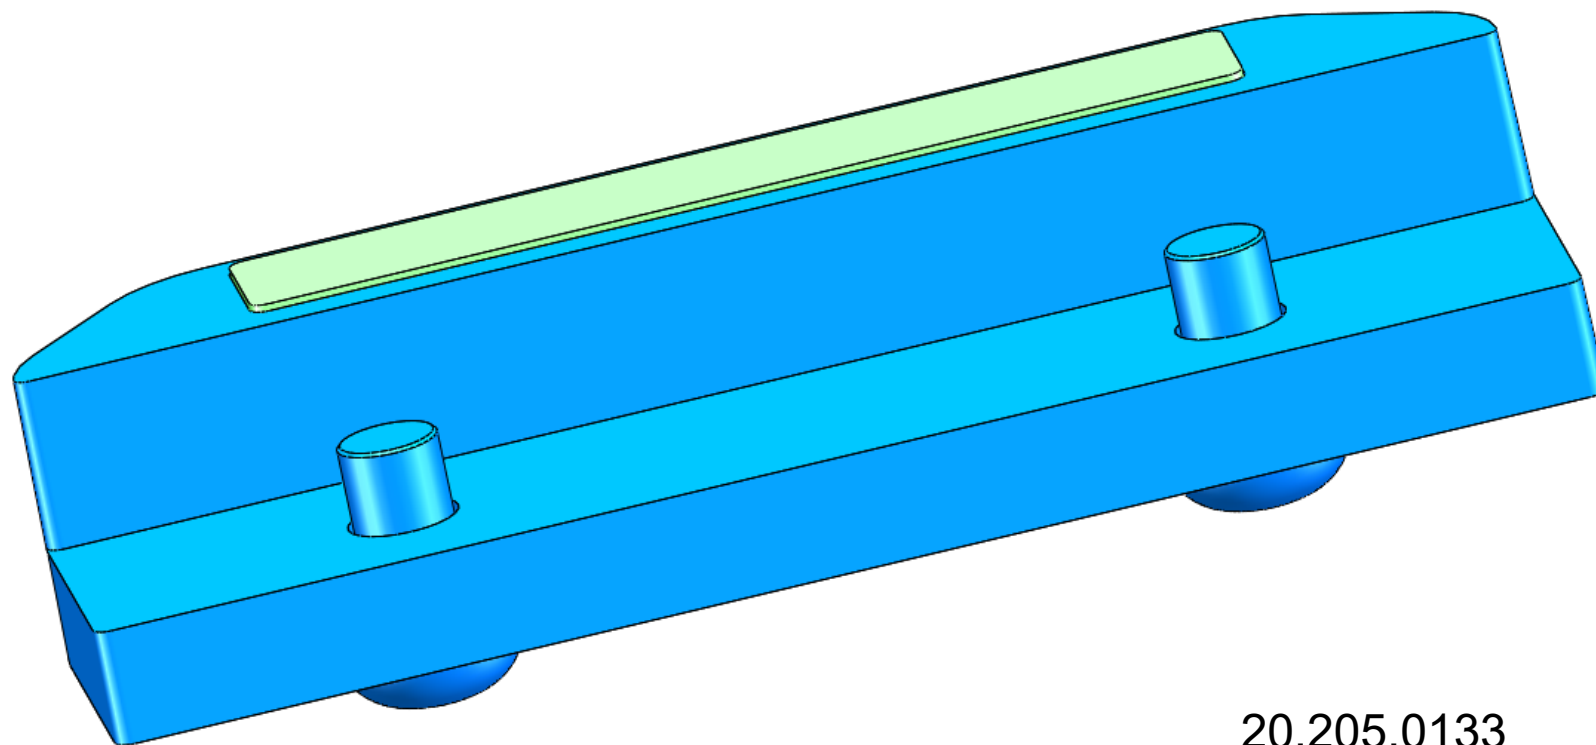



20.205.0133
前门磁铁组件
Front Door Magnet Assembly


06.209.0018
前门磁铁
Front Door Magenet

05.201.0189
前门磁铁座
Front Door Magenet
Base

09.202.0031
内六角半圆头螺钉 M3*6
M3 x 6 Hex Socket Screw, Half
Round

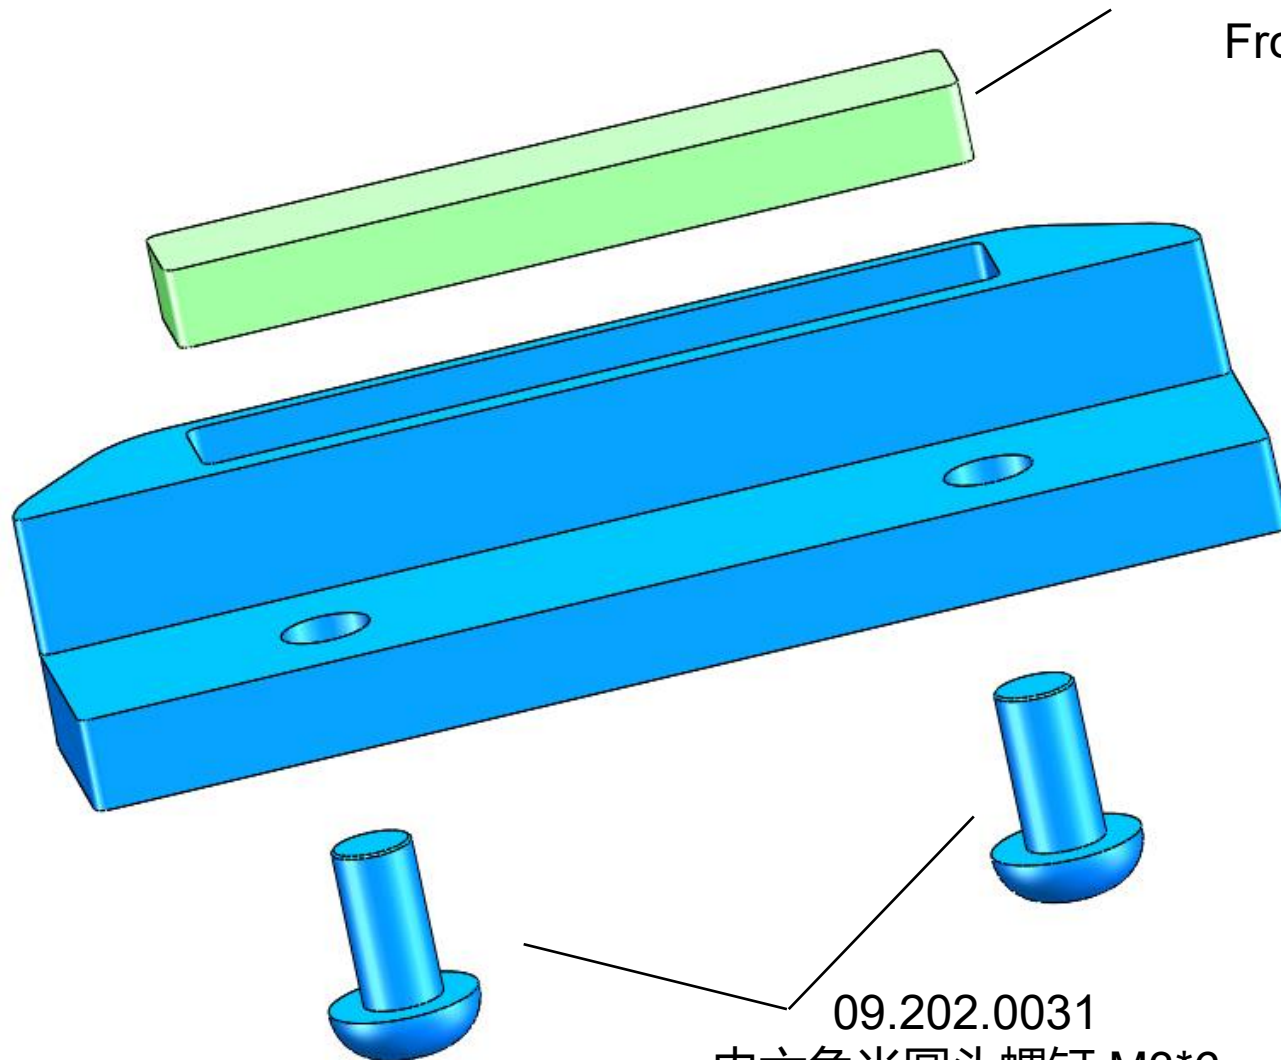

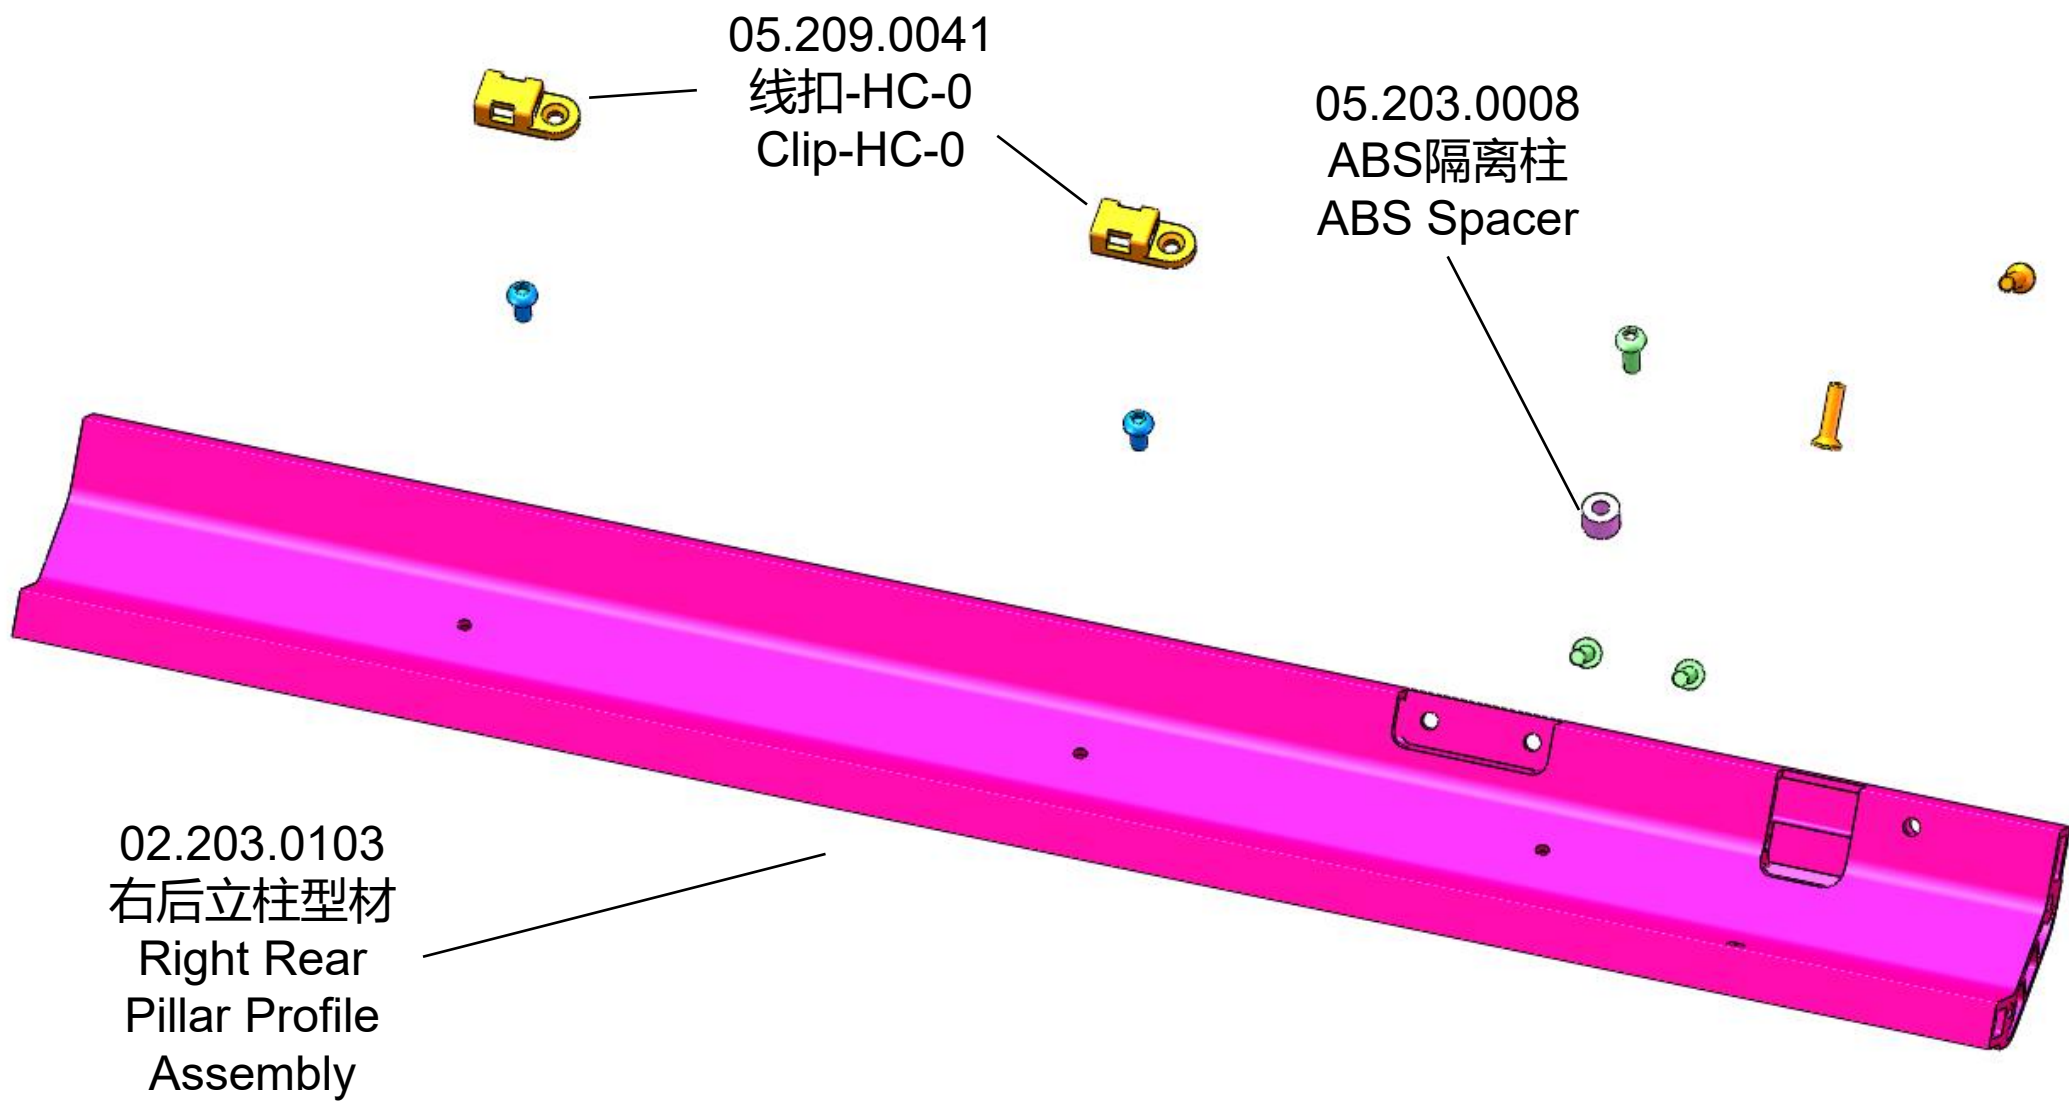


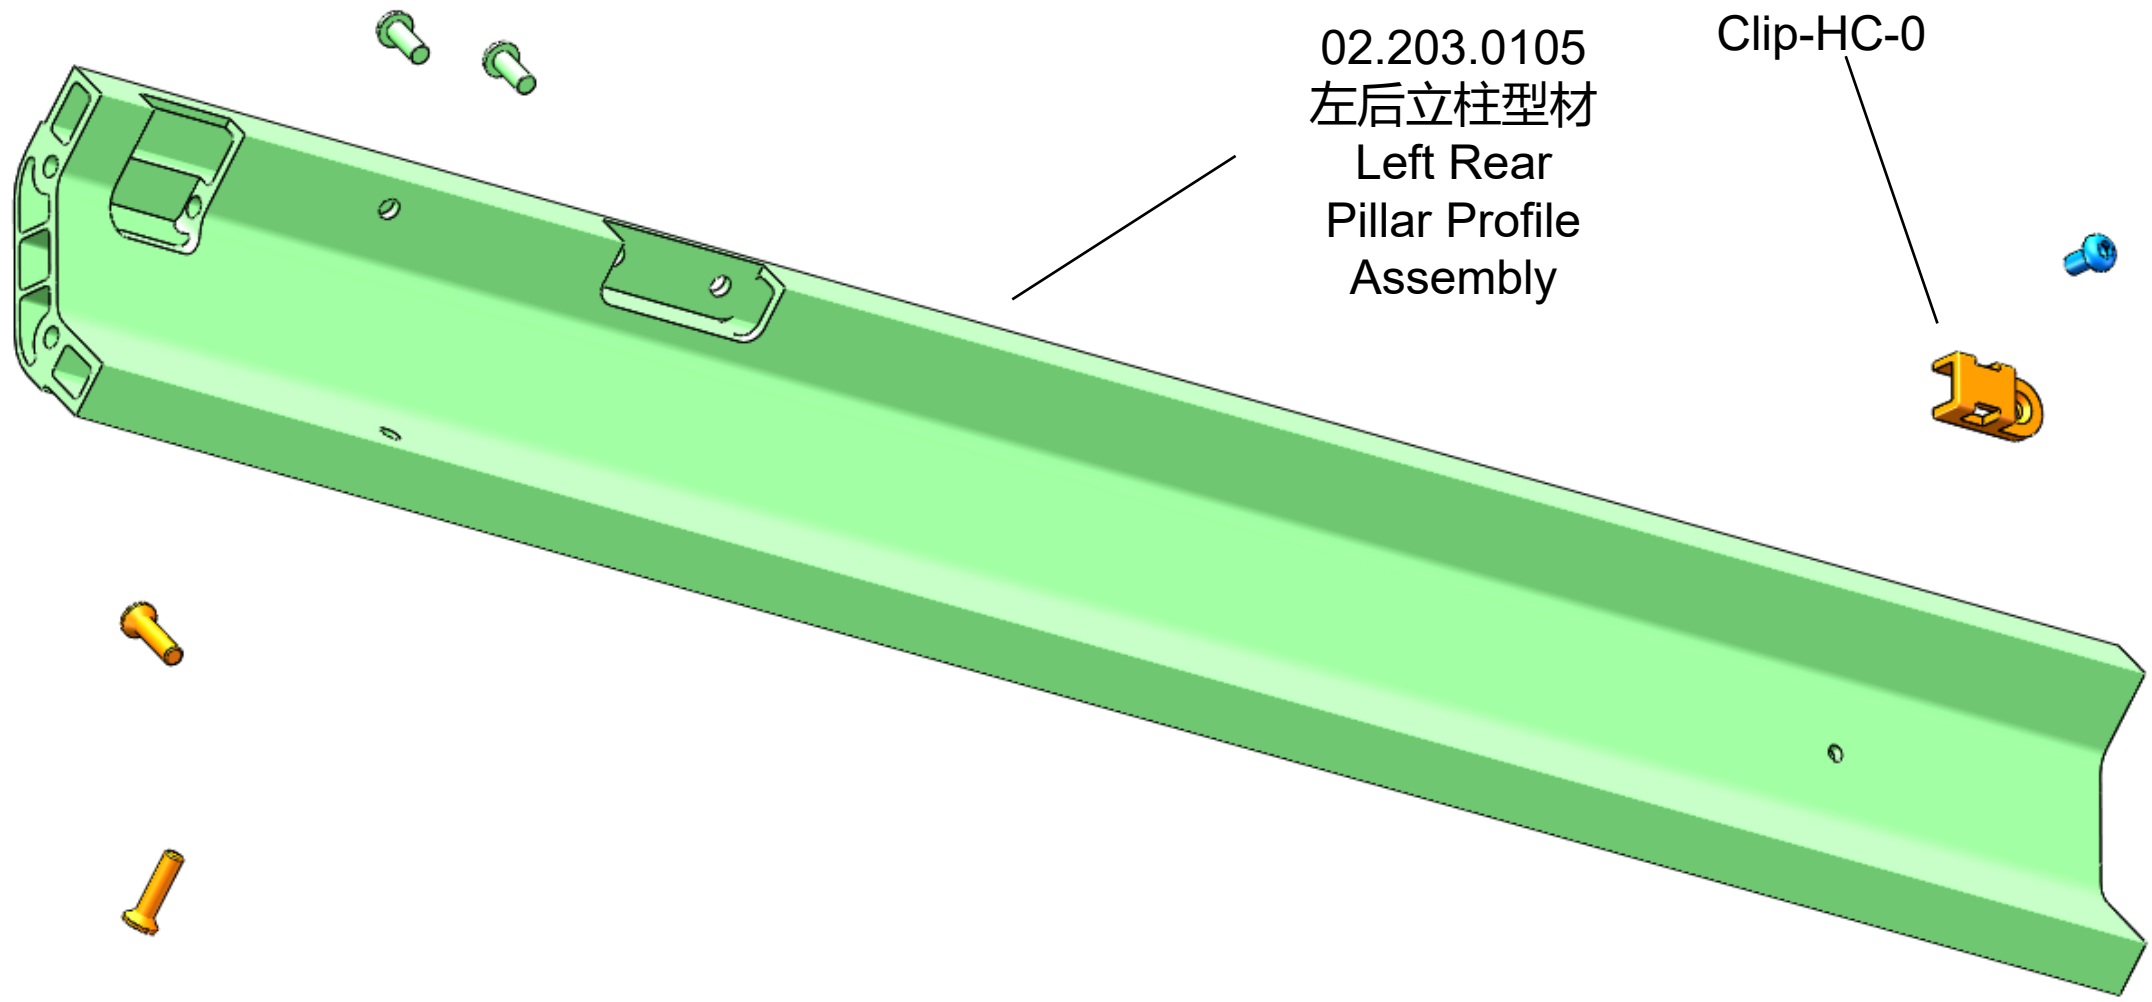


02.203.0105
左后立柱型材
Left Rear
Pillar Profile
Assembly


05.209.0041
线扣-HC-0
Clip-HC-0


02.203.0102
后横梁板
Rear Beam Plate

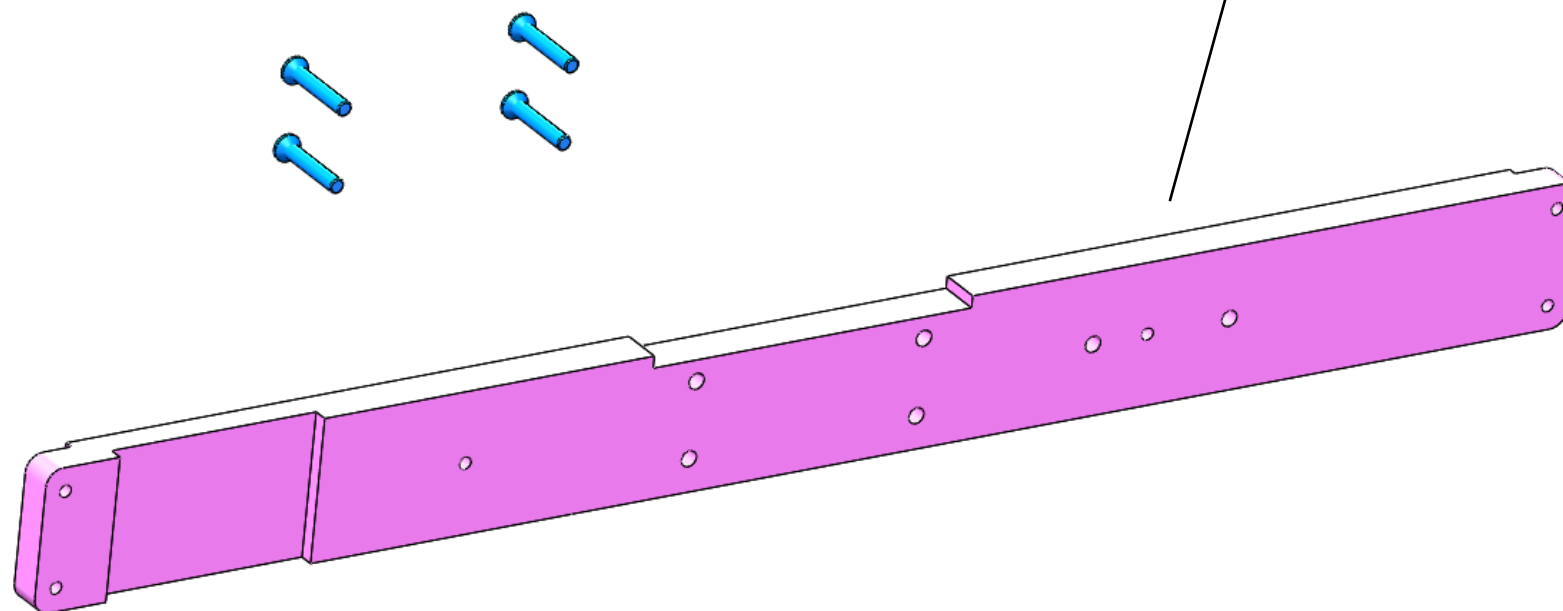

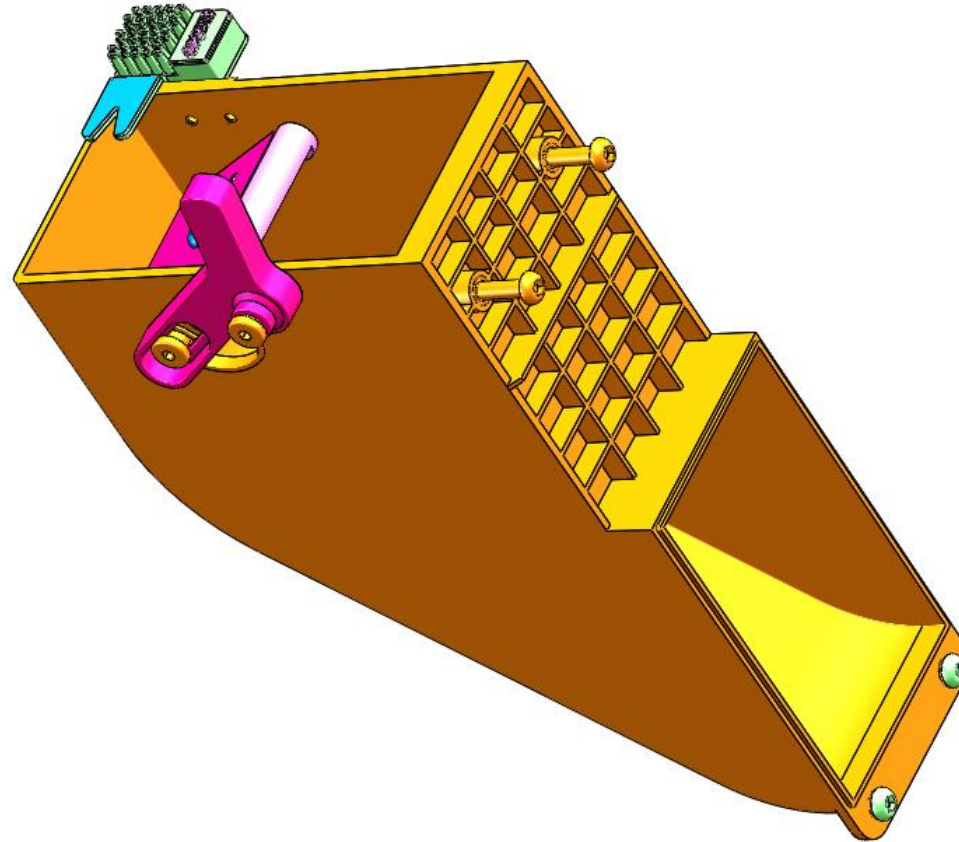


20.205.0135
Wiping Assembly
Cat # 001788

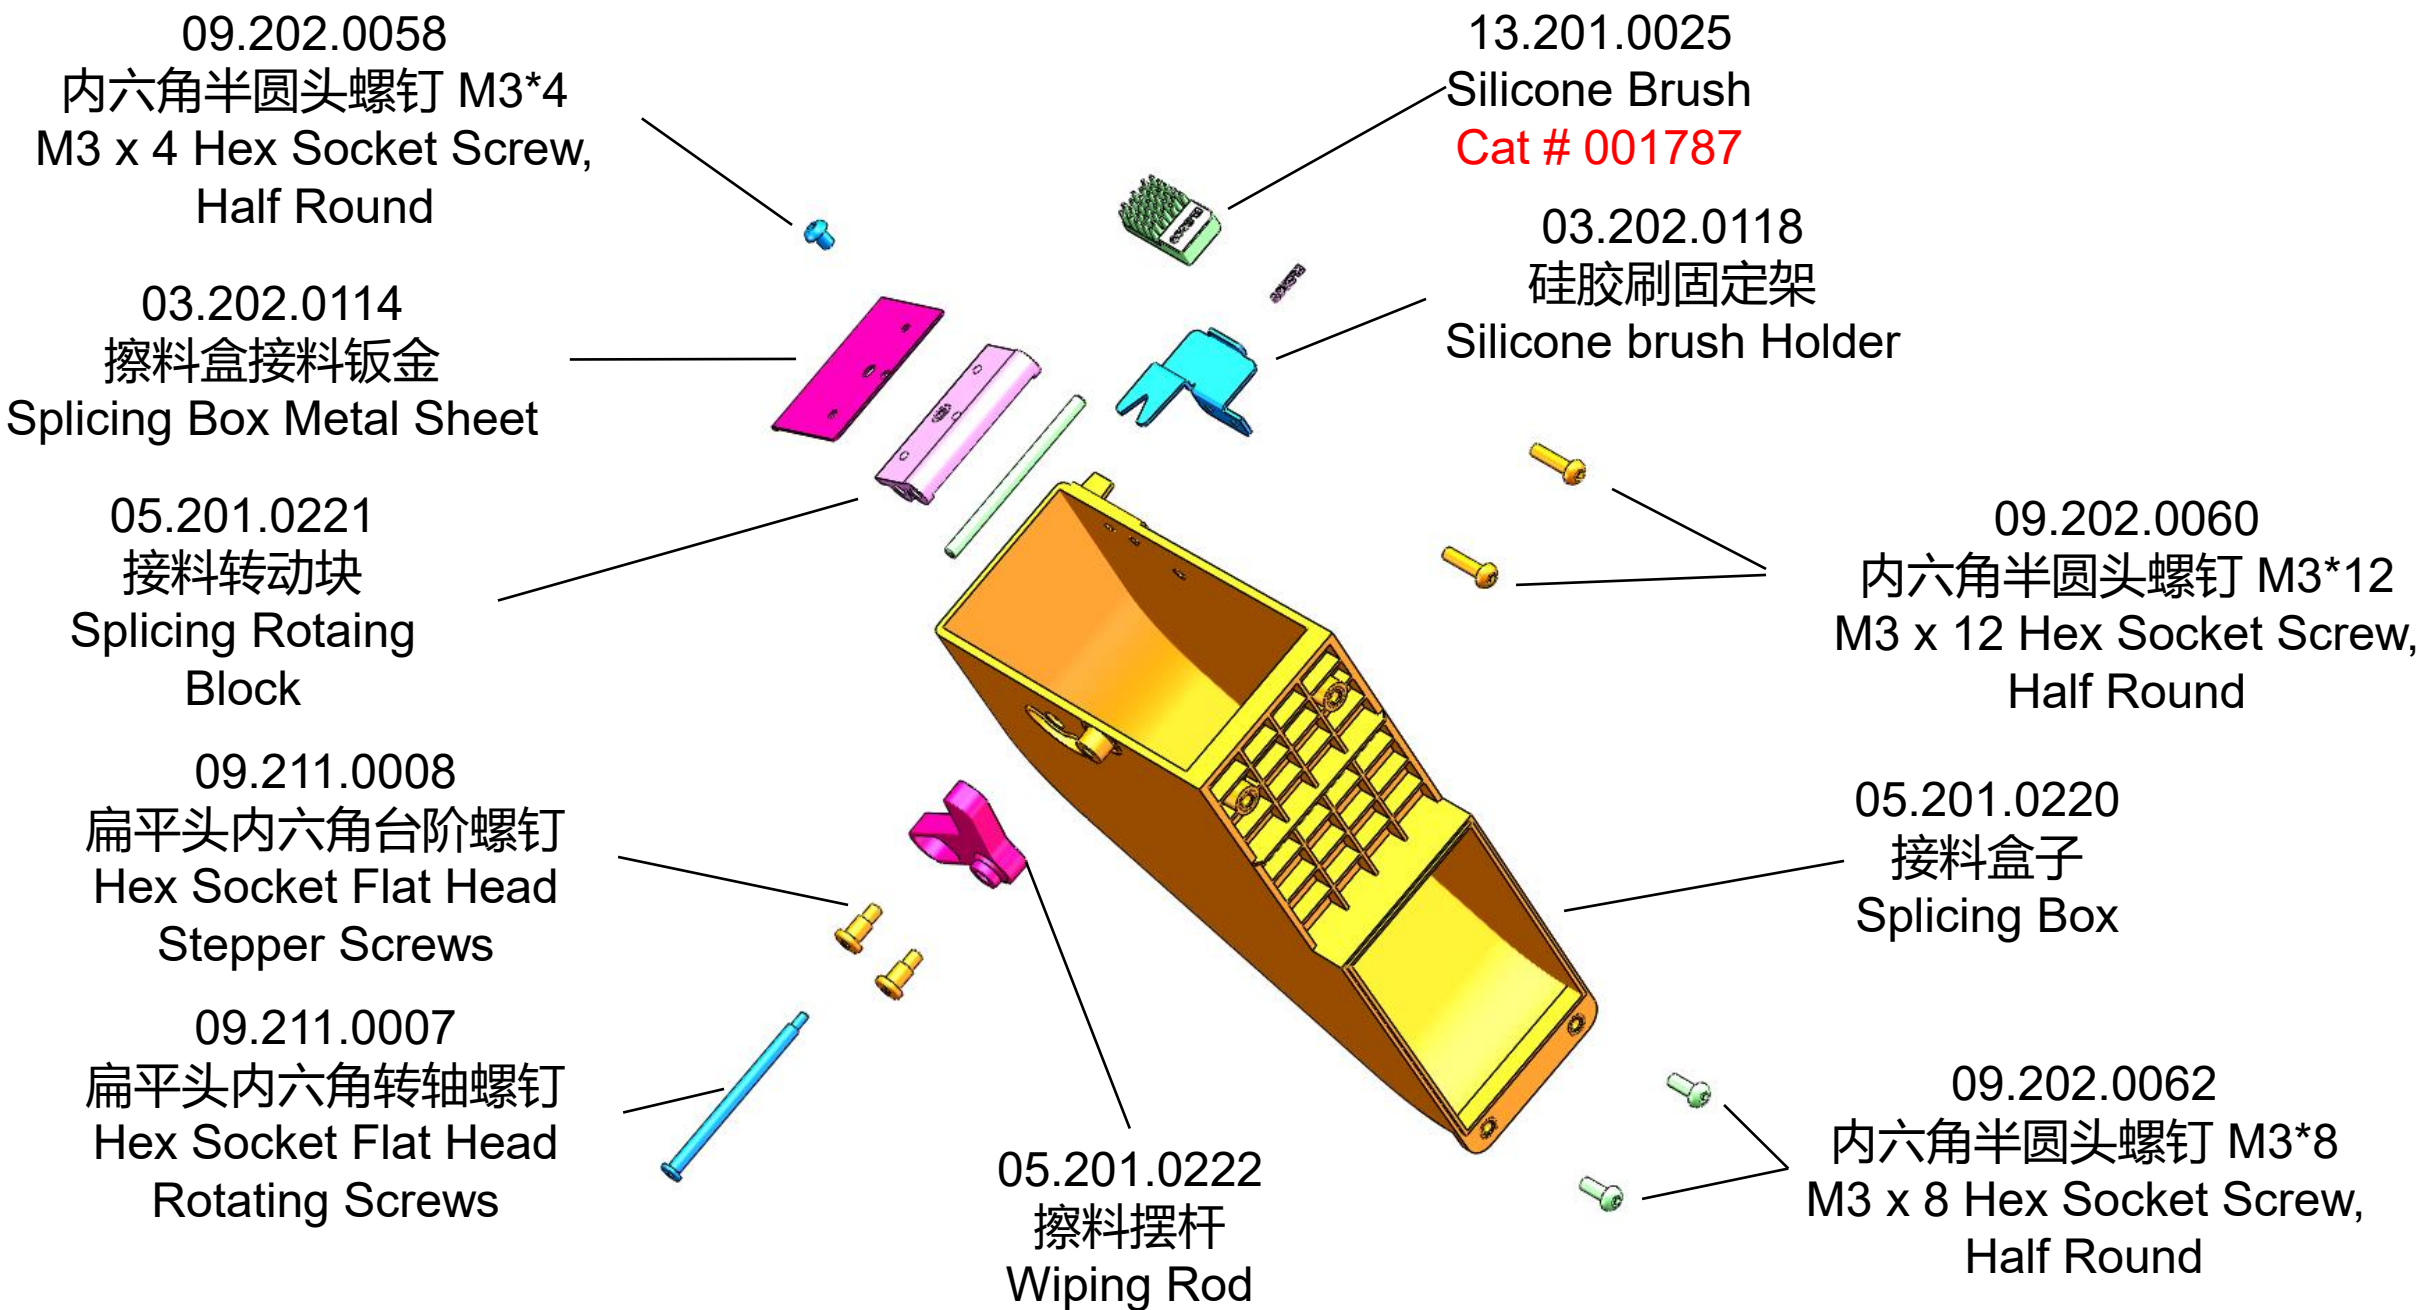

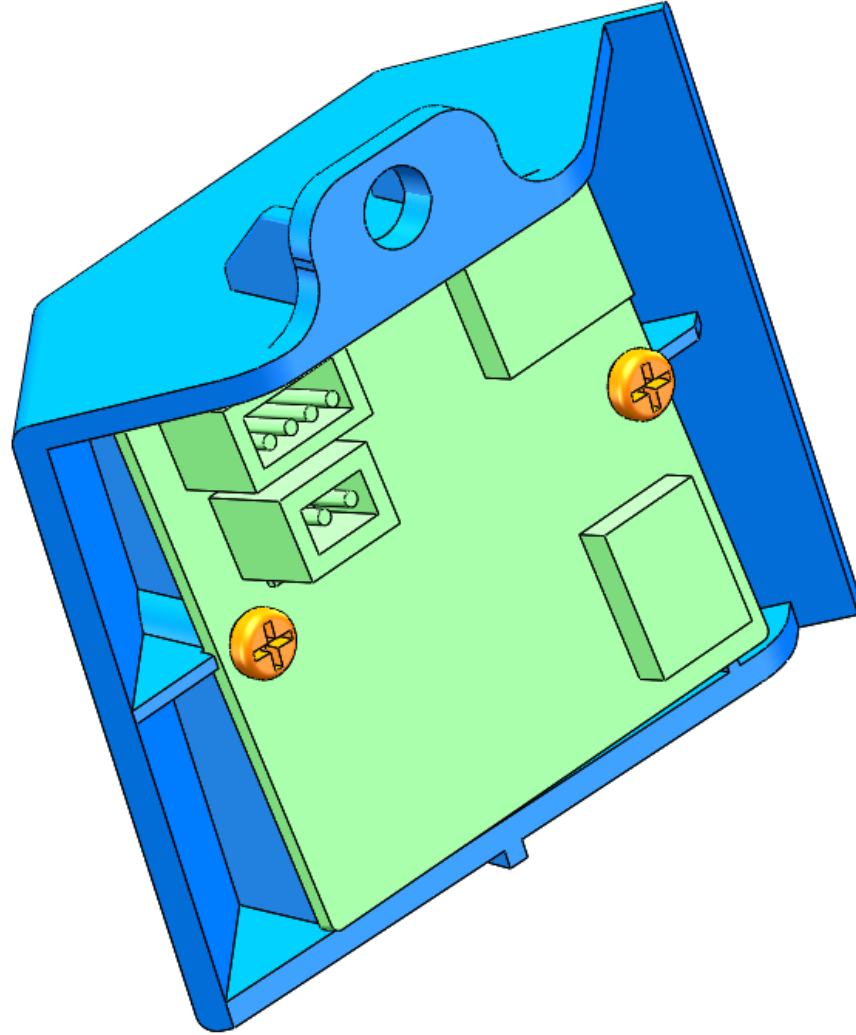


20.205.0134
摄像头组件
Camera Assembly


05.201.0216B
摄像头外壳B版本
Camera Housing B Version

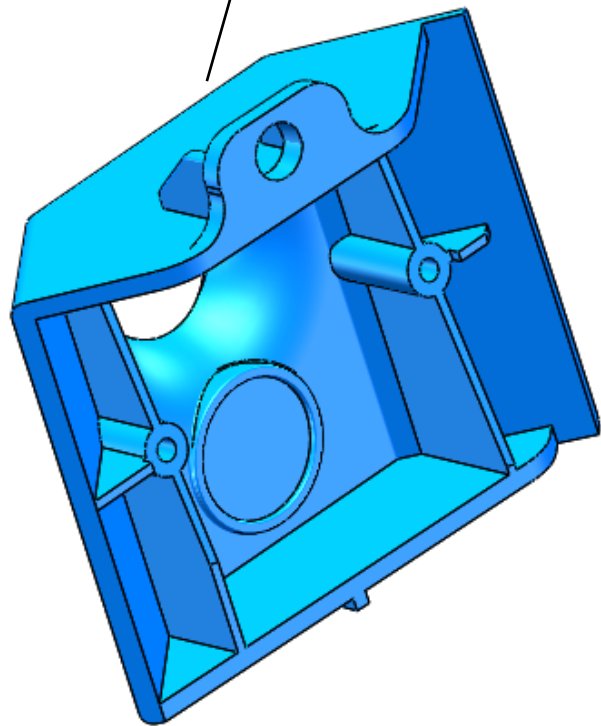


09.206.0010
十字盘头尖尾自攻螺钉/PA 2*6
2 x 6 Cross Pan Head Tapping Screws,
Sharp Tail

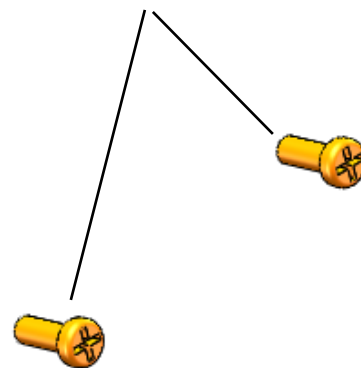



04.210.0030
摄像头模块-无灯珠
Camera Module-No Lamp
Bead

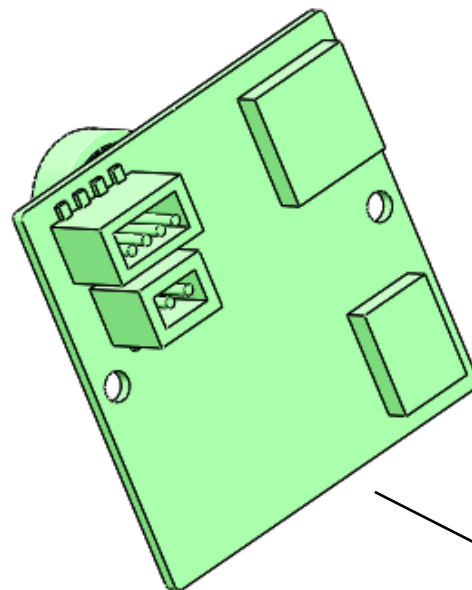


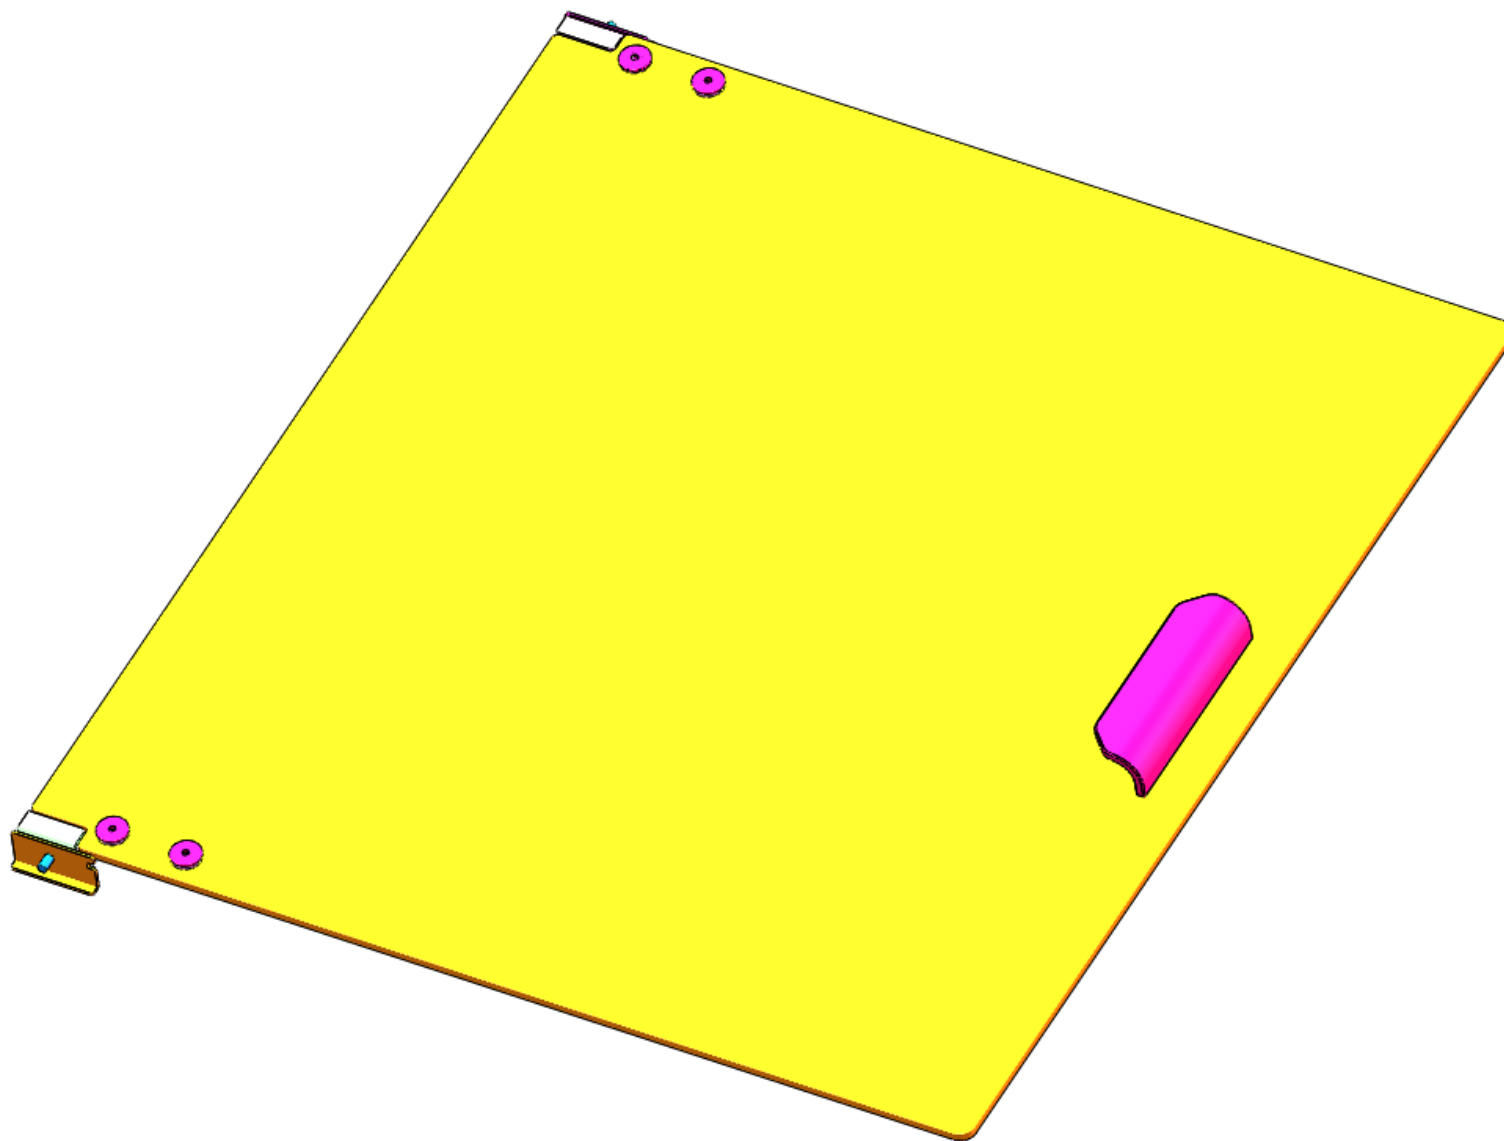

20.206.0041
Front Glass Door
Assembly
Cat # 001761

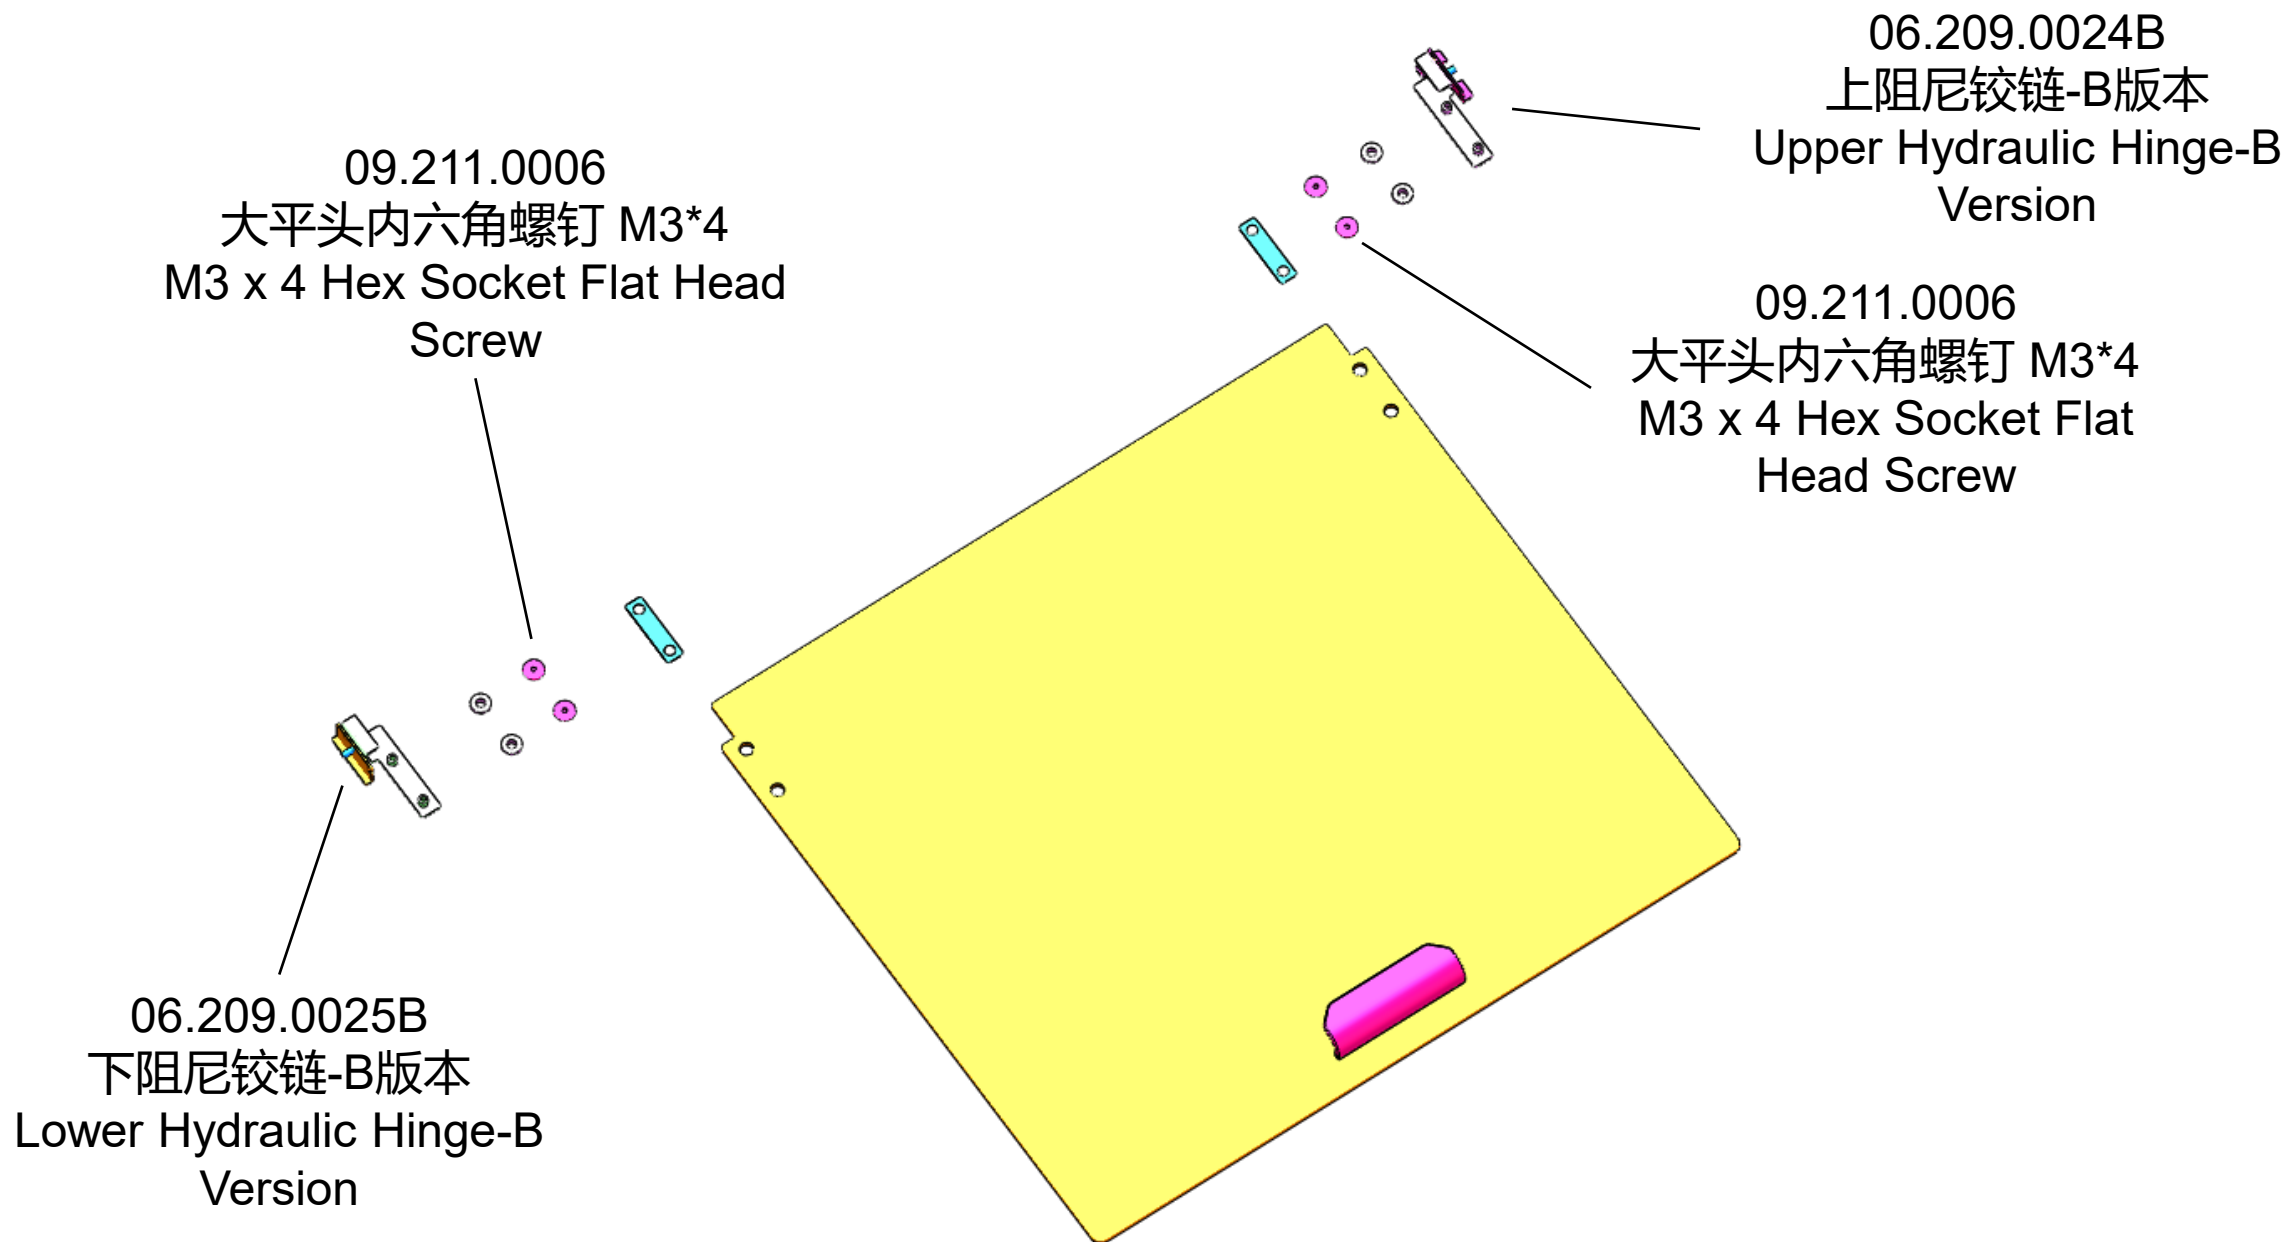


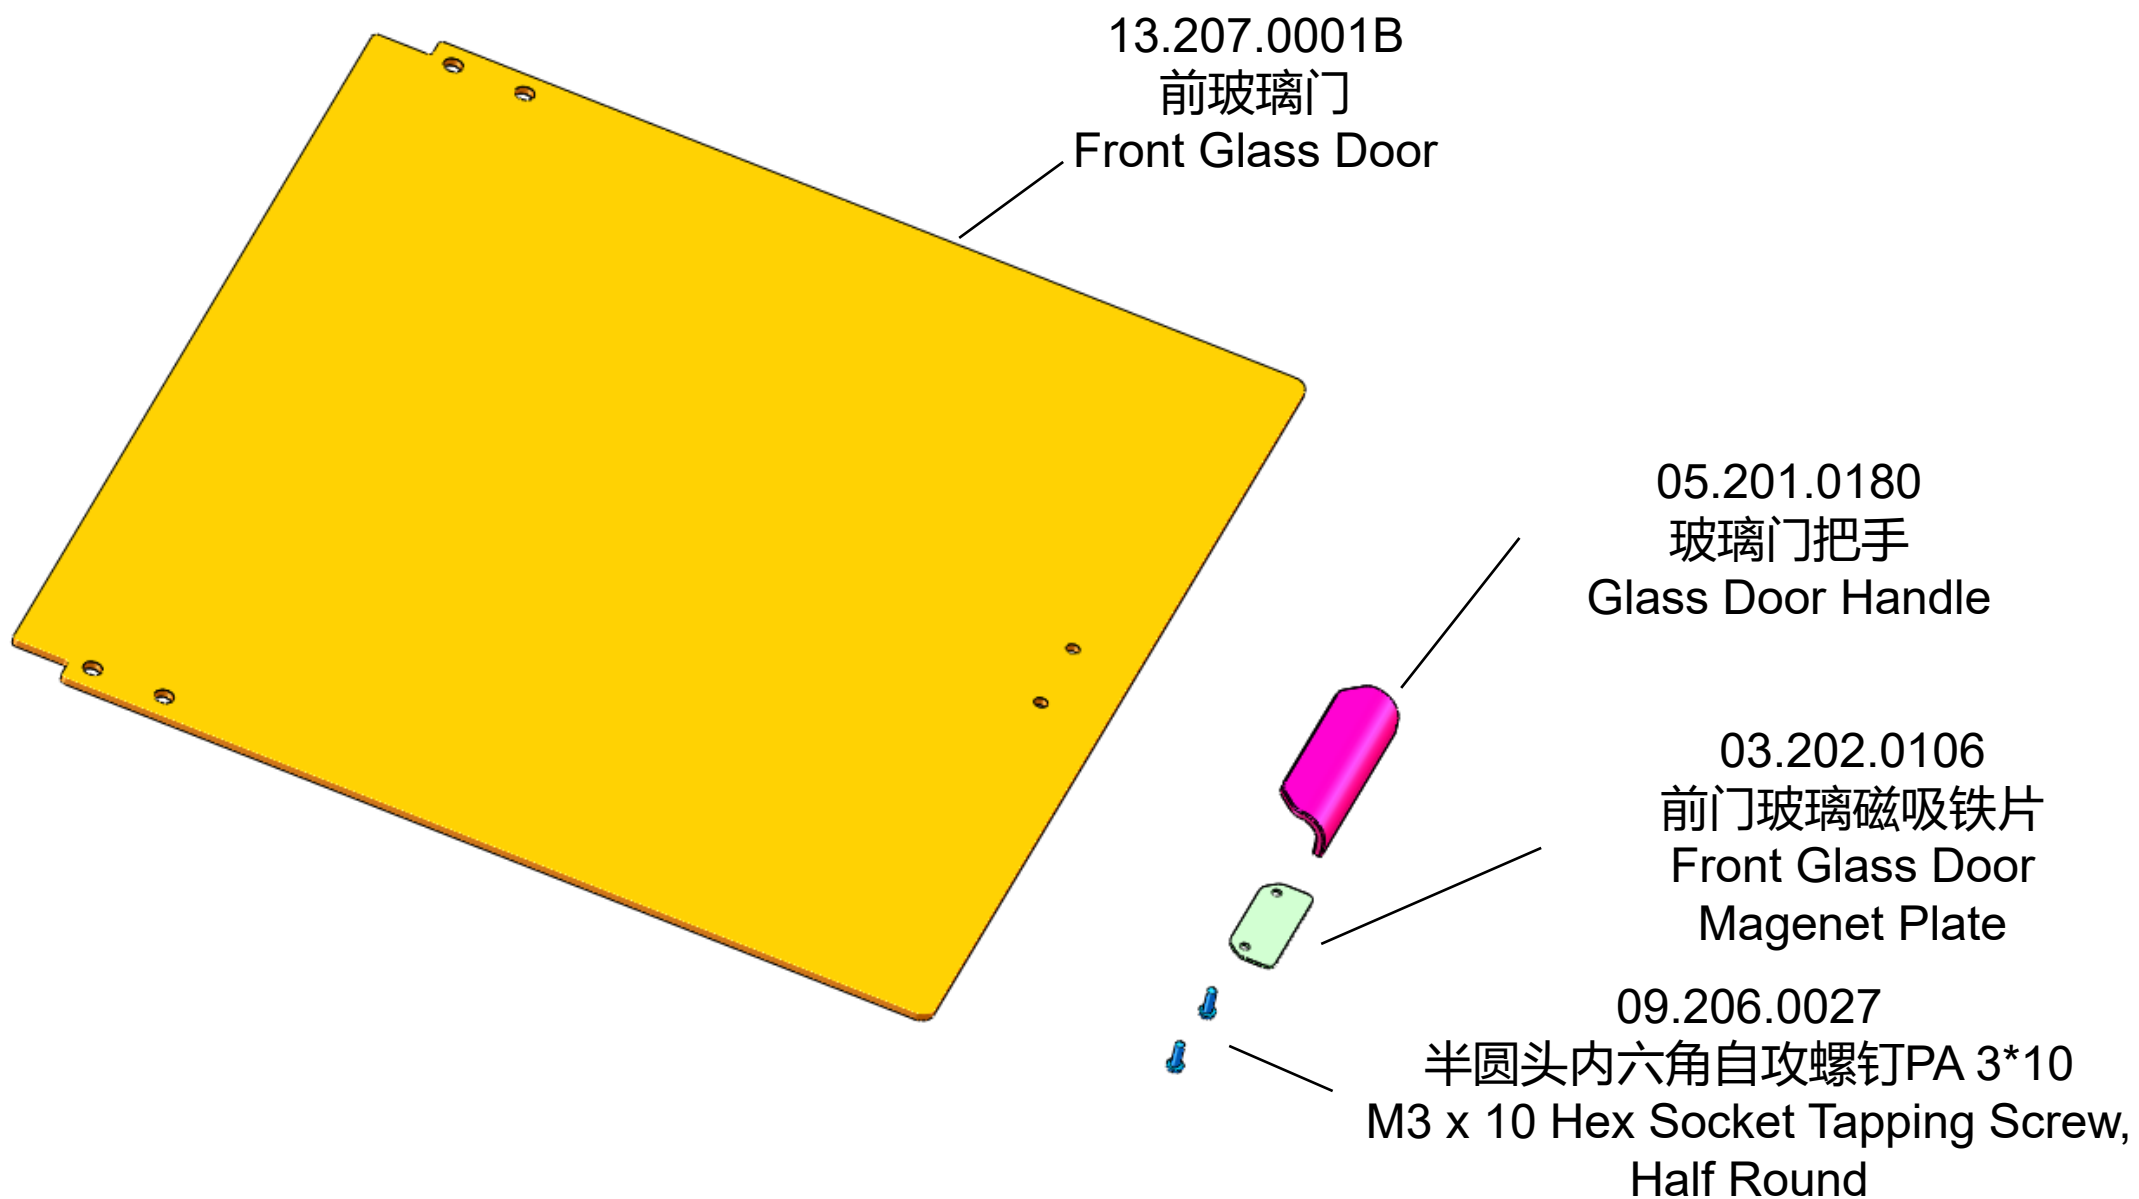


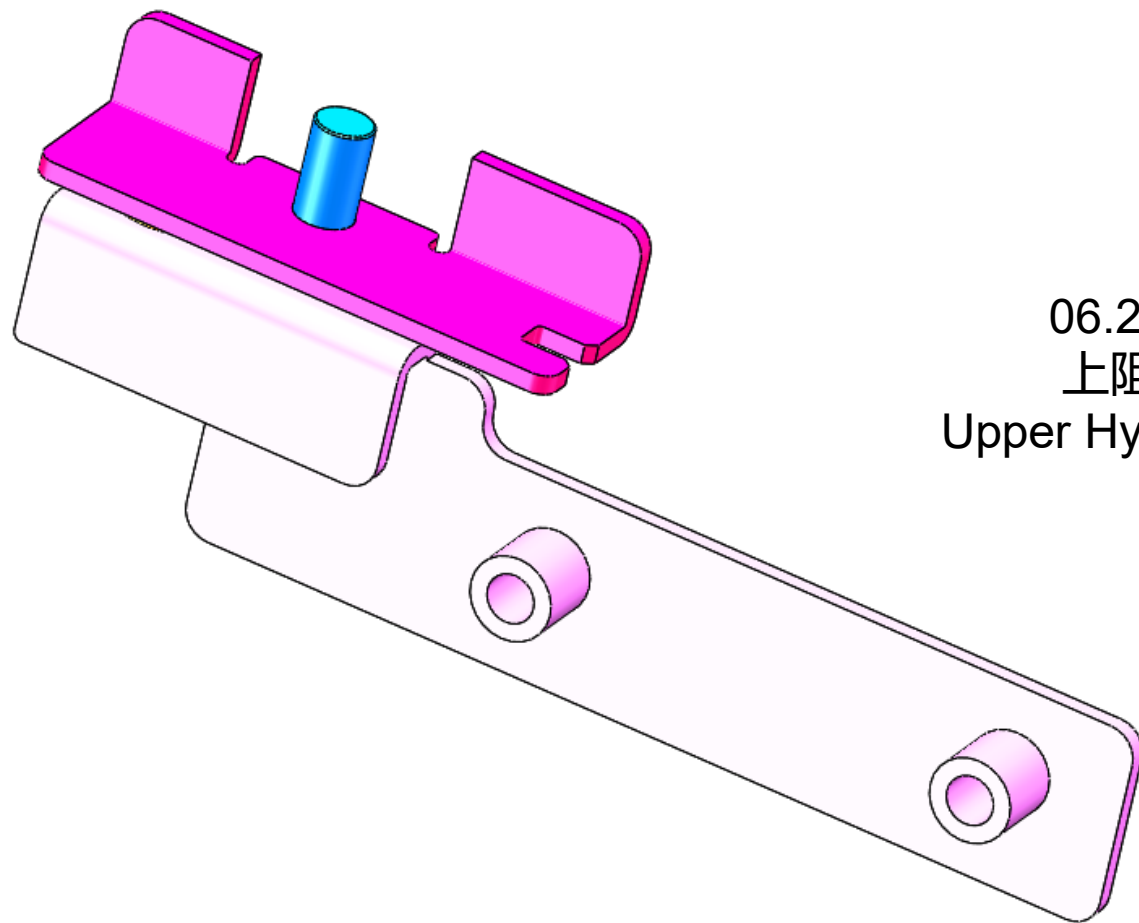

06.209.0024
上阻尼铰链
Upper Hydraulic Hinge

06.209.0025
下阻尼铰链
Lower Hydraulic Hinge

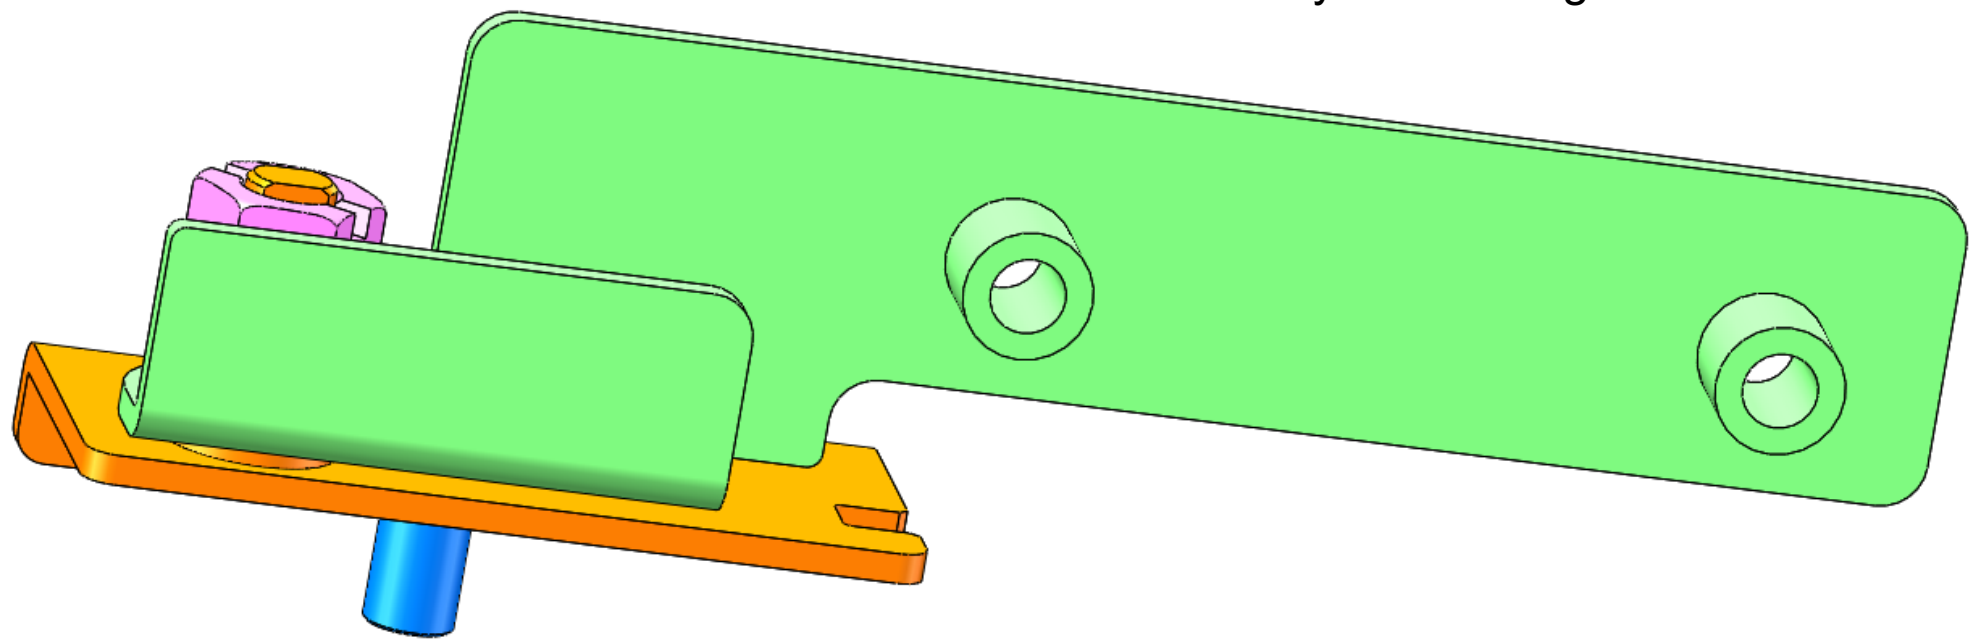


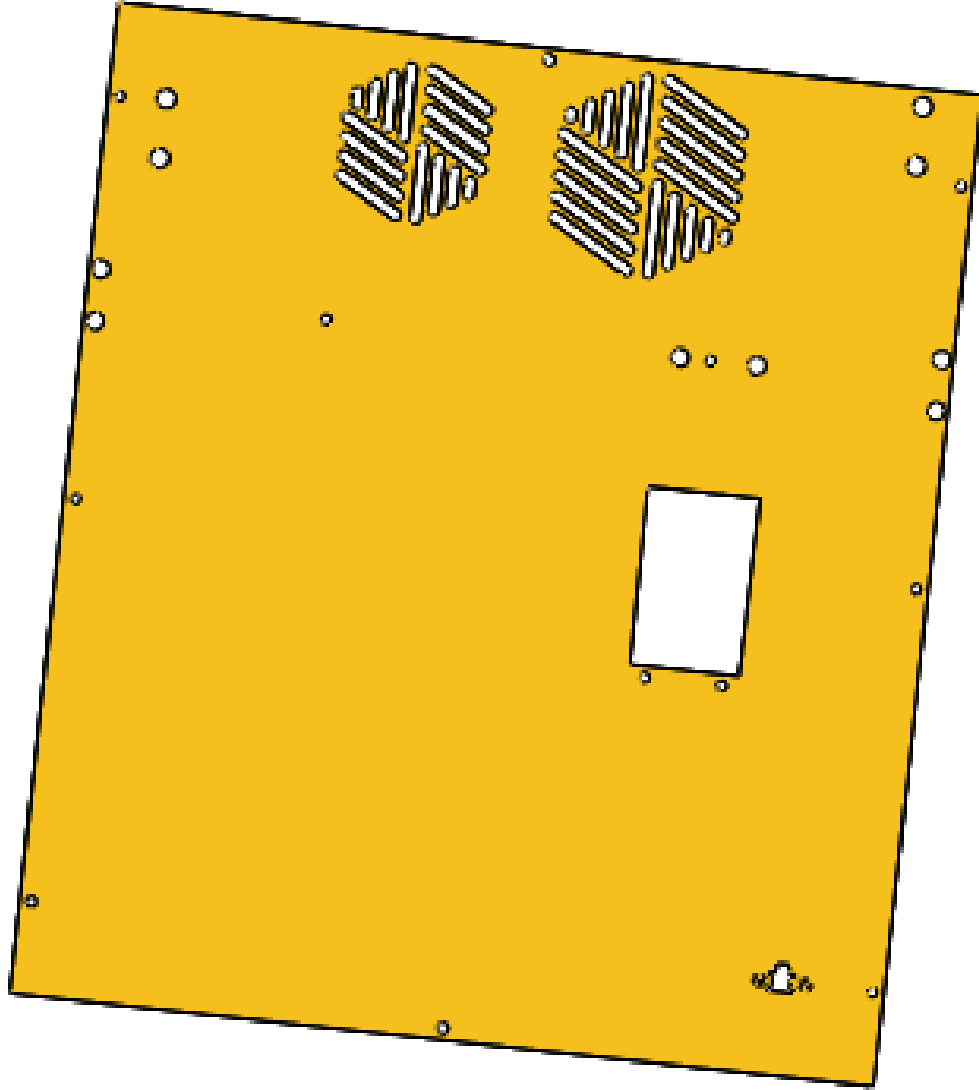

20.205.0141
后封箱板组件
Rear Cover Assembly


03.202.0125
后封箱板-B版本
Rear Cover Assembly
-B Version

12.204.0073
封箱钣金减震棉
Boxing Metal Sheet Shock-
Absorbing Foam

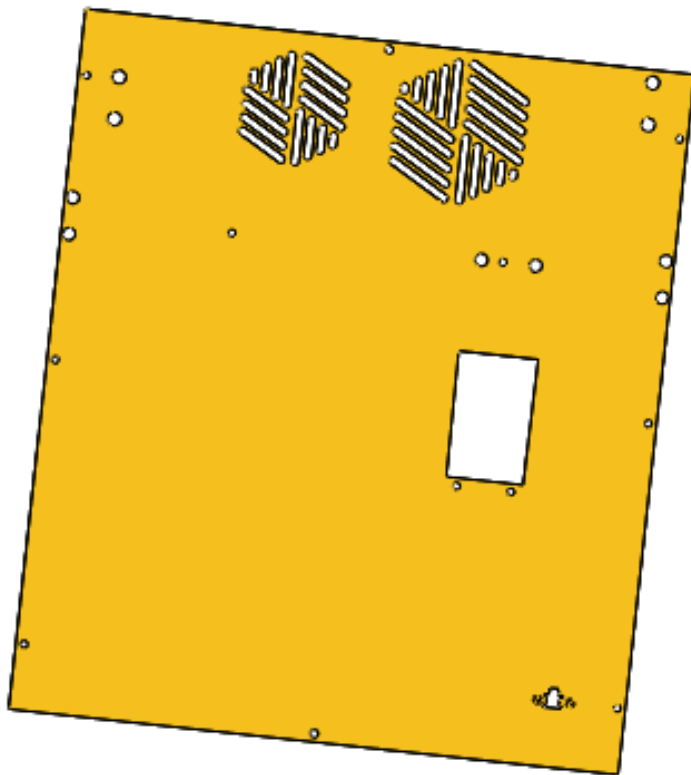

09.202.0058
内六角半圆头螺钉 M3*4
M3 x 4 Hex Socket Tapping Screw, Half
Round



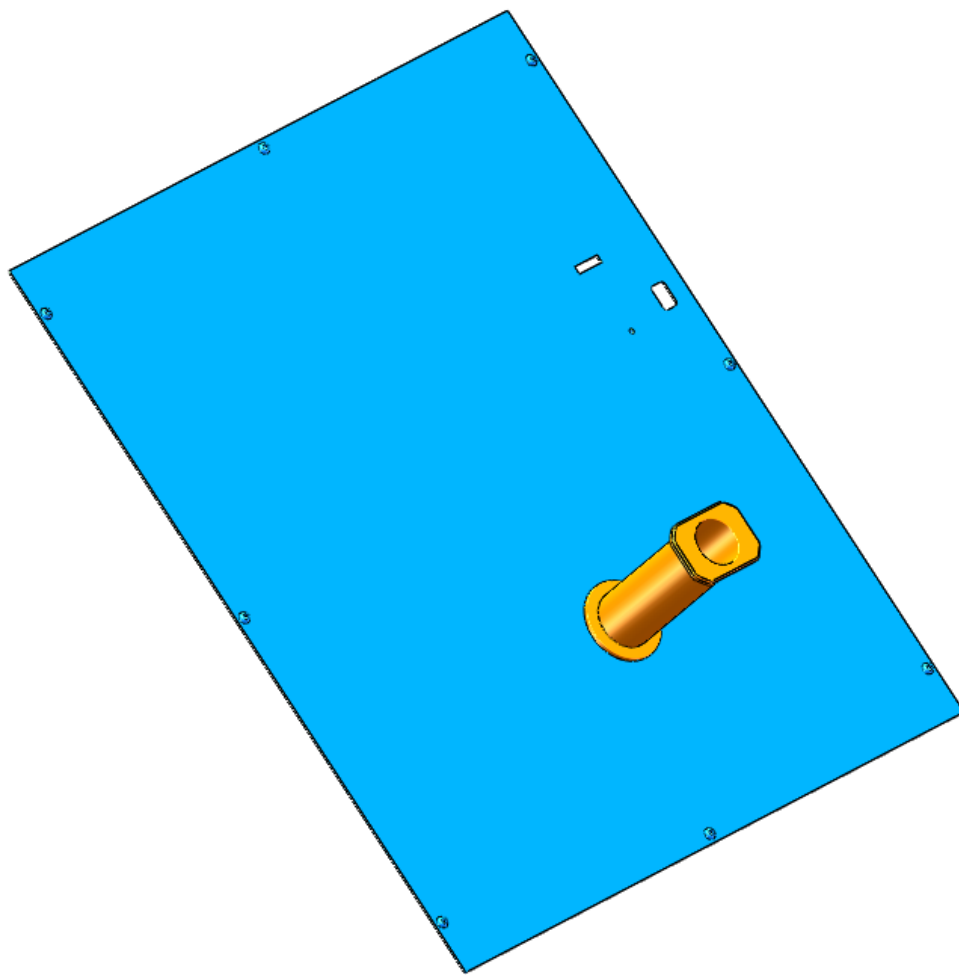

20.205.0139
右封箱板组件
Right Boxing Assembly

12.204.0073
封箱钣金减震棉
Boxing Metal Sheet
Shock-Absorbing Foam




09.202.0058
内六角半圆头螺钉 M3*4
M3 x 4 Hex Socket Tapping
Screw, Half Round


03.202.0127
Right Boxing Cover-C Version
Cat # 001764

05.201.0229
料架底座
Spool Holder Base

09.202.0062
内六角半圆头螺钉 M3*8
M3 x 8 Hex Socket Tapping
Screw, Half Round

05.201.0228
塑胶料架
Plastic Holder

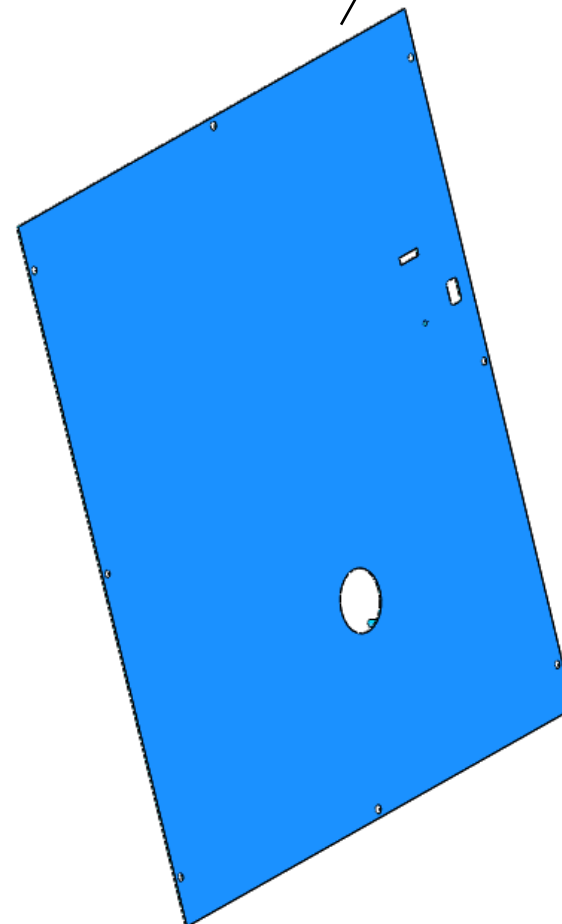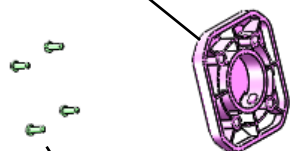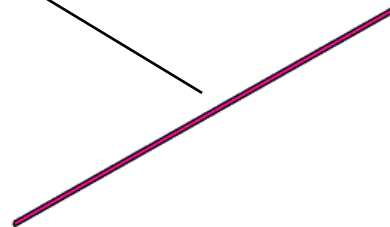

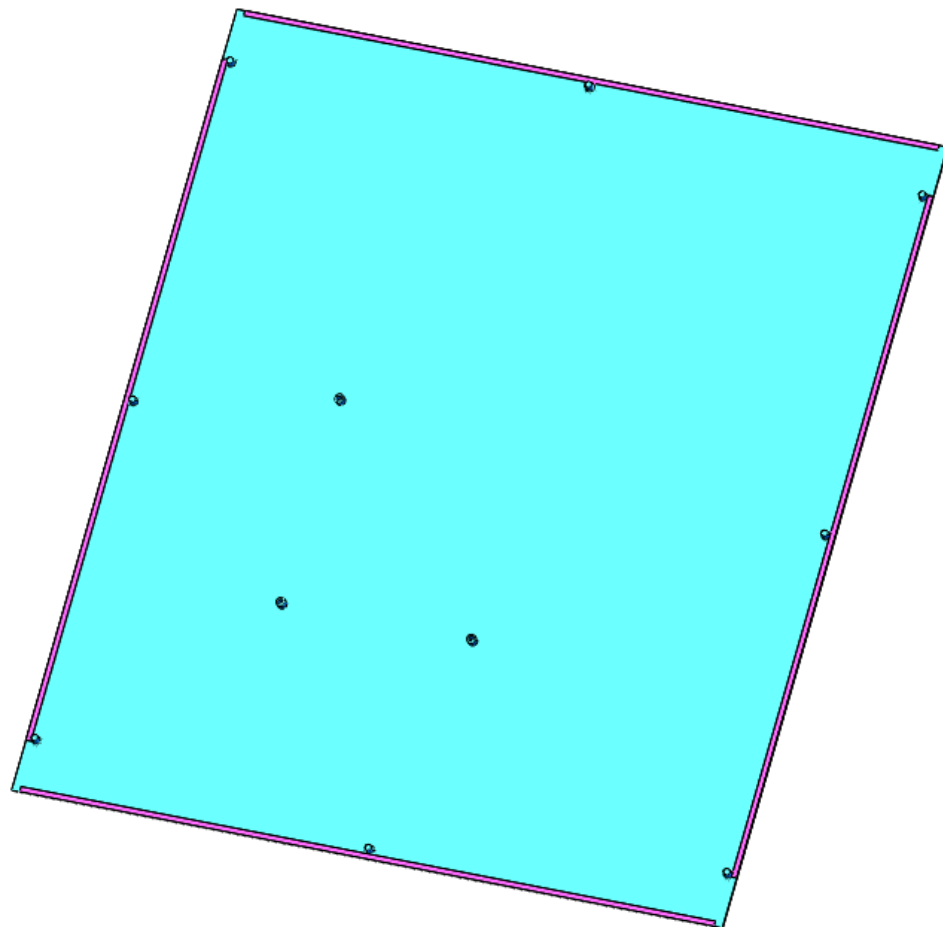



20.205.0138
左封箱板组件
Left Boxing Assembly

03.202.0101
Left Boxing Cover
Cat # 001763


12.204.0073
封箱钣金减震棉
Boxing Metal Sheet Shock-
Absorbing Foam


09.202.0031
内六角半圆头螺钉 M3*6
M3 x 6 Hex Socket Tapping Screw,
Half Round

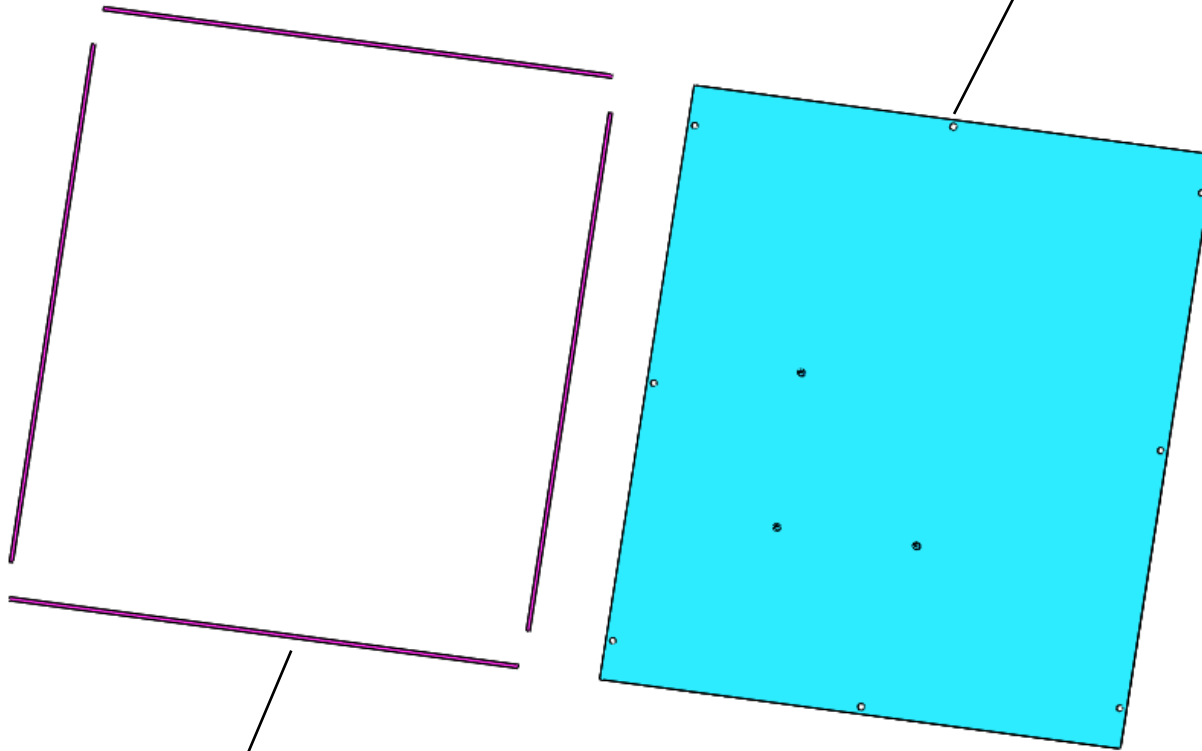

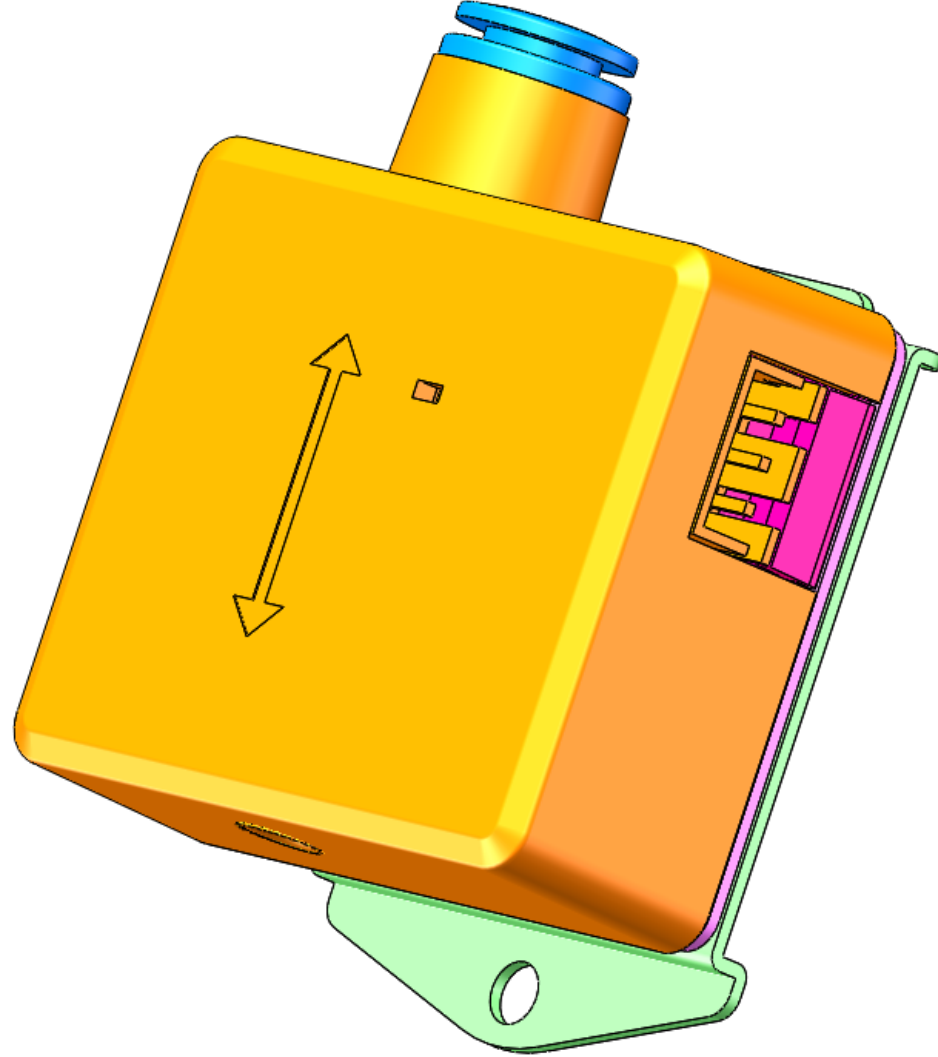


20.204.0204
Filament Runout Detection Assembly
Cat # 001781

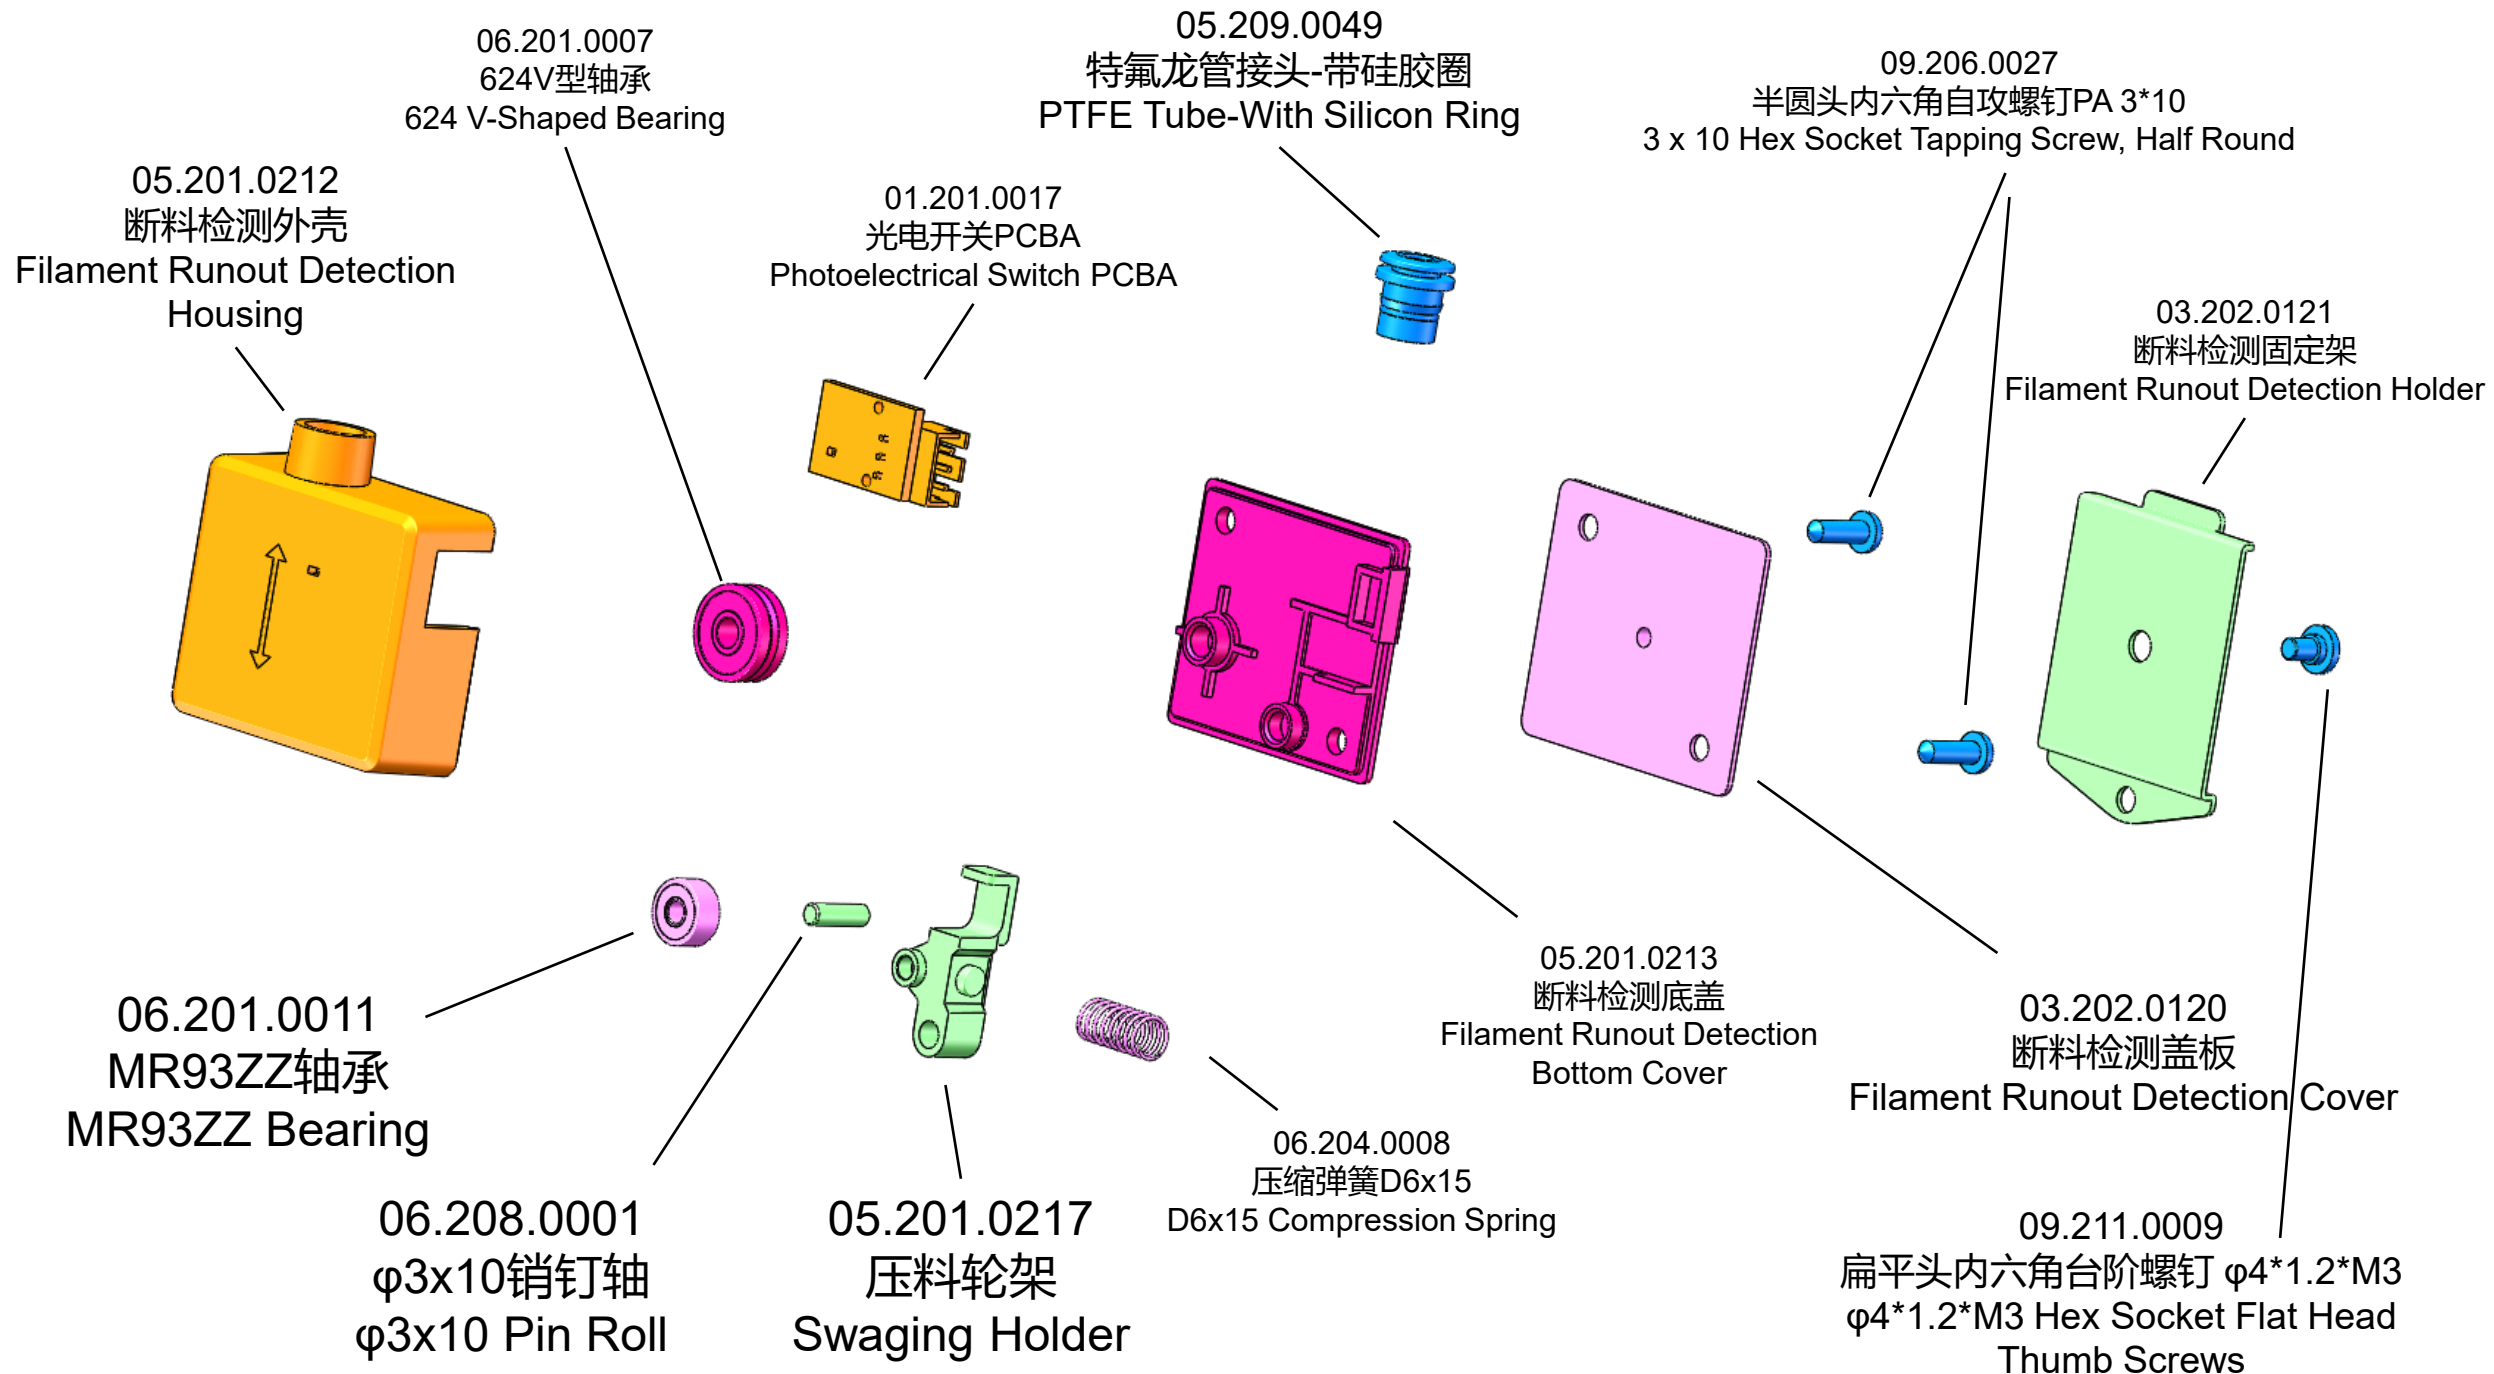

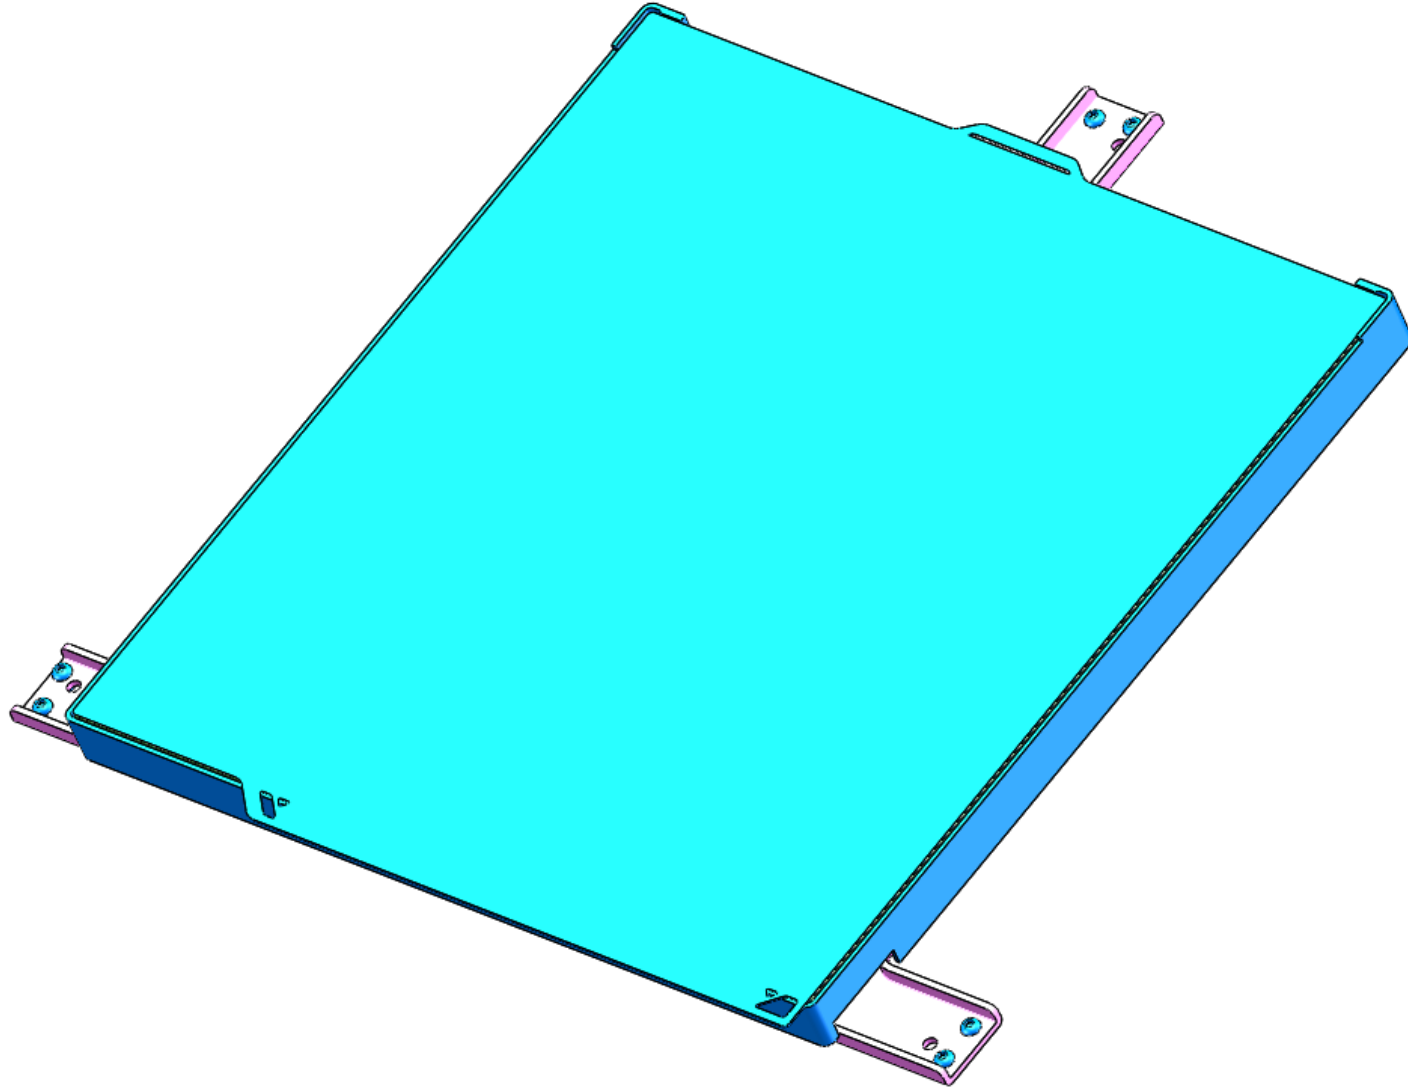


20.204.0198
打印平台套件
Build Plate Kit

20.205.0136
热床板组件
Heated Bed Assembly

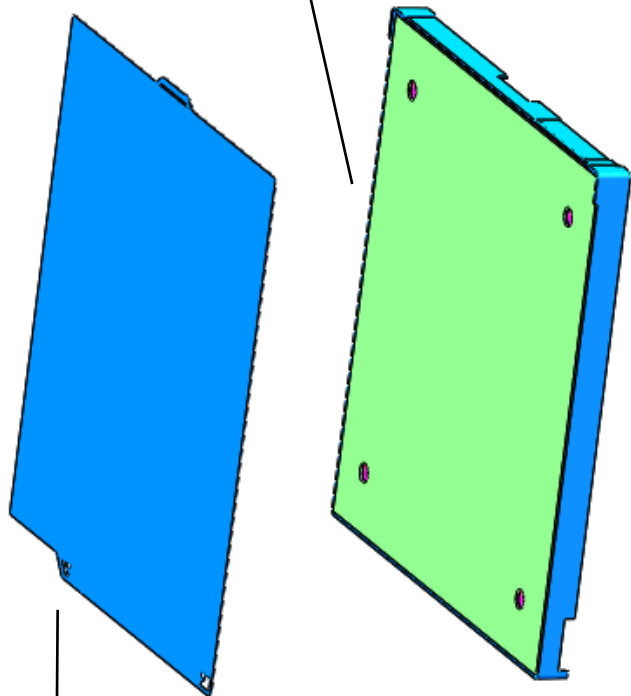


13.202.0026
Build Plate Panel
Cat # 1766

06.204.0020
模具弹簧D10X20
D10X20 Mould Coil Spring

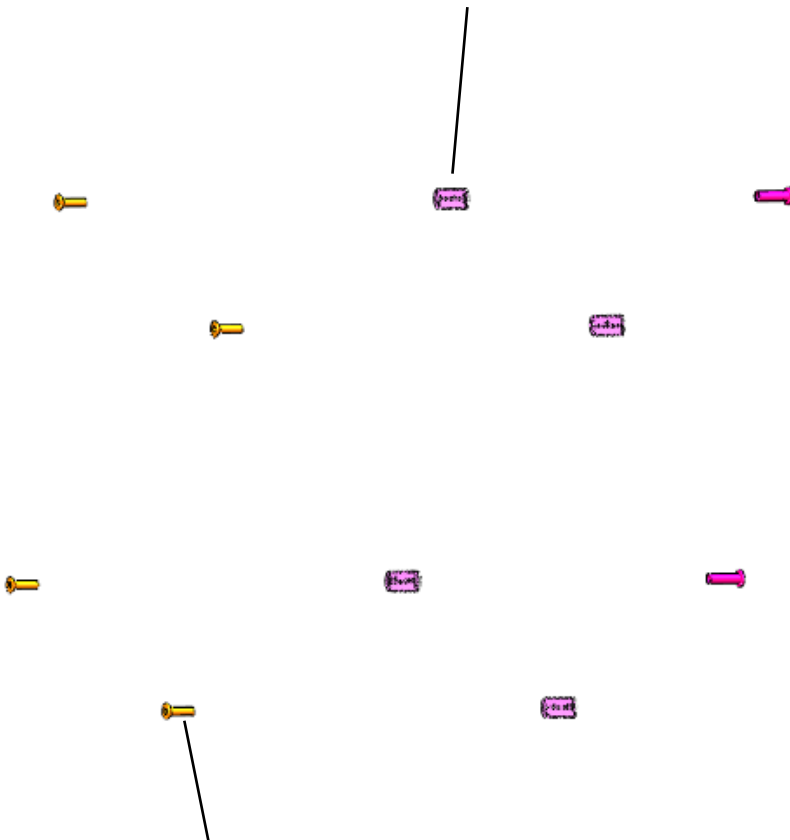


09.201.0039
内六角沉头螺钉 M4*14
M4 x 14 Hex Socket Countersunk
Head Screws

20.205.0137
热床支撑板金组件
Metal Sheet Supporting
Assembly of the Heated Bed

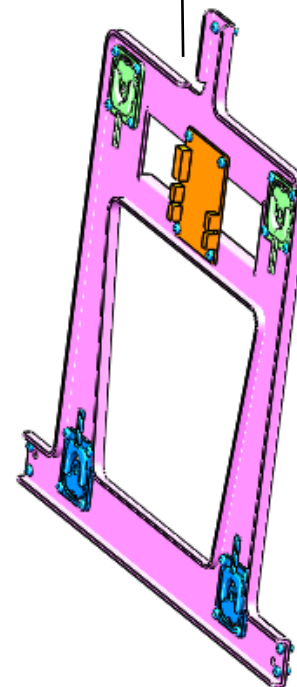

09.205.0016
对锁螺母M4x16
M4x16 Joint Nut

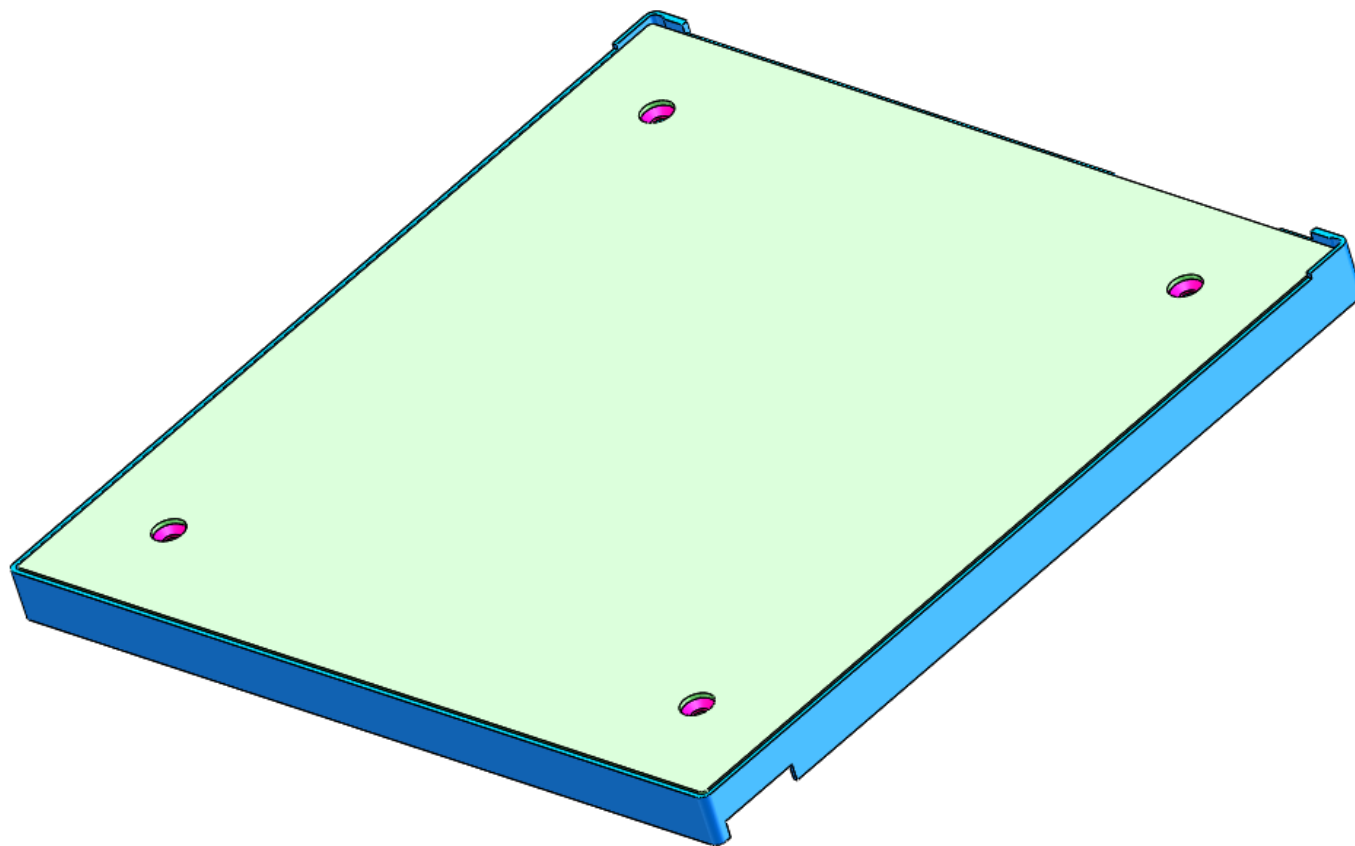

20.205.0136
热床板组件
Heated Bed Assembly

13.202.0018
软磁贴
Soft Magnet

04.209.0014
热床铝基板
Heated Bed Aluminium Base

12.204.0013
高温棉
High-Temperature Foam


04.202.0016
温控开关
Temperature Controller


09.202.0068
十字半圆头螺钉M3*3
M3 x 3
Cross Round Head Screws

09.206.0022
十字沉头自攻螺钉 3*8
3 x 8 Cross Countersunk Head
Tapping Screws

09.207.0009
十字半圆头带垫片组合螺钉PWM3*8
M3 x 8 Cross Half Rounded Head Screws and Washer


05.201.0199
热床托盘
Heated Bed Tray

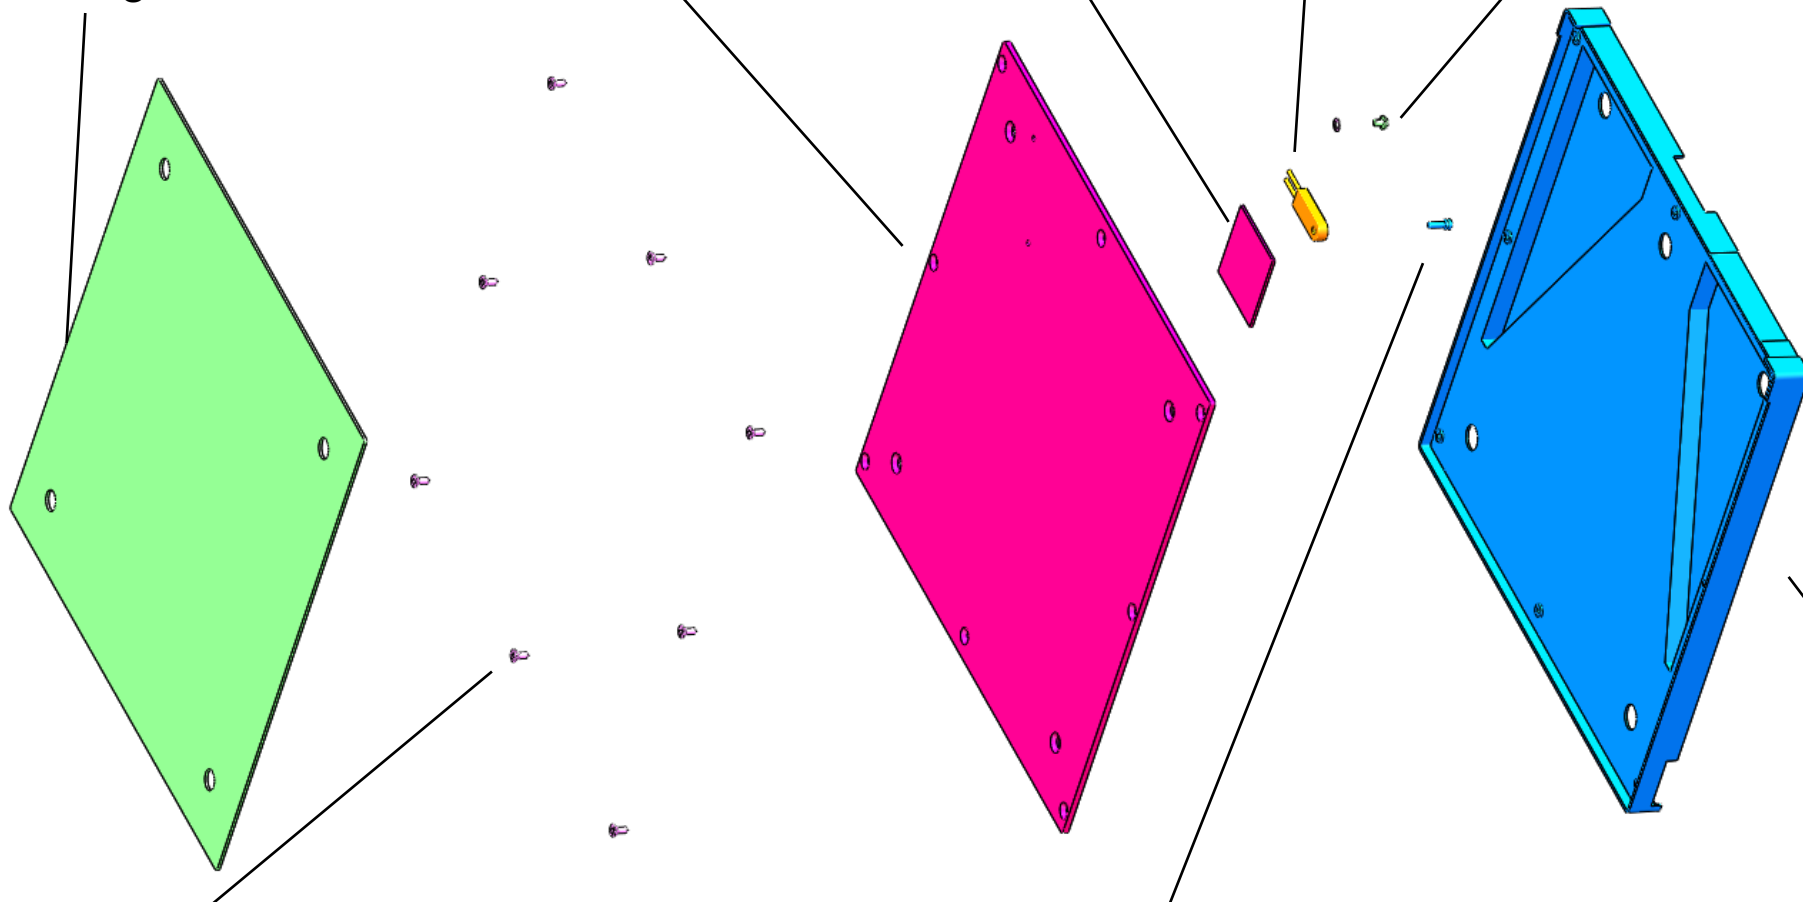

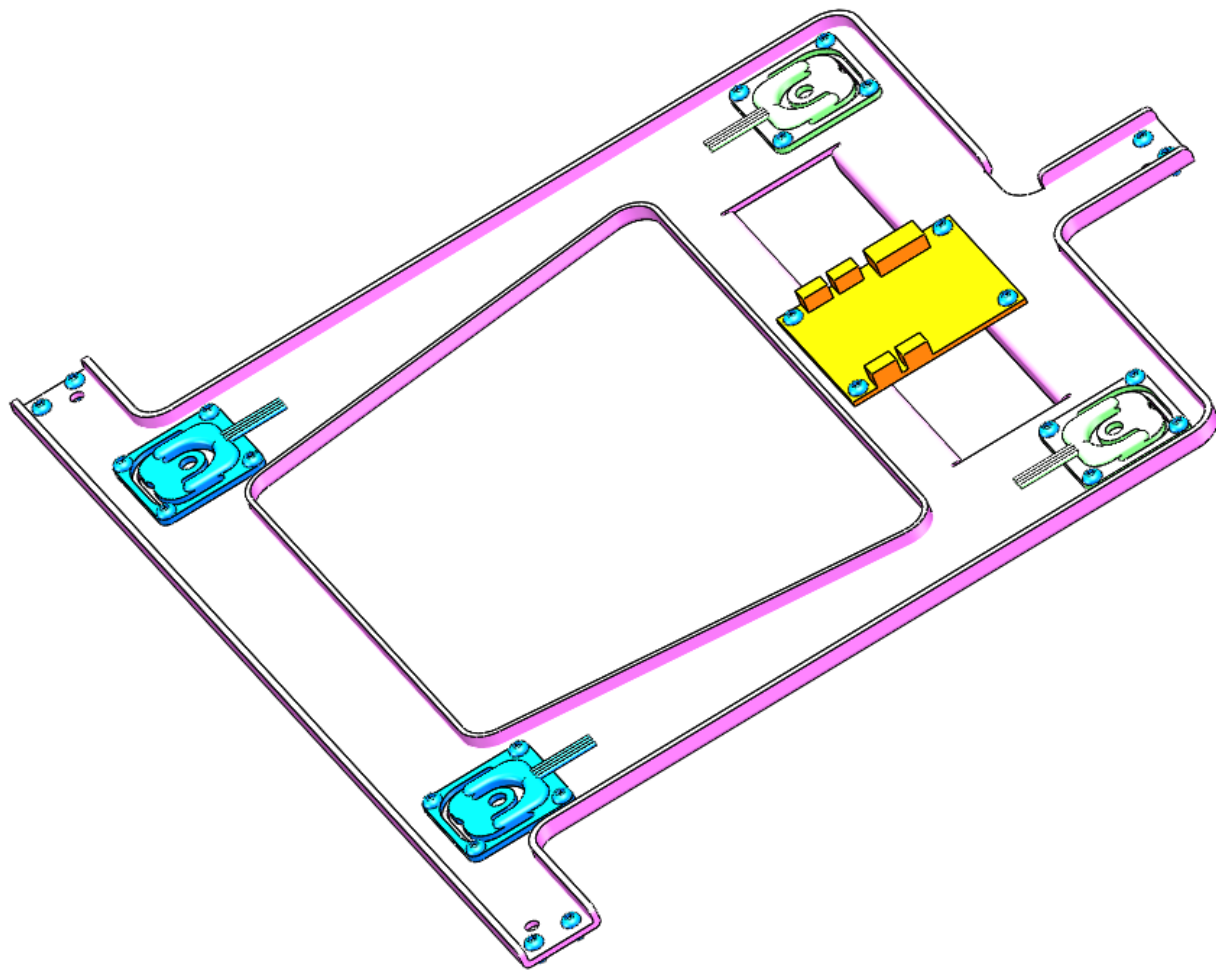


20.205.0137
热床支撑板金组件
Heated Bed Supporting Assembly



04.210.0020
Pressure Leveling
Sensor-Short Cable
Cat # 001779

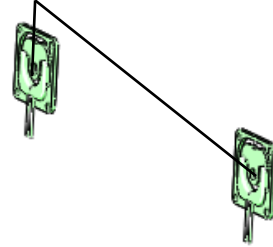


04.210.0025
Pressure Leveling
Sensor-Long Cable
Cat # 001780

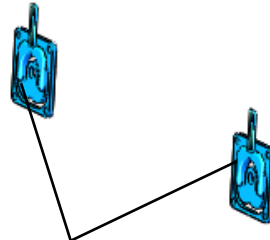


01.201.0047
Strain Gauge Adapter Board
Cat # 001783

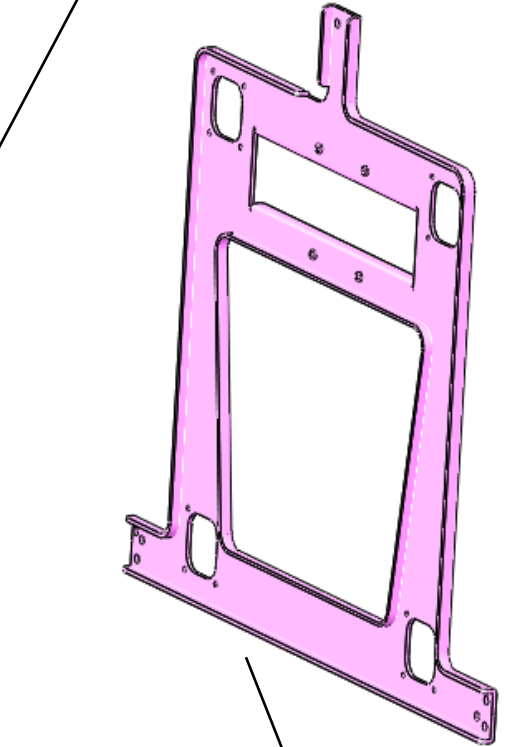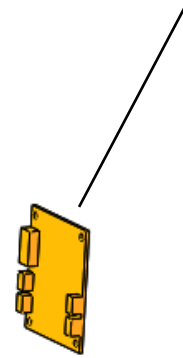


03.202.0116
热床支撑钣金-B版本
Metal Sheet Support of the
Heated Bed-B Version

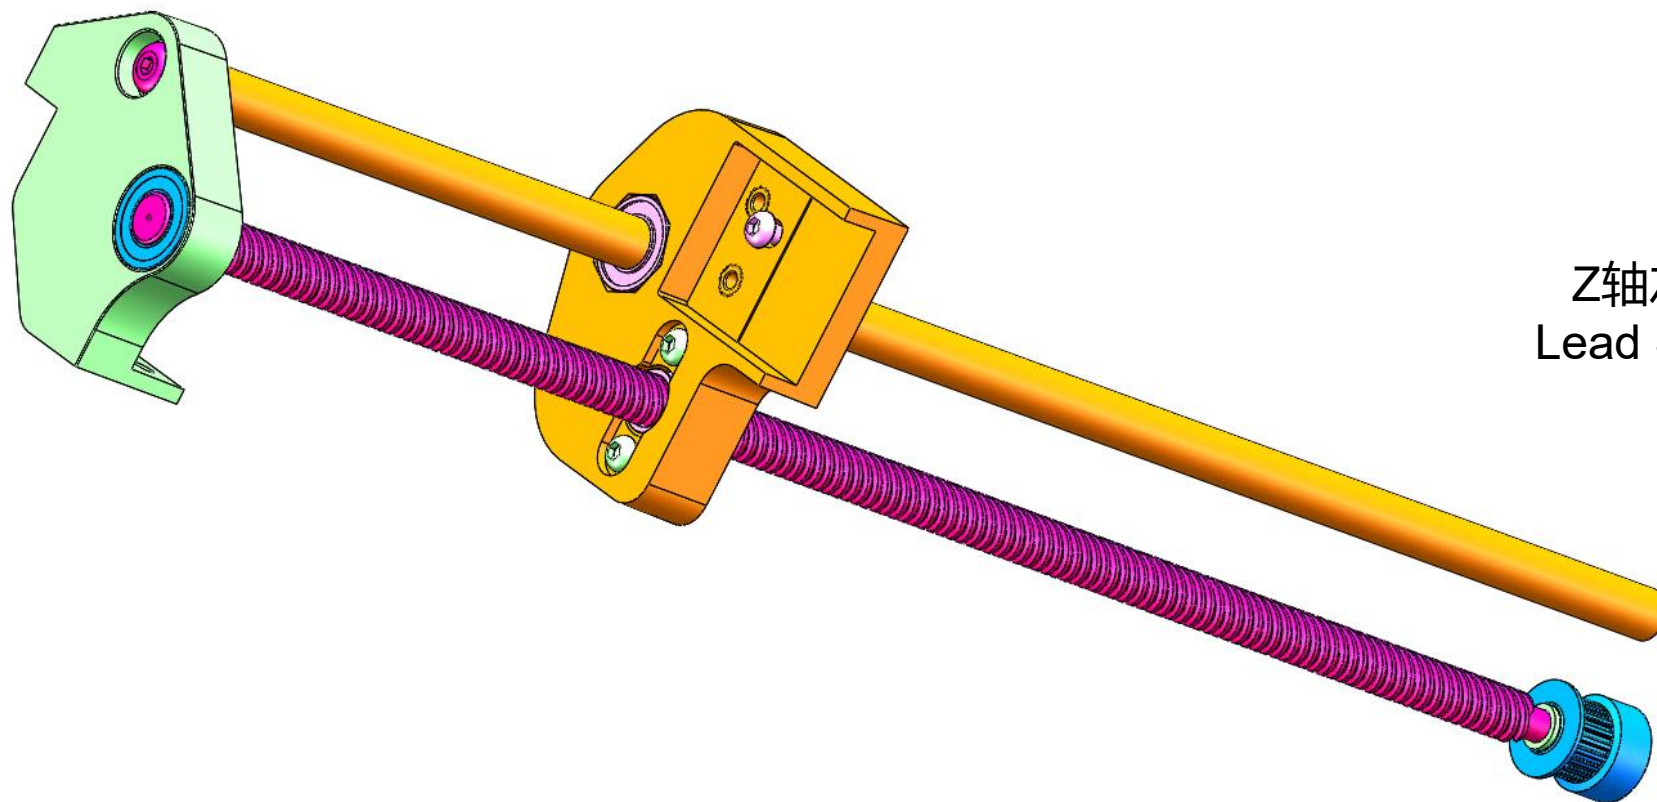


20.205.0130
Z轴左丝杆光轴组件Left Z-Axis
Lead Screw Plain Shaft Assembly

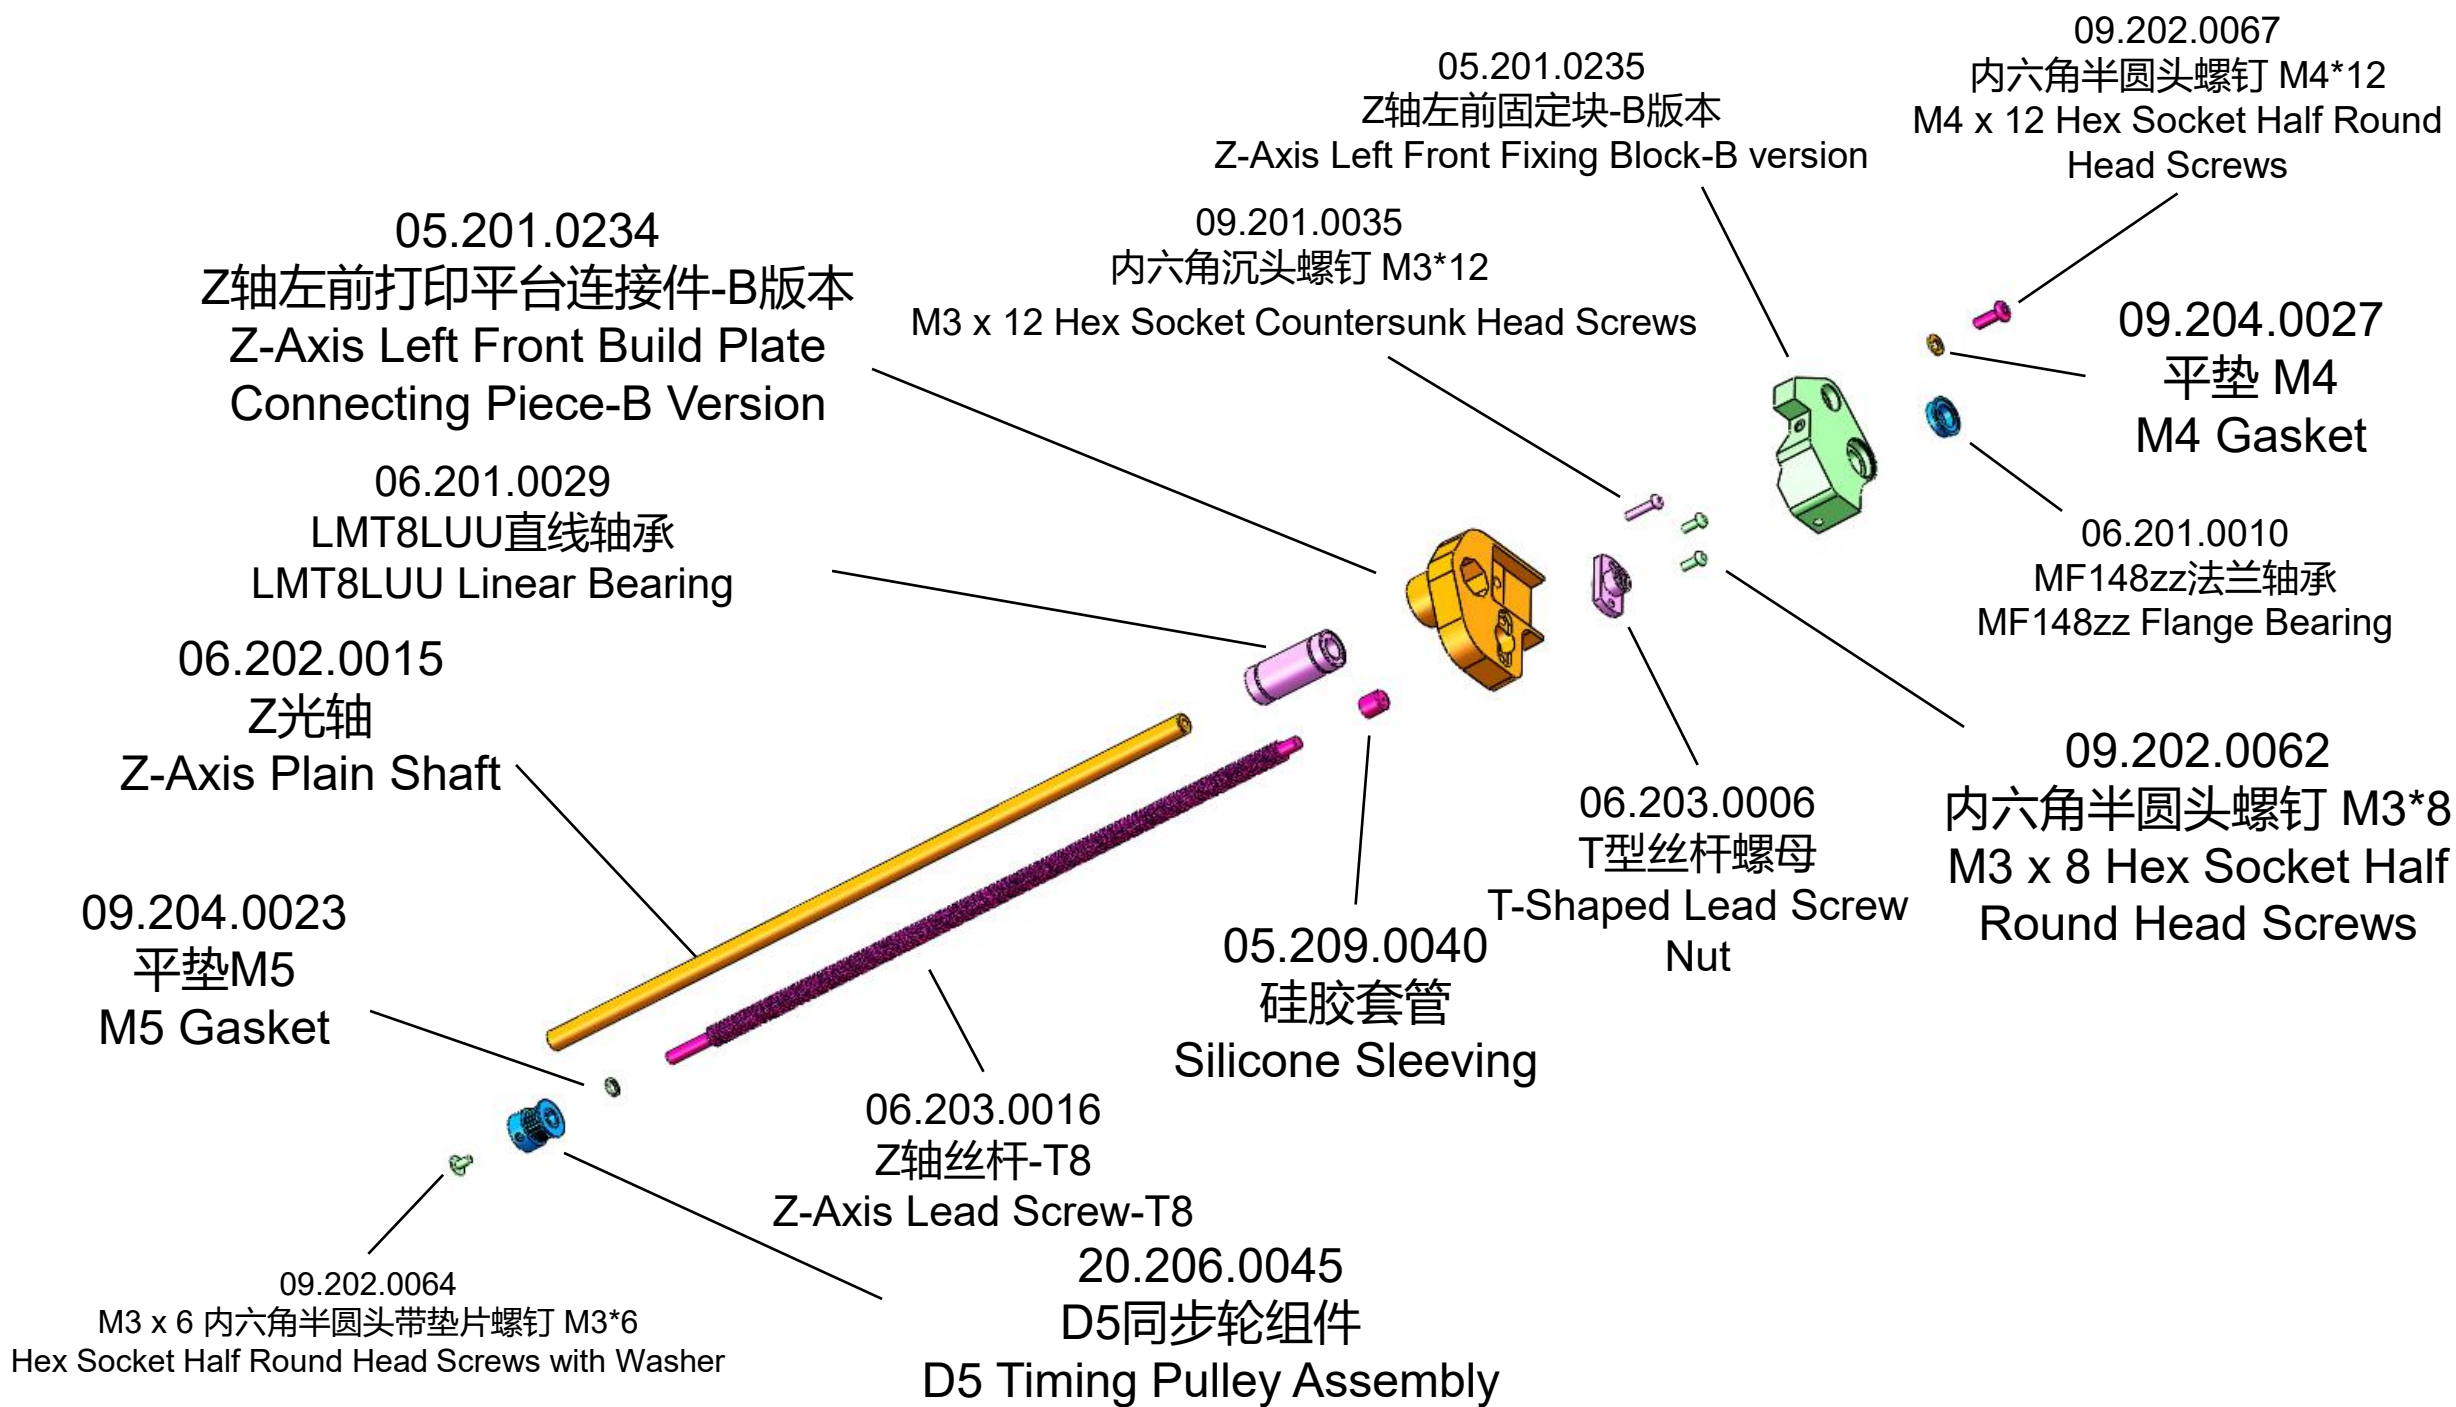



20.205.0131
Z轴右丝杆光轴组件
Z-Axis Right Lead Screw
Plain Shaft Assembly

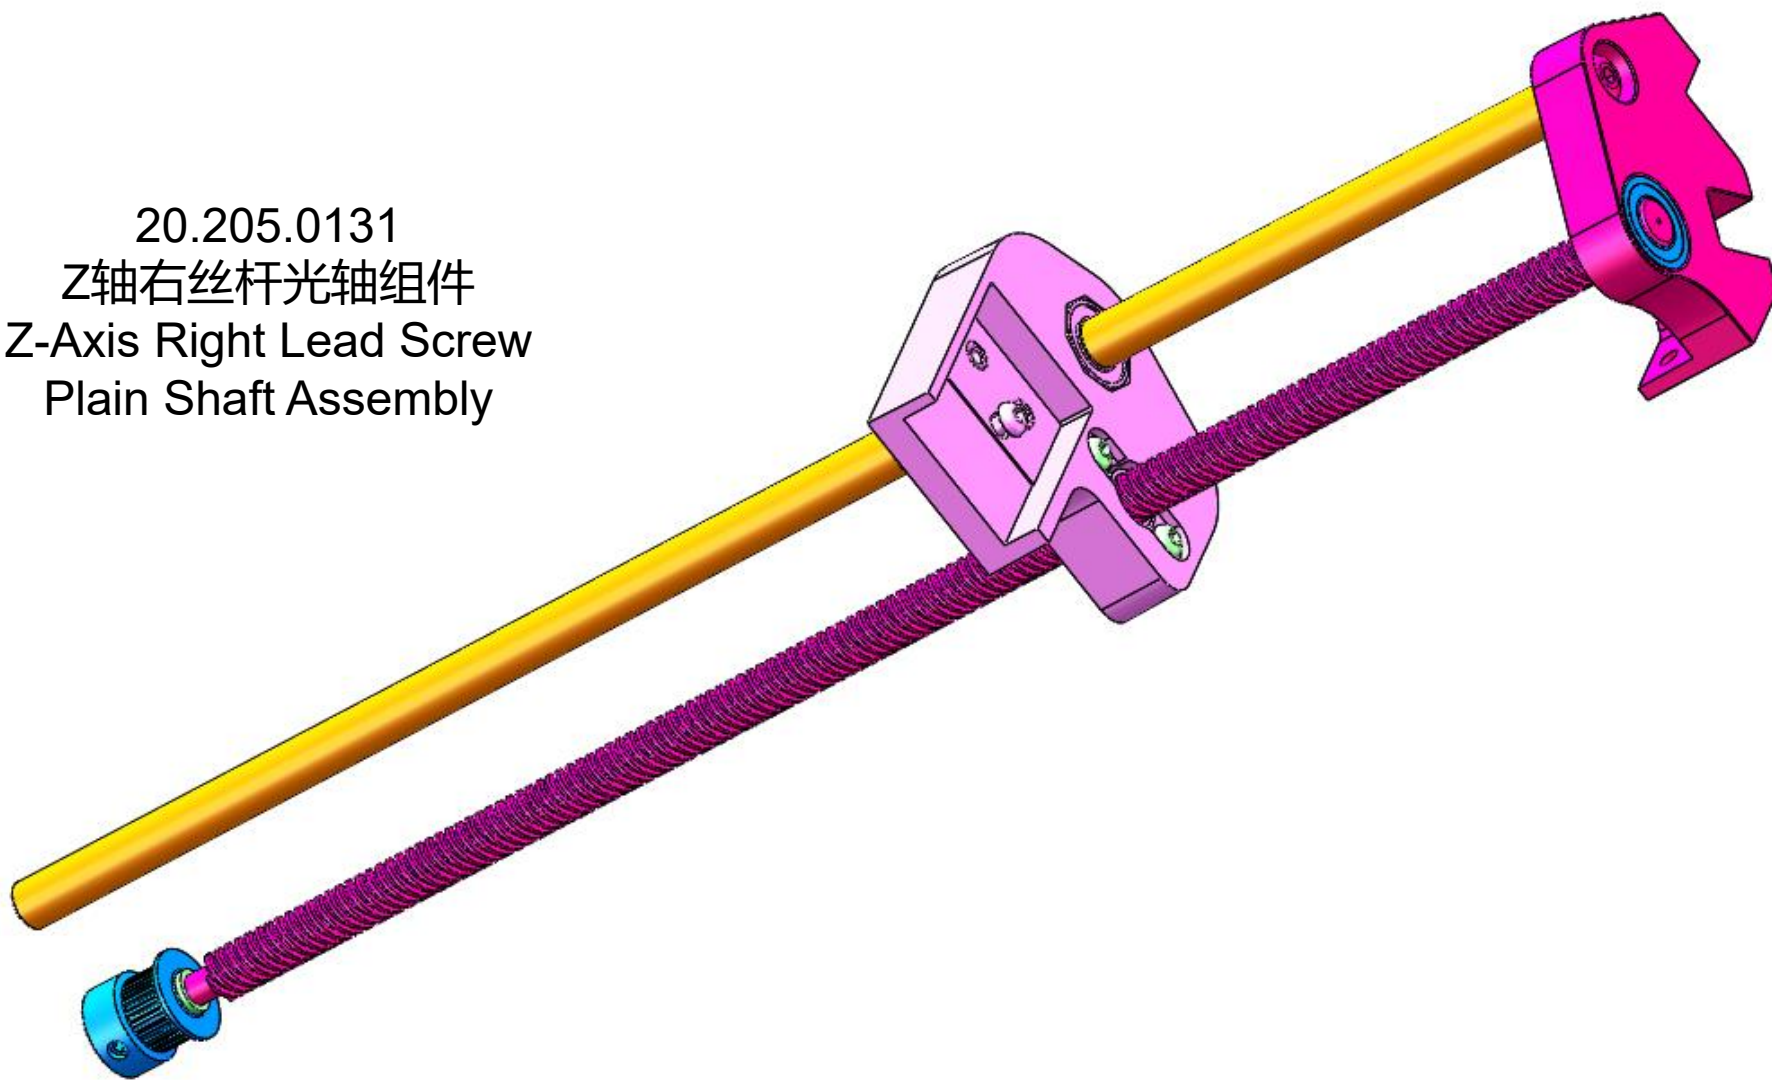


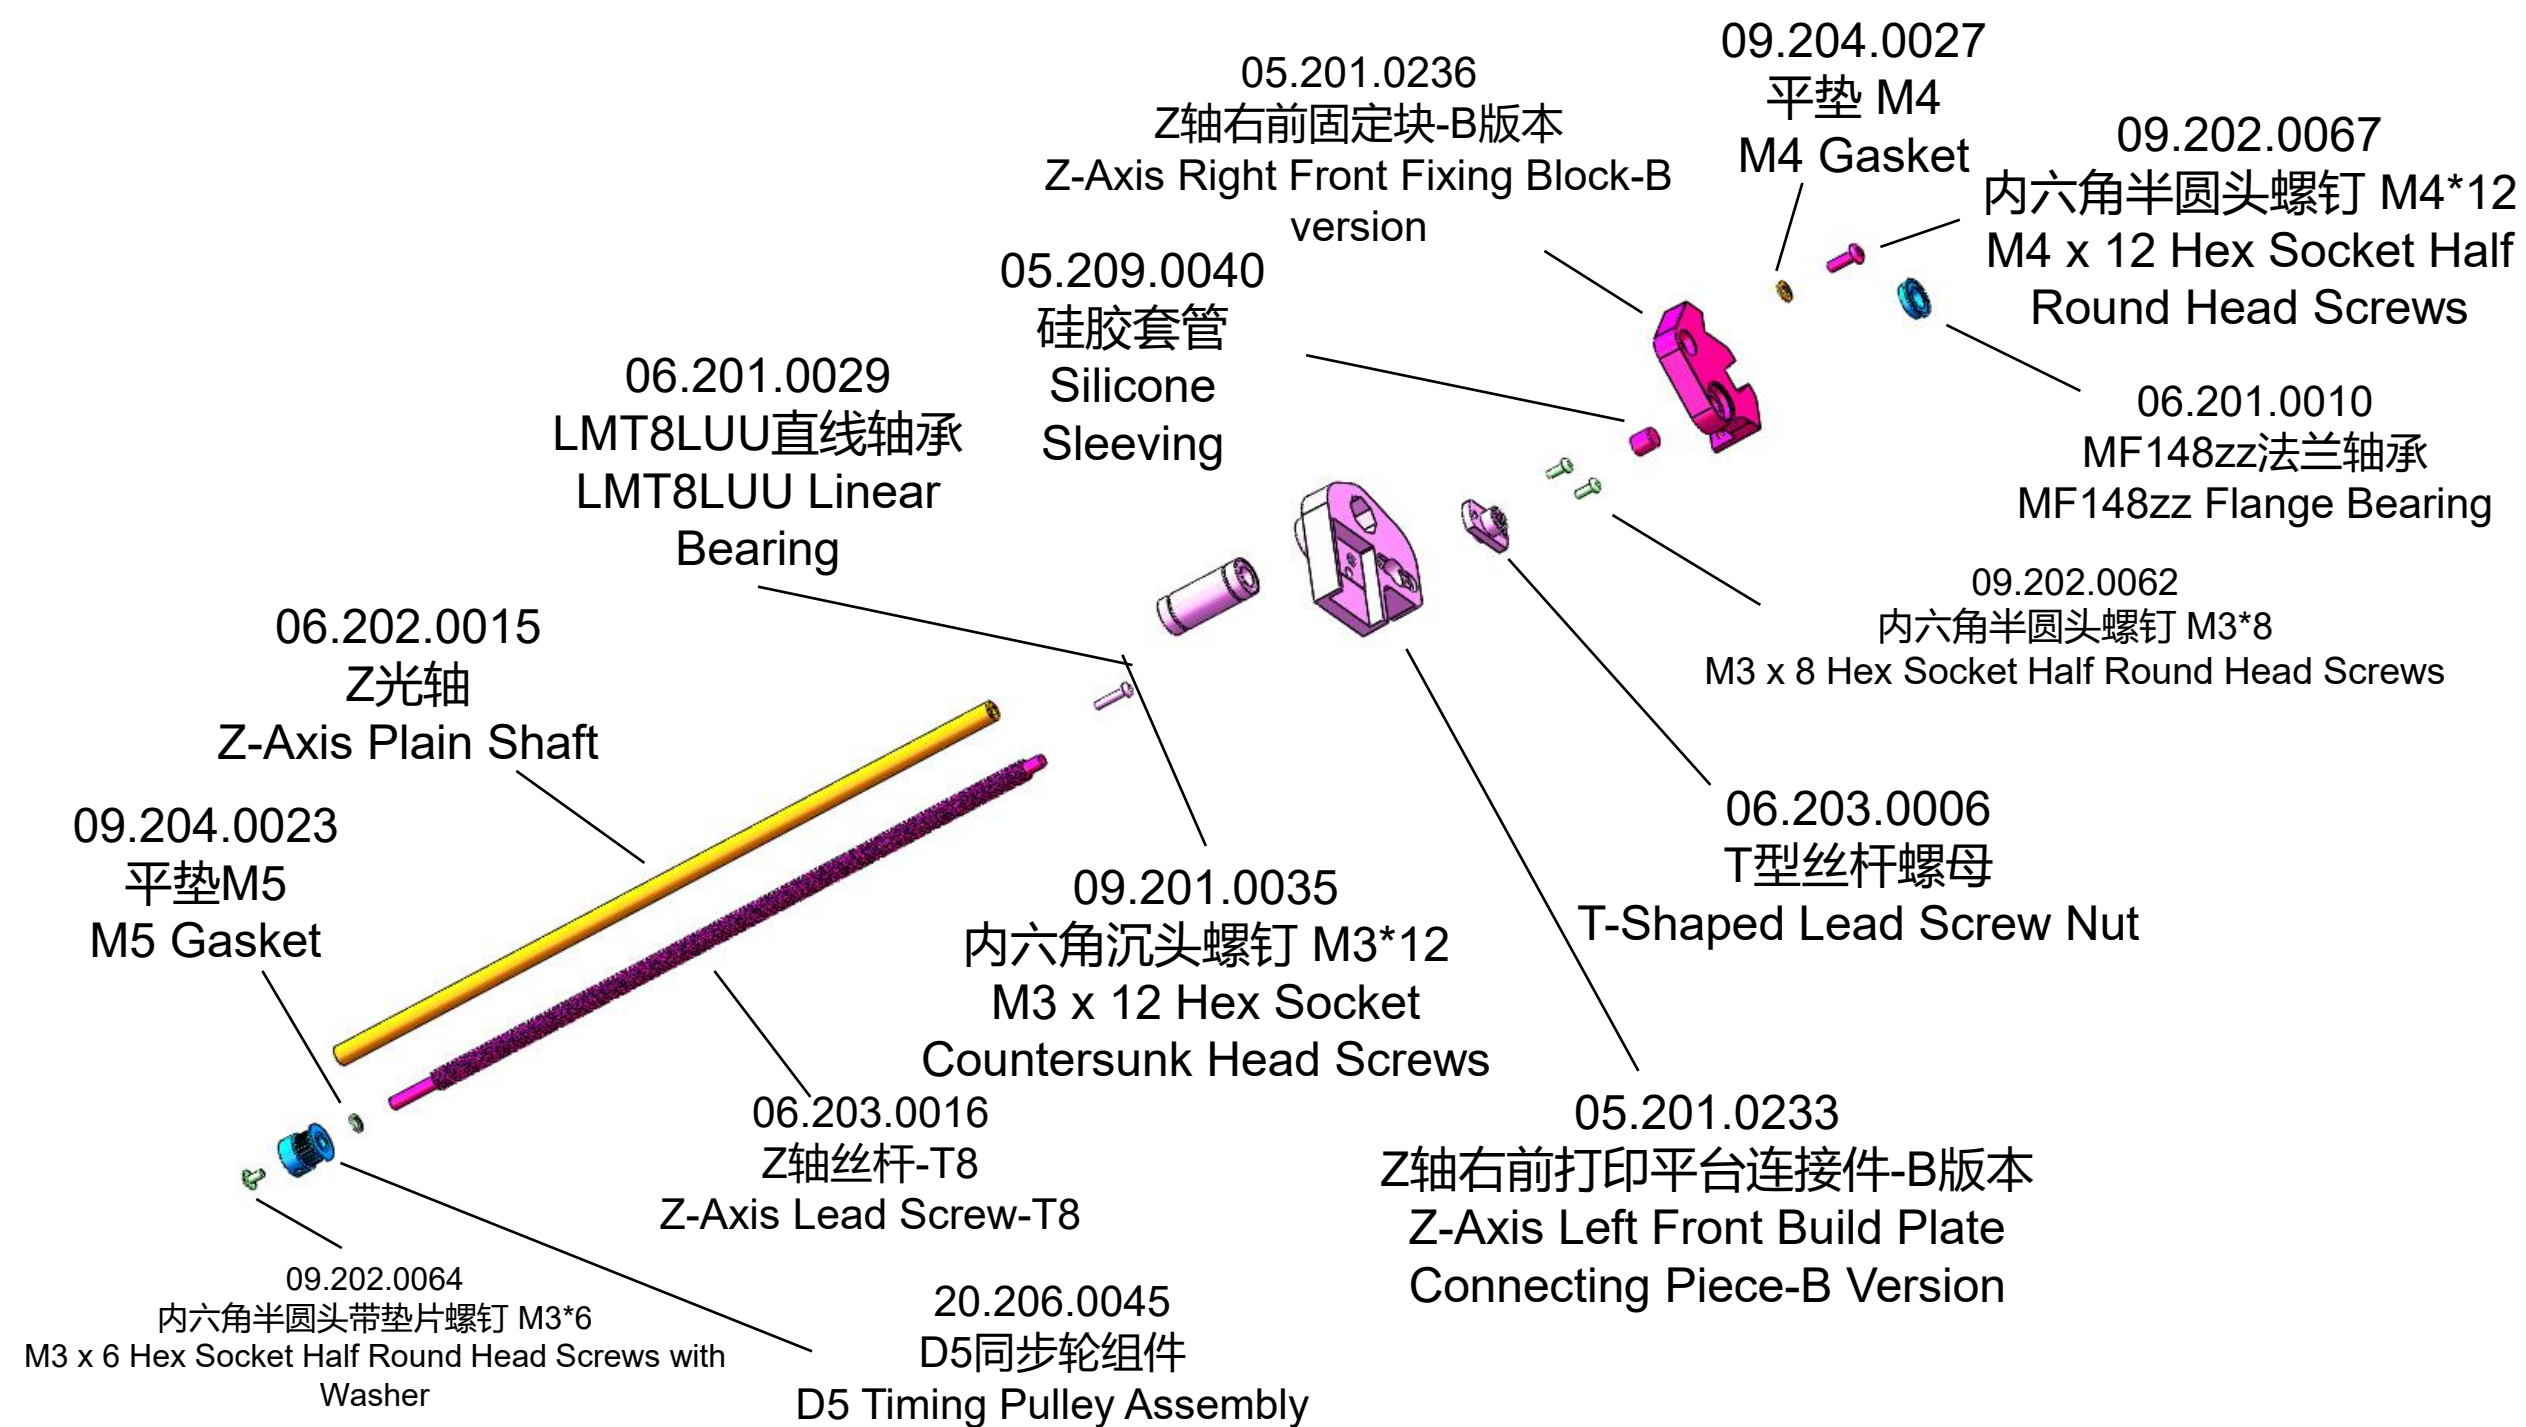

20.205.0132
Z轴后丝杆光轴组件
Z-Axis Rear Lead Screw Plain Shaft Assembly

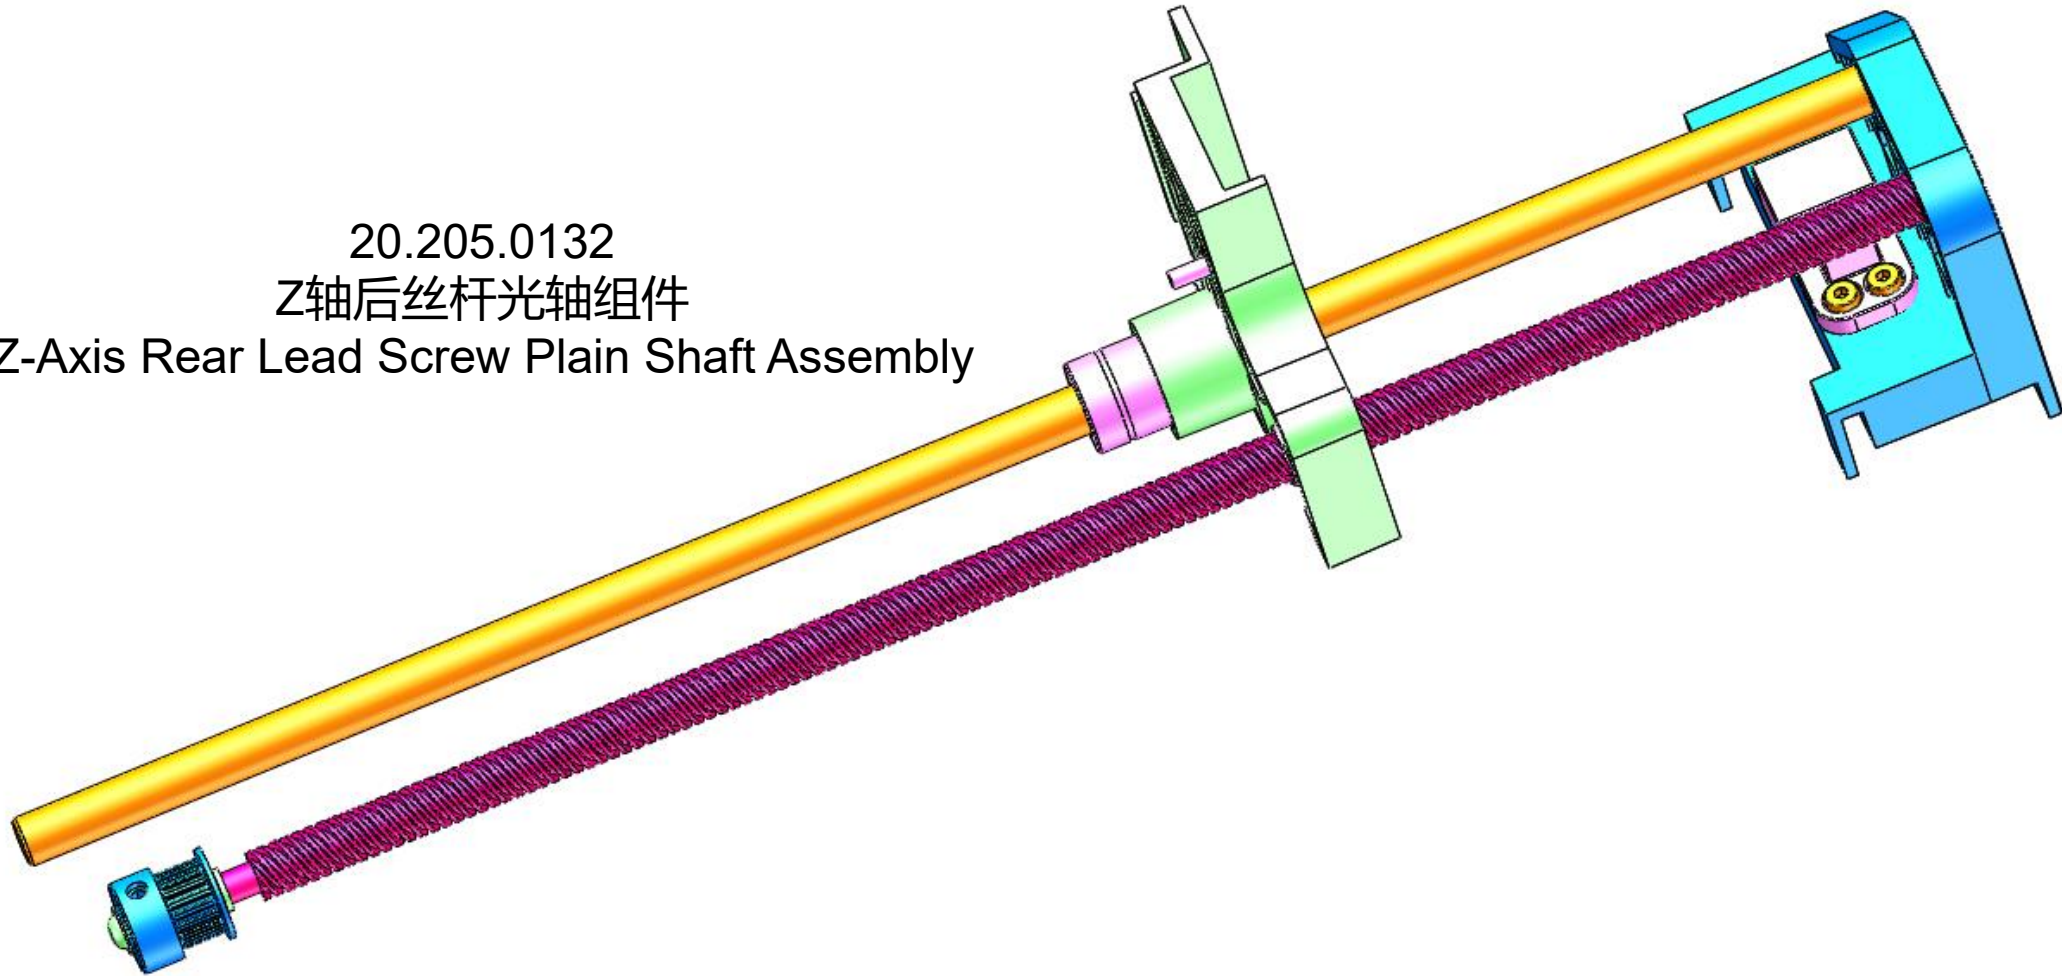

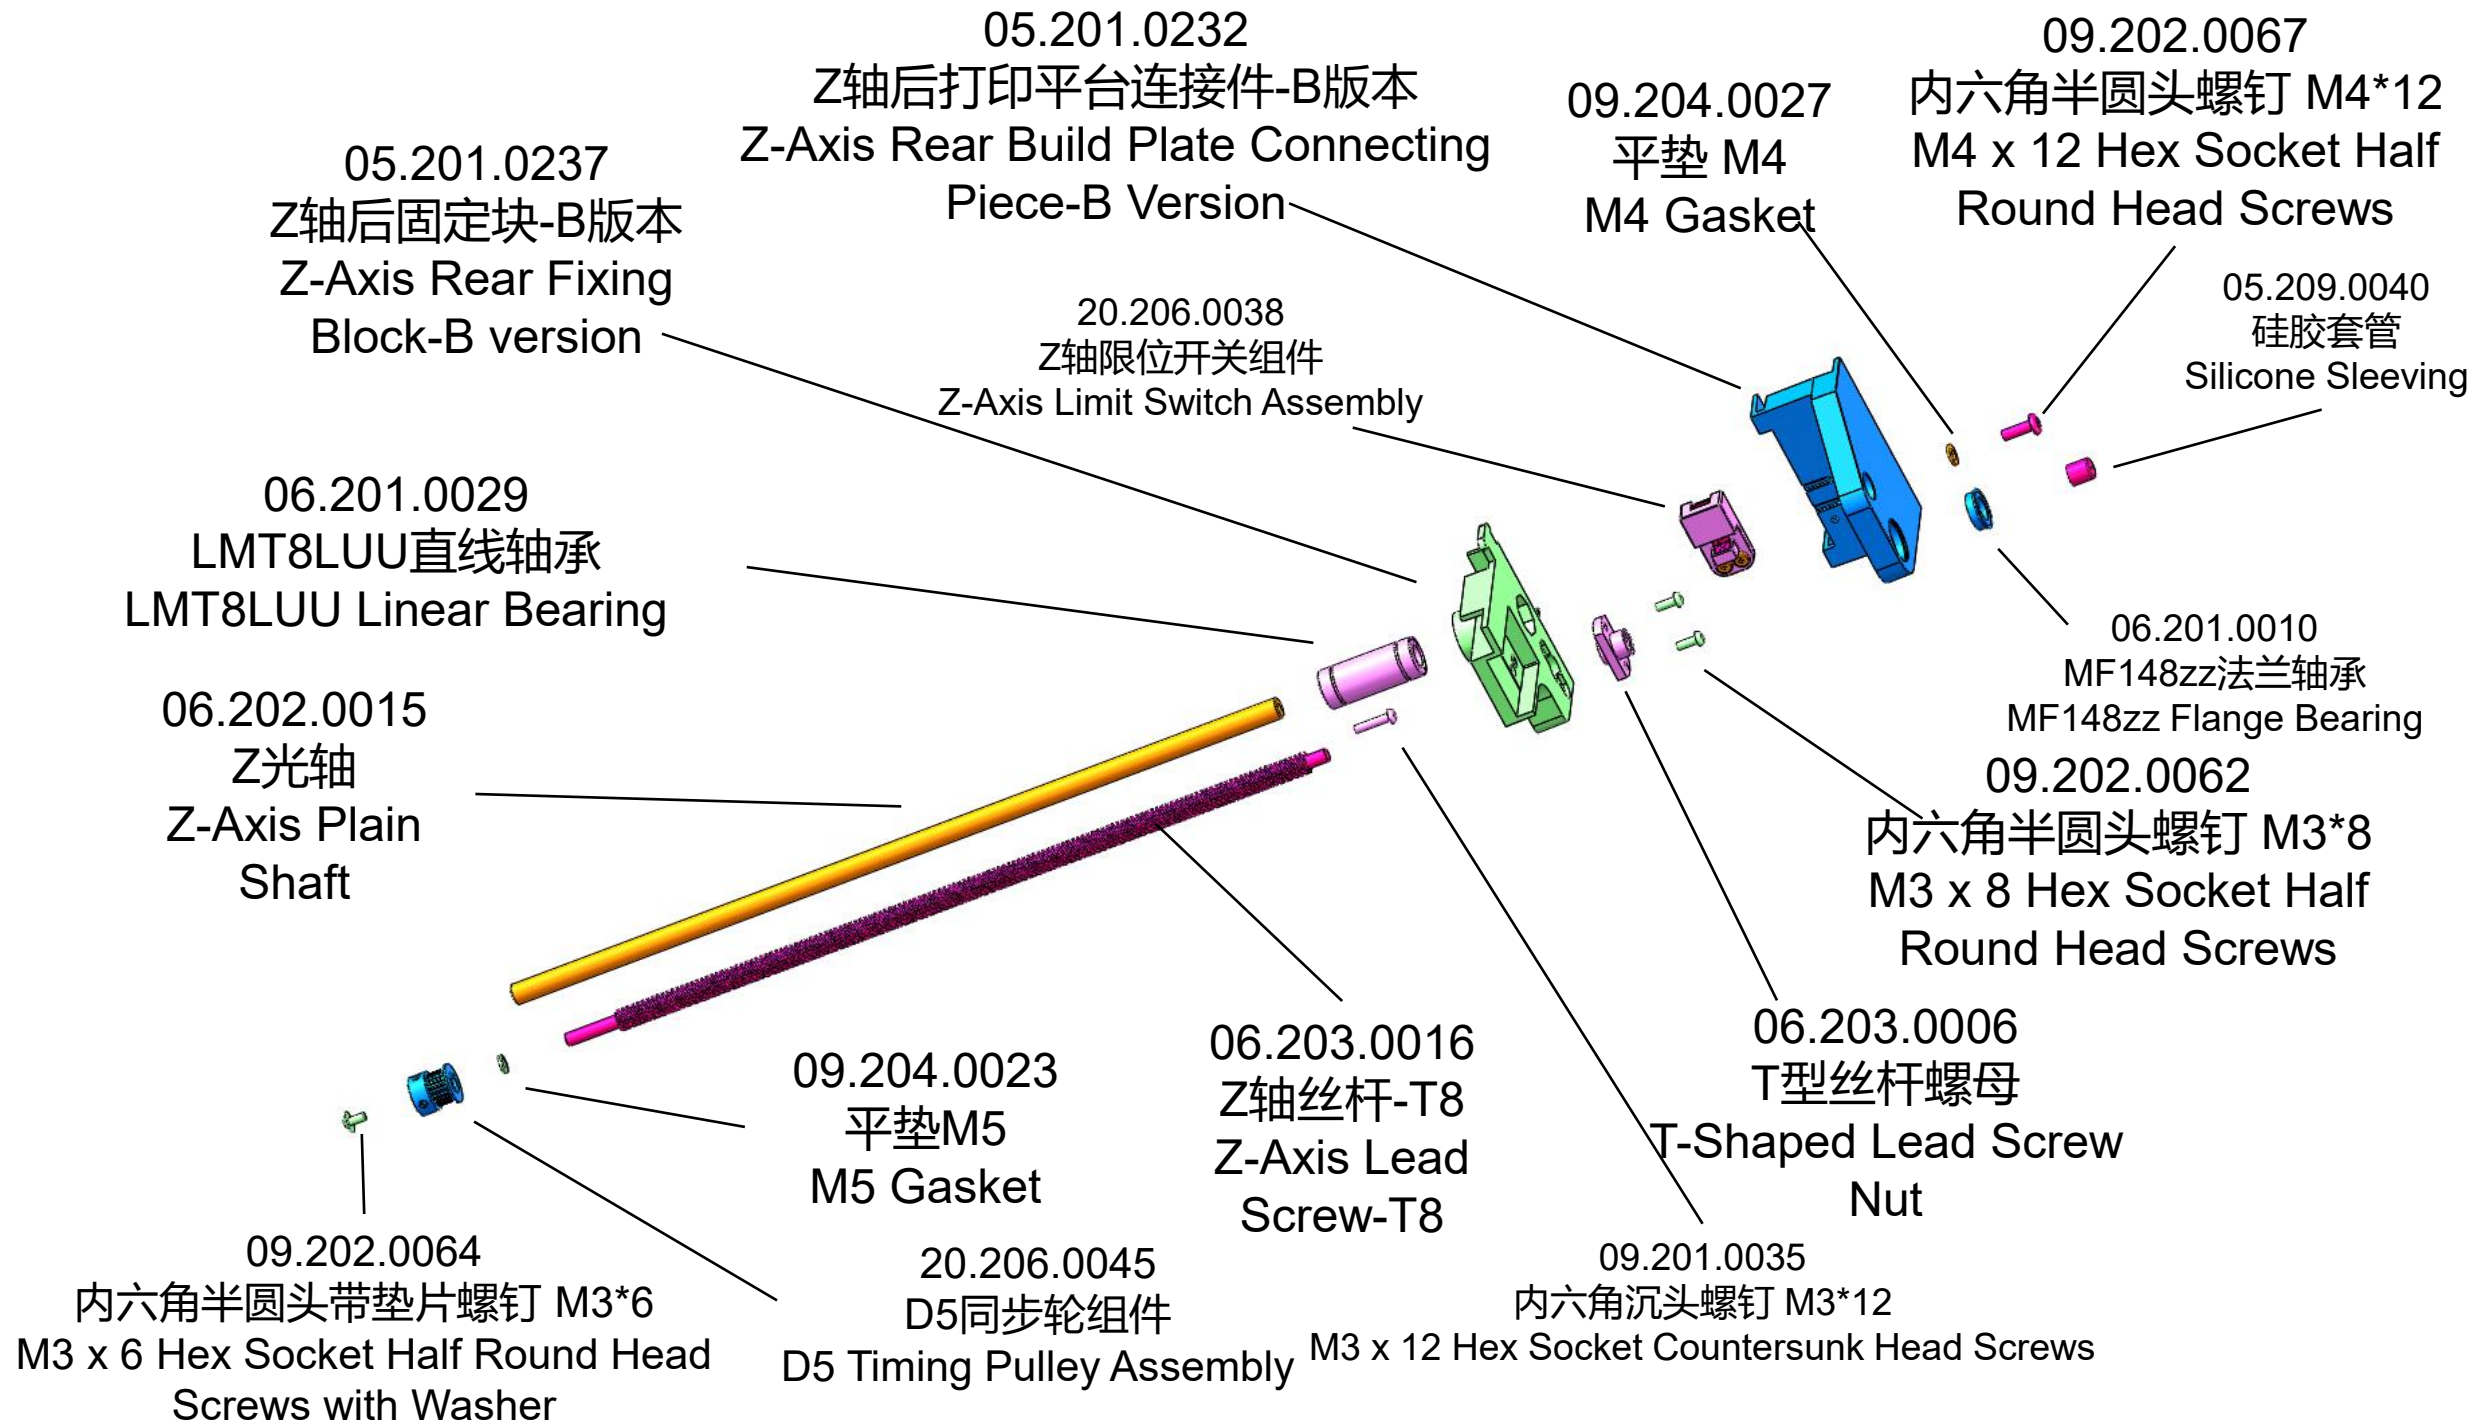


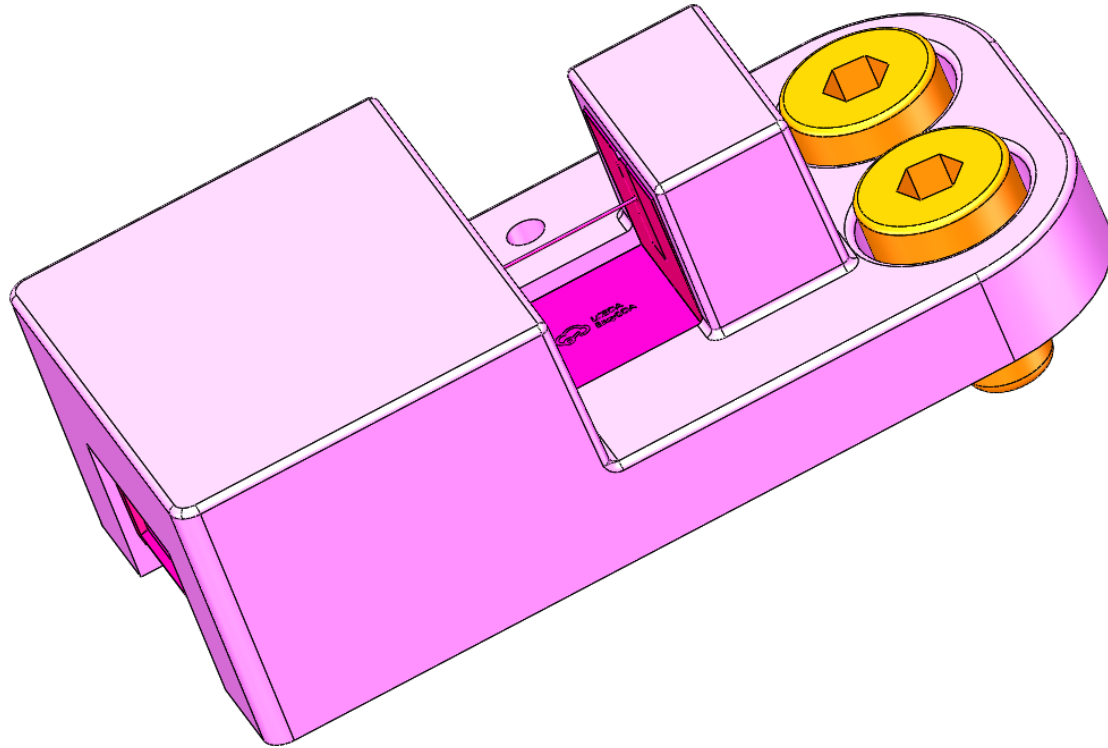


20.206.0038
Z-Axis Limit Switch
Cat # 001786



09.206.0025
圆柱头内六角平尾自攻螺钉 M3*5
M3 x 5 Flat Tail Hex Socket
Domed Head Tapping Screws

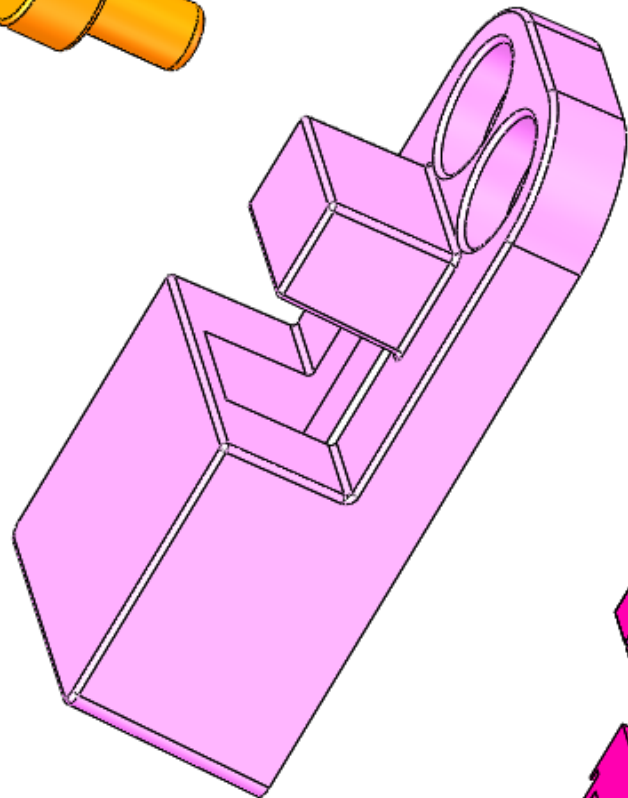

05.201.0231
限位开关外壳
Housing of the
Limit Switch

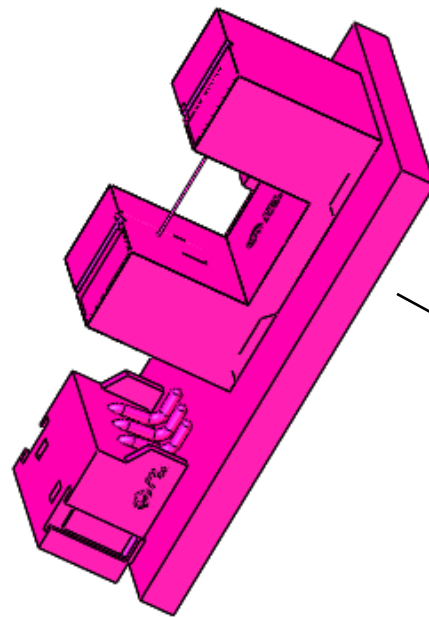

01.201.0055
调平光电开关
Photoelectrical Switch for
Leveling